

MARKET MAKER ASIA LTD

Inspection Report INR-2208001

CLIENT **MMBL**

DATE **15/10/2022**

SUPPLIER **KONKA**

FACTORY **DONGGUAN KONKA ELECTRONIC CO.,**

Inspection **PRE-SHIPMENT INSPECTION**

QC Man **Peter**

Colin

RESULT

PENDING

PO NUMBER	MODEL	Brand	QTY
DG21-BL0105	TCSAND32HDPR07	TV Smart 32 inch	Polaroid


AQL

Insp Type	Pre-Shipment inspection
Sampling Standard	ISO 2859-1 OR MIL-STD-105E
SampleSize	80

AQL Level II	CRI	MAJ	MIN
Found	0	0	1
Max	0	2	5

AQL Details

1 Tiny Impurity inside panel

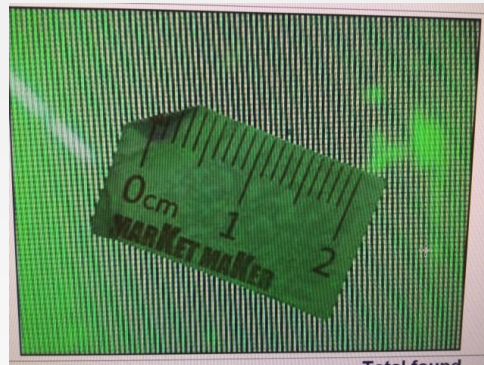

MIN
Qty 1

QUANTITY

	Lot Size	Finished Size	Sample Size	Number of Cartons	Number of Inspec CTN
Total	680	680	80	680	80
TCSAND32HDPR07	680	680	80	680	80

DIMENSION

Item	Unit	Spec	Sample1	Sample2	Sample3	Sample4	Sample5
Screen size	Inch	32	31,7	31,7	31,7	31,7	31,7
Unit size	mm	732*19	730x19	730x19	731x19	730x19	730x19

WEIGHT

Item	Unit	Spec	Value	Material
Component weight inside GB	g	166		
GB weight empty	g	983		

Inspection Report INR-2208001

Polybag weight	g	28		
Unit Wight without Battery	g	3696		

REMARKS /FINDINGS

1. Quantity

PASSED

1.1 Quantity Breackdown and capacity

PASSED

2. Packaging

2.1 ★ Metal stapels used on Carton / GB

2.4 ★ No Warranty registration card

There wasn't a piece of polyfoam place din front of panel

2.5 Carton drop test was conducted as per factory standard (65 cm heigt 2 corner 2 edges 85 cm height 3 sides) not MMBL standard (30 inches height 1 corner 3 edges 6 sides), the test result was passed

PENDING

2.1 Cartons Packing

★ Metal stapels used on Carton / GB

FAILED

2.2 Carton Size

785x117x500

PASSED

2.3 Carton Gross Weight

About 4,86 kg

PASSED

2.4 Unit Packing

★ No Warranty registration card

There wasn't a piece of polyfoam place din front of panel

FAILED

2.5 Drop Test

Carton drop test was conducted as per factory standard (65 cm heigt 2 corner 2 edges 85 cm height 3 sides) not MMBL standard (30 inches height 1 corner 3 edges 6 sides), the test result was passed

PENDING

2.6 Shipping Marks

NA

3. User Manual and marking

PASSED

3.1 Paper Quality & Page Number 4 languages UM

PASSED

3.2 Correct assembly of UM

PASSED

3.3 Declaration of conformity

PASSED

4. Product Specifications

4.2 ★ Not UV coating on all pictures and logos

PENDING

4.1 Color of product

PASSED

4.2 Check finishing

★ Not UV coating on all pictures and logos

FAILED

4.3 Barcode scanning

PASSED

4.4 Check Conformity of markings

SPL Logo on RL is about 7mm high I/O 8 mm

FAILED

4.5 Dimensions

PASSED

4.6 Rub test

PASSED

4.7 Appearance

PASSED

5. Functionnal testing

5.6 The model chipset couldn't be checked

Power plus is not same as sample

5.11 80 pcs inspected : found 1 bad dot on panel x 1

5.14 Didn't cancel "KONKA" character on netflix ESN mode

RC is not BT but pairing step on UM and first install

PENDING

5.1 Battery Fitness check

PASSED

5.2 Assembly test

PASSED

5.3 Fatigue test

PASSED

5.4 Accessories test

PASSED

Inspection Report INR-2208001

5.5	Hi-Pot test		PASSED
5.6	Internal Check	The model chipset couldn't be checked Power plus is not same as sample	PENDING
5.7	Software Check		PASSED
5.8	Burning Test		PASSED
5.9	Power consumption		PASSED
5.10	Pull Test		PASSED
5.11	Panel Dot Checking	80 pcs inspected : found 1 bad dot on panel x 1	PENDING
5.12	Stability Test		PASSED
5.13	Remote controle test		PASSED
5.14	Function test	Didn't cancel "KONKA" character on netflix ESN mode RC is not BT but pairing step on UM and first install	PENDING
6. Spare Parts			PASSED
6.1	Spare Part	Spare part ready for inspection	PASSED
7. Bribery Issue & declaration			PASSED
7.1	Bribery issue & delcaration of supplier		PASSED

MARKET MAKER ASIA LTD

Picture Report INR-2208001

PO NUMBER

DG21-BL0105

MODEL

TCSAND32HDPR07

DESCRIPTION

TV Smart 32 inch

Brand

Polaroid

QTY


680

1. QUANTITY

PASSED

1.1 / Quantity - Quantity Breakdown and capacity

PASSED

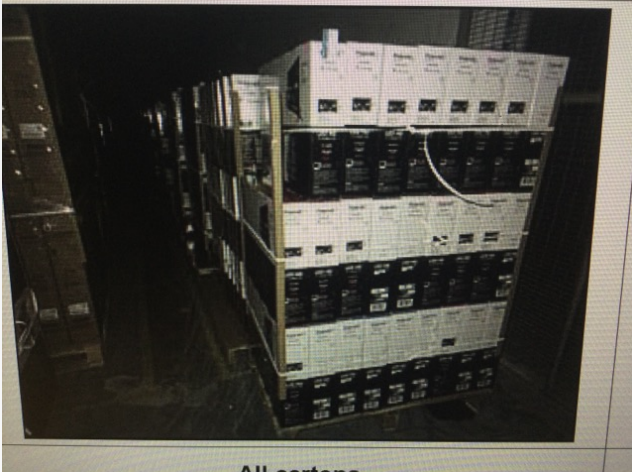

10/08/2022 00:00:35

All cartons



10/08/2022 00:00:36

All cartons



10/08/2022 00:00:36

Inspected cartons



10/08/2022 00:00:36

Inspected cartons

2. PACKAGING

PENDING

2.1 / Packaging - Cartons Packing

FAILED


★ Metal stapels used on Carton / GB





2.2 / Packaging - Carton Size

PASSED

785x117x500

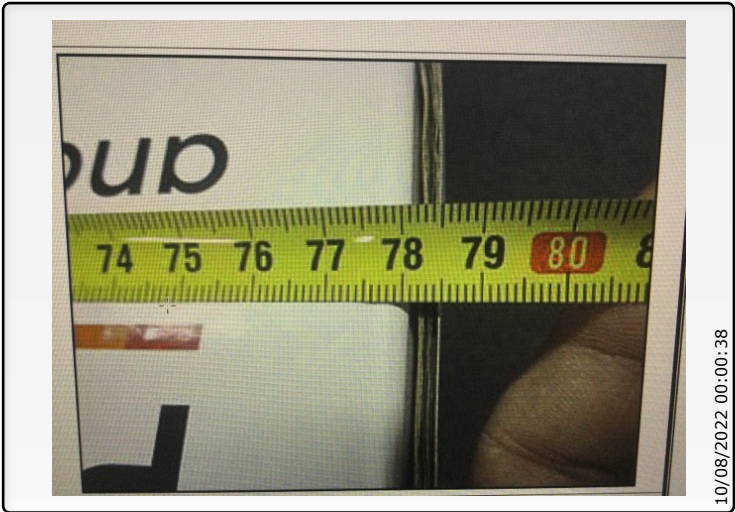

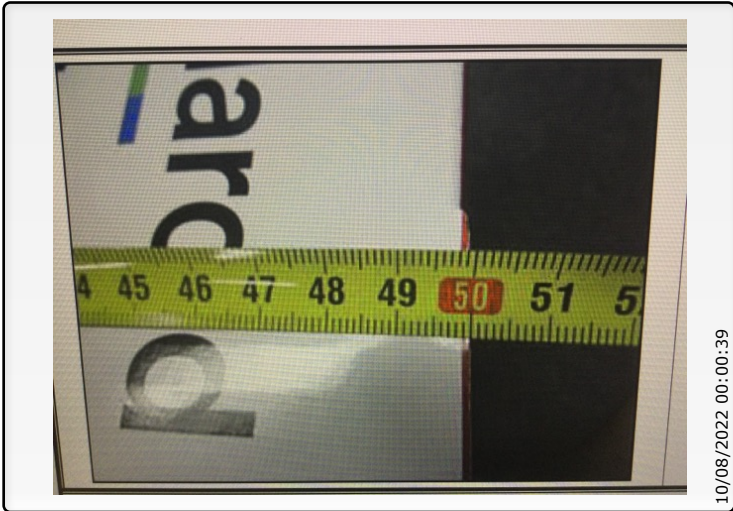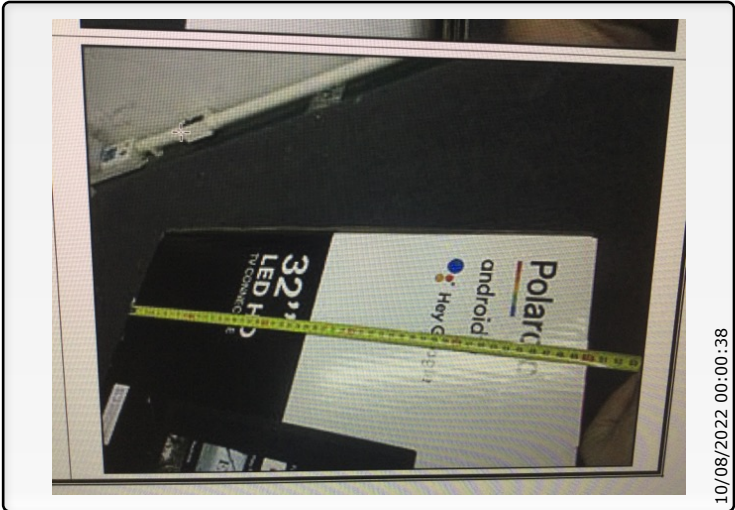

2.3 / Packaging - Carton Gross Weight

PASSED

About 4,86 kg



2.4 / Packaging - Unit Packing

FAILED


★ No Warranty registration card
There wasn't a piece of polyfoam place din front of panel




10/08/2022 00:00:39



10/08/2022 00:00:40

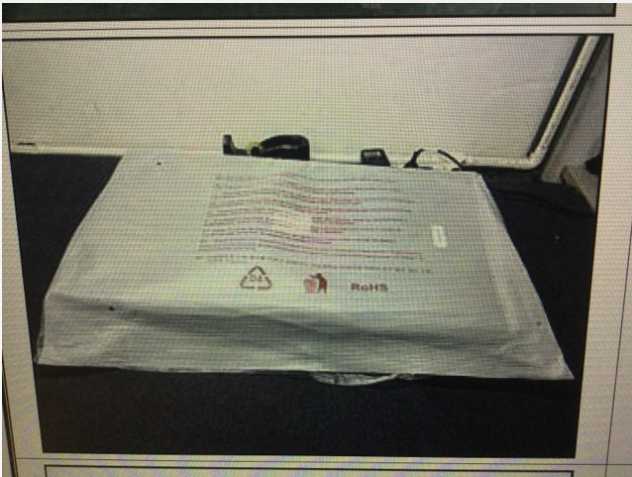


10/08/2022 00:00:40

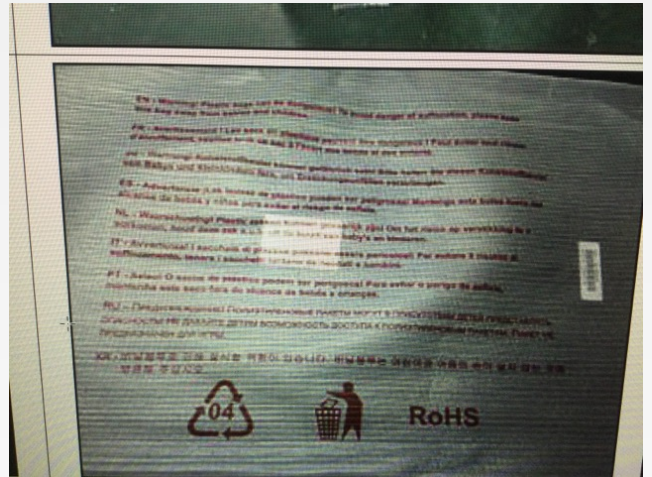




10/08/2022 00:00:40






10/08/2022 00:00:40

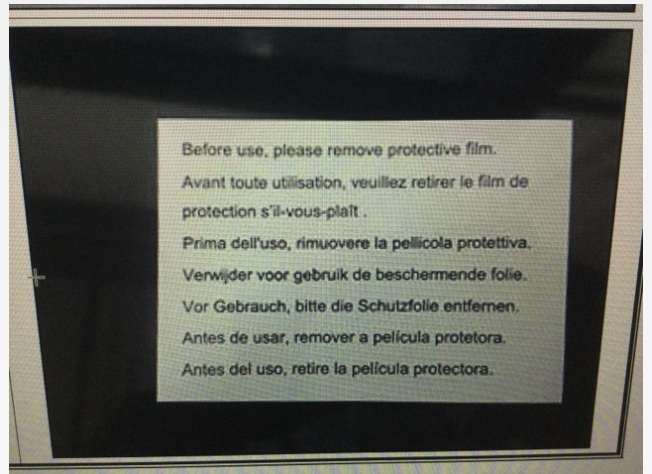

10/08/2022 00:00:41

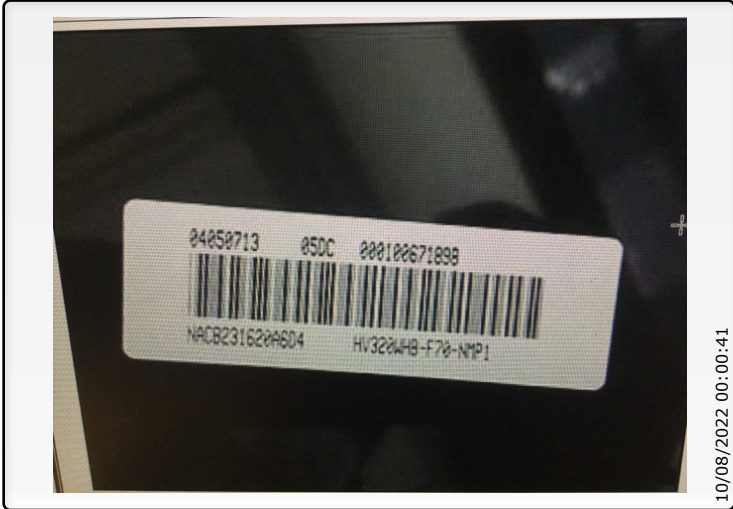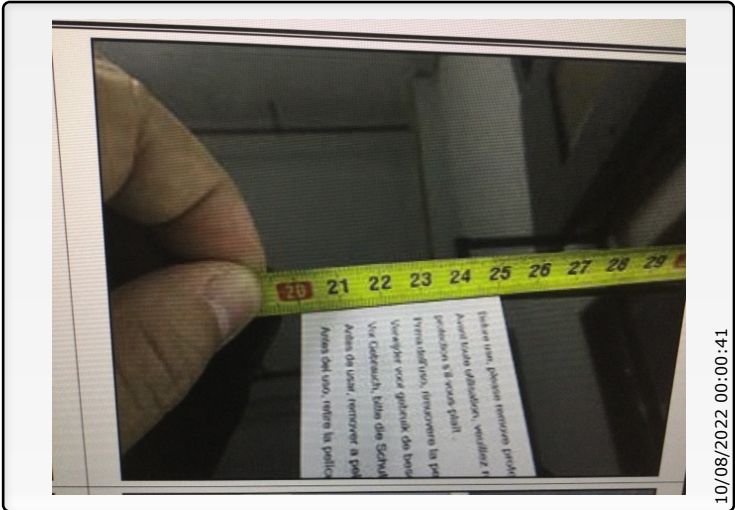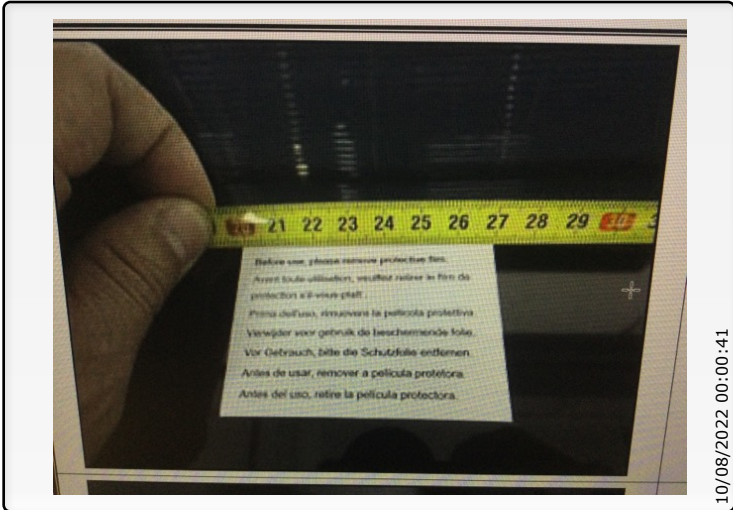

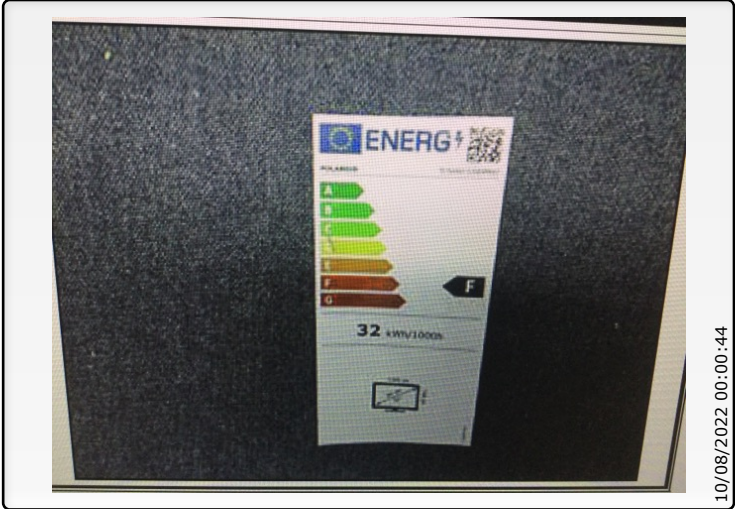

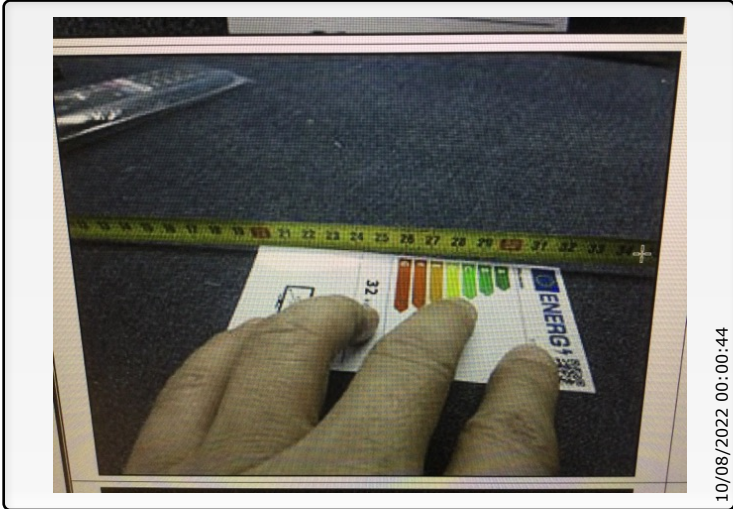
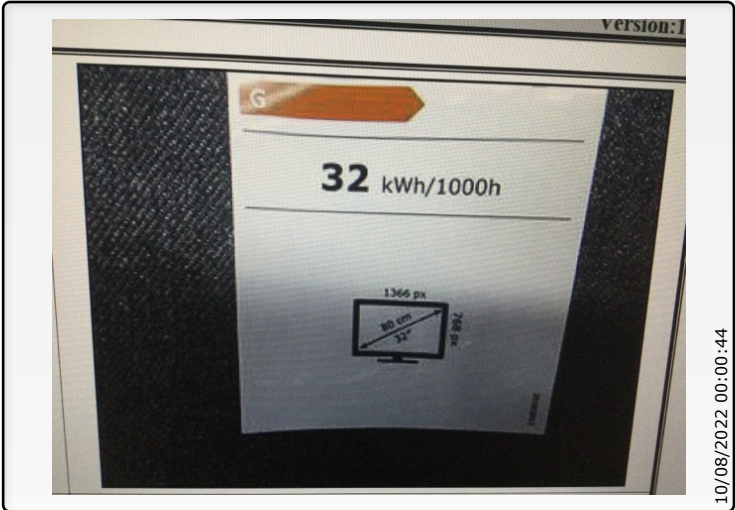



Picture Report INR-2208001



2.5 / Packaging - Drop Test PENDING

Carton drop test was conducted as per factory standard (65 cm height 2 corner 2 edges 85 cm height 3 sides) not MMBL standard (30 inches height 1 corner 3 edges 6 sides), the test result was passed

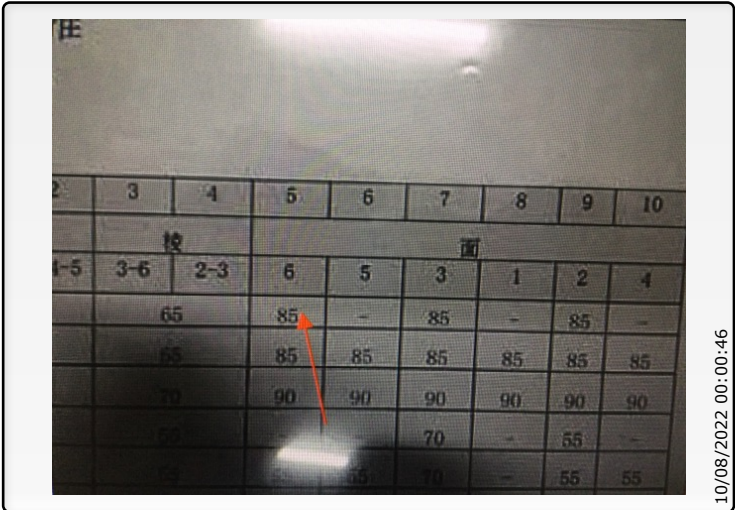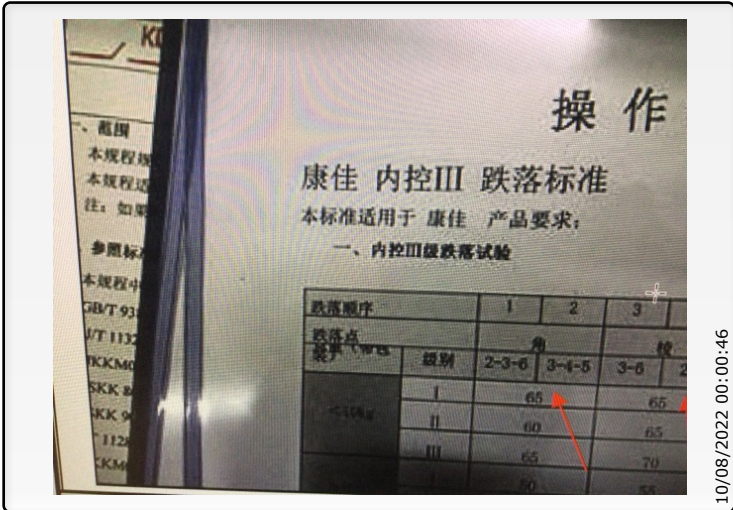


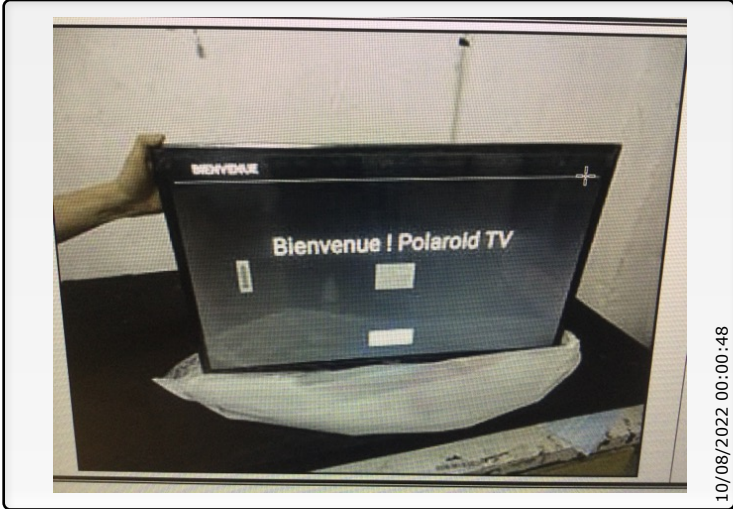




Moyenne



Faible

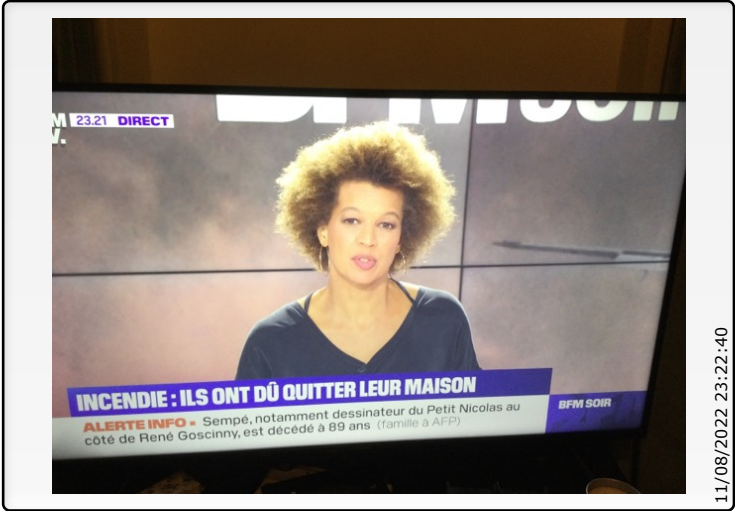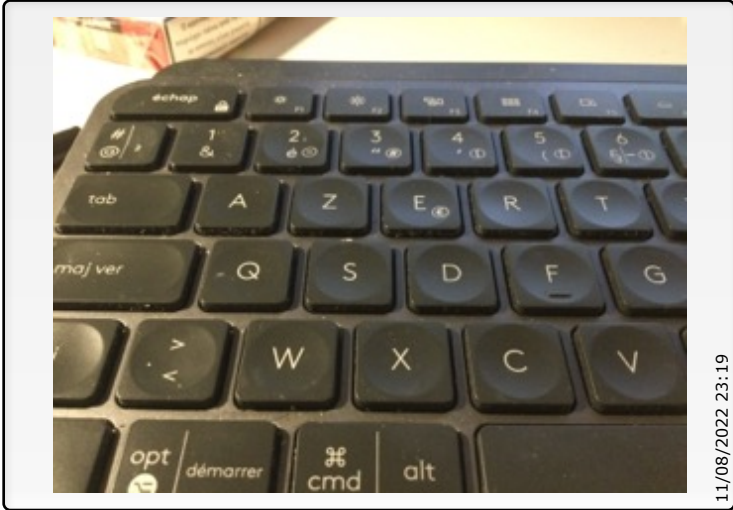







3. USER MANUAL AND MARKING

PASSED

3.1 / User Manual and marking - Paper Quality & Page Number


PASSED

4 languages UM

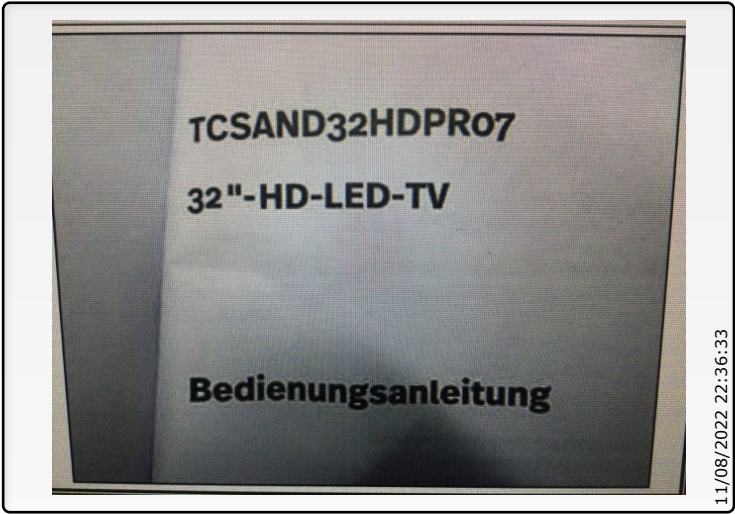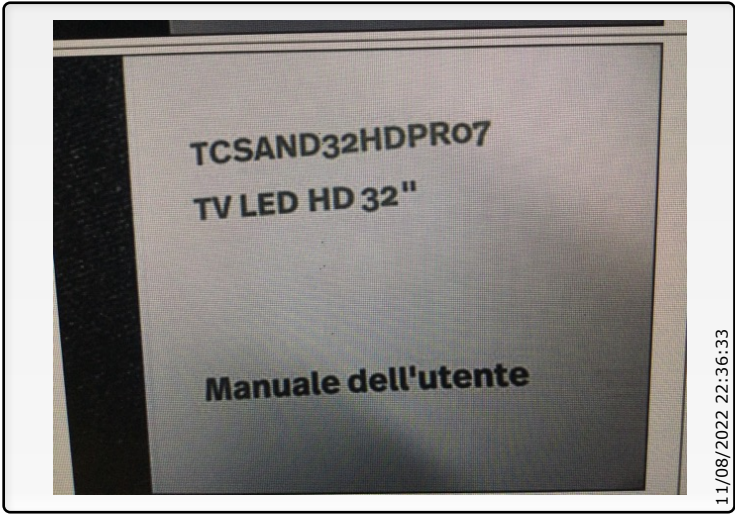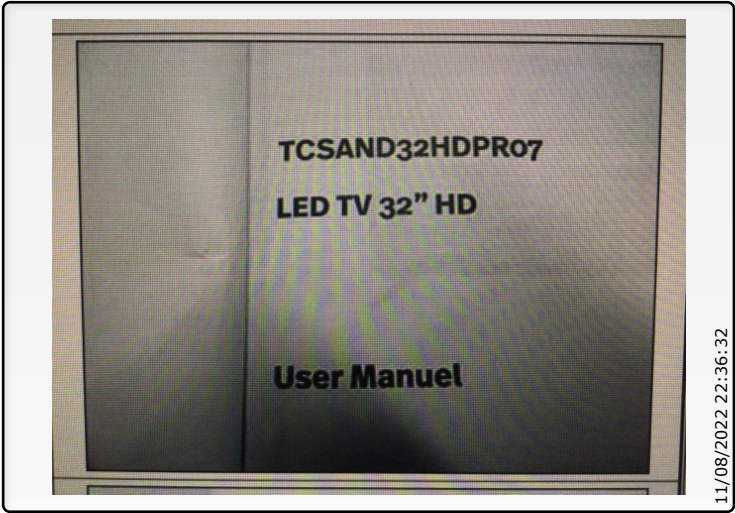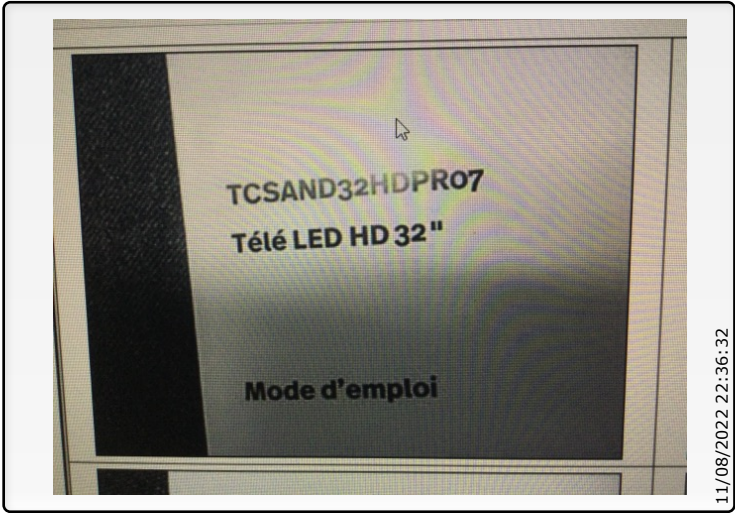


3.2 / User Manual and marking - Correct assembly of UM


PASSED

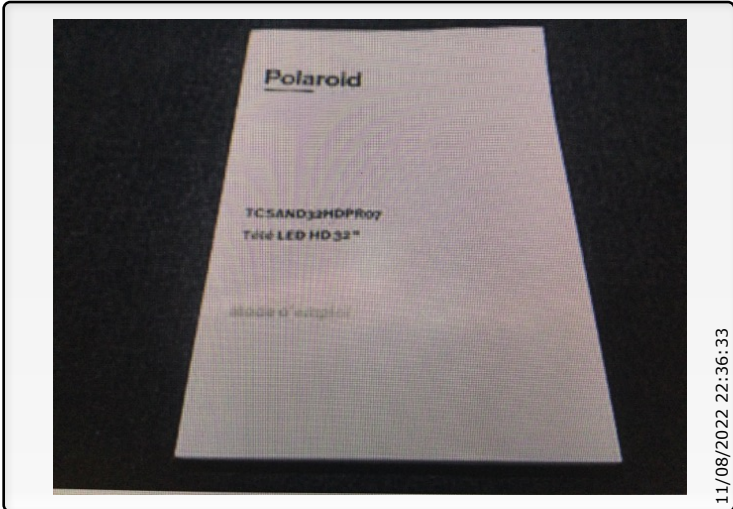


11/08/2022 22:36:33

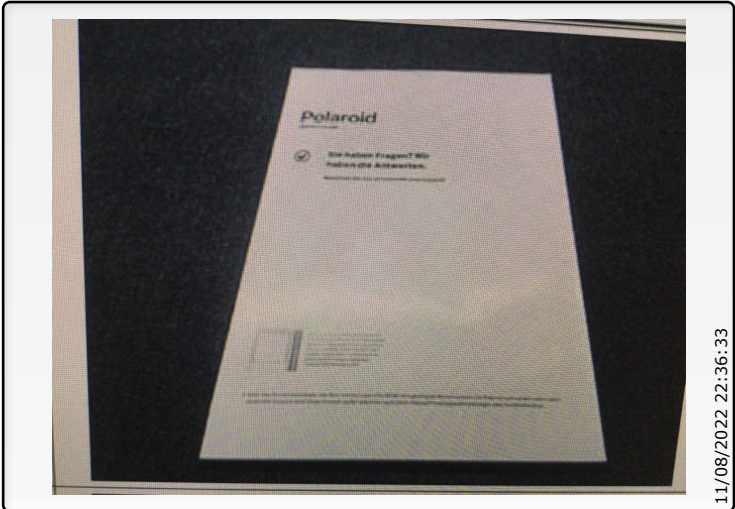

11/08/2022 22:36:33

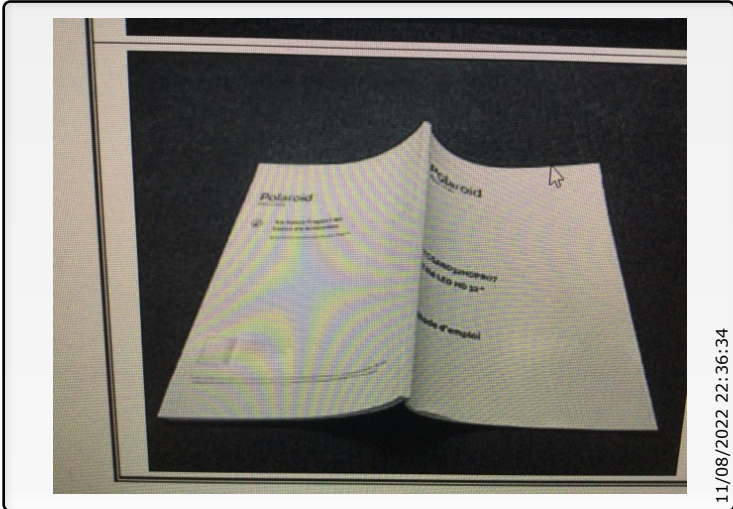


11/08/2022 22:36:34

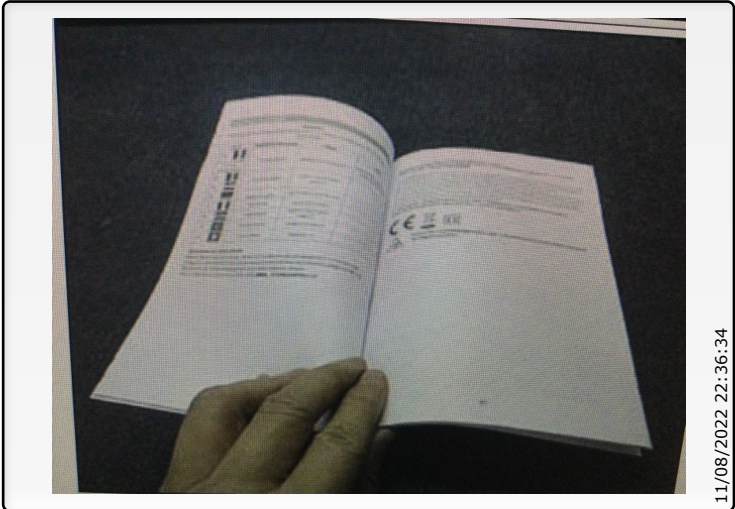


11/08/2022 22:36:34

3.3 / User Manual and marking - Declaration of conformity


PASSED

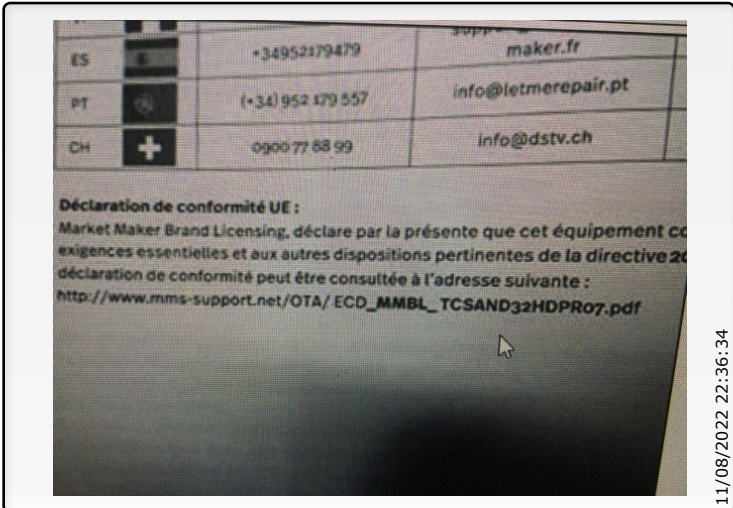


11/08/2022 22:36:34

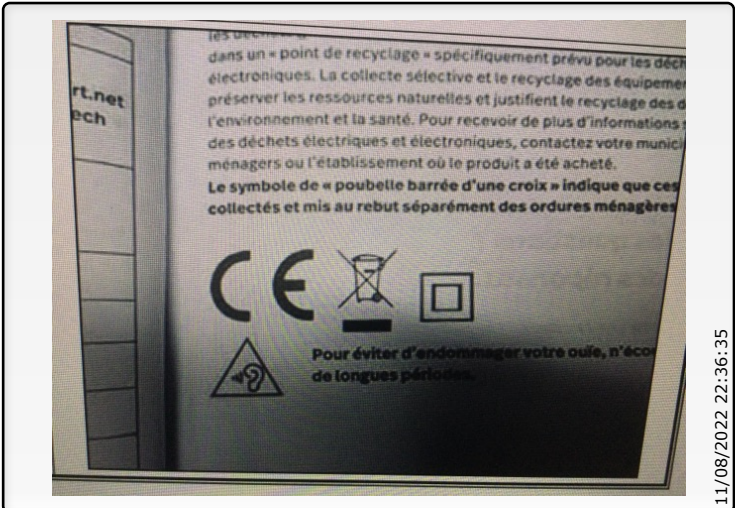


11/08/2022 22:36:35

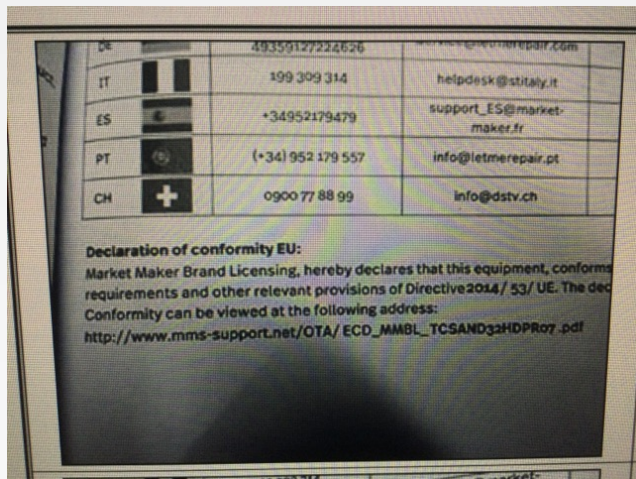


11/08/2022 22:36:35

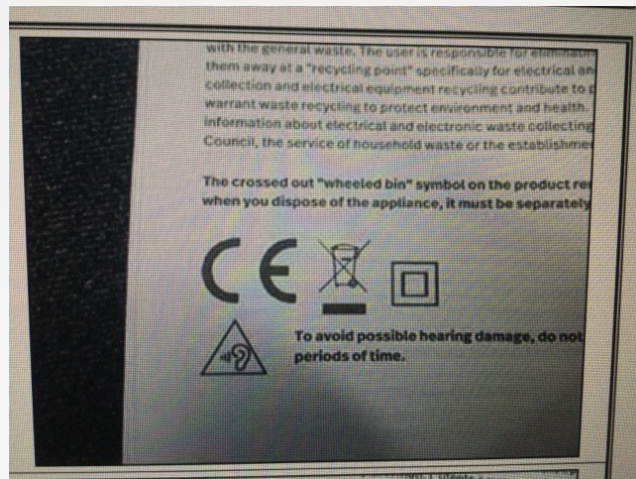


11/08/2022 22:36:35

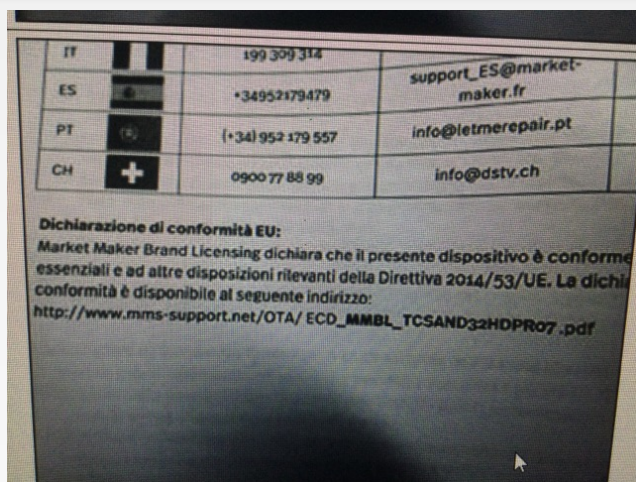


11/08/2022 22:36:35

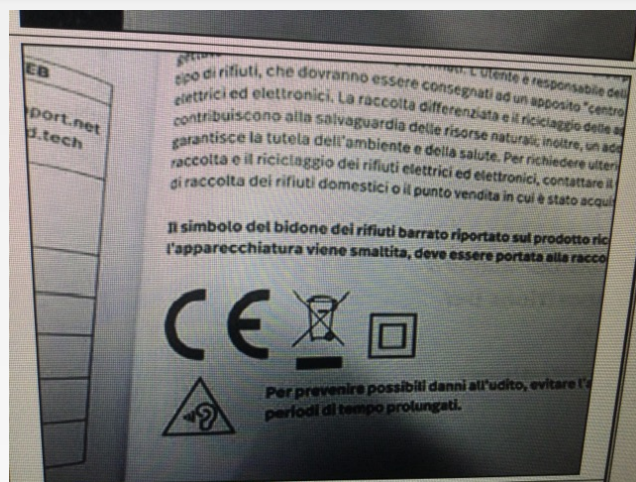

11/08/2022 22:36:36

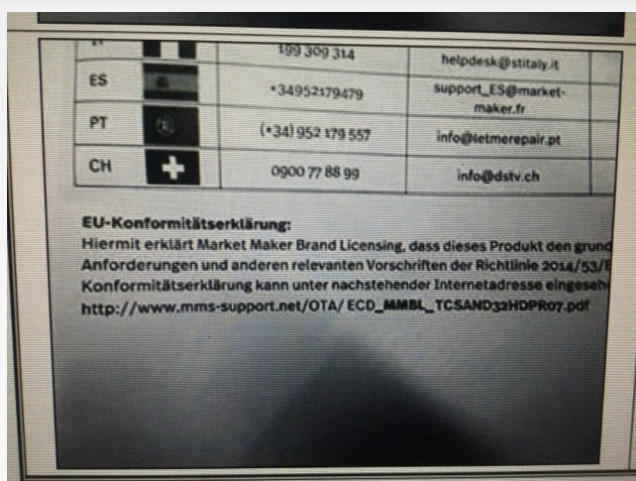

11/08/2022 22:36:36

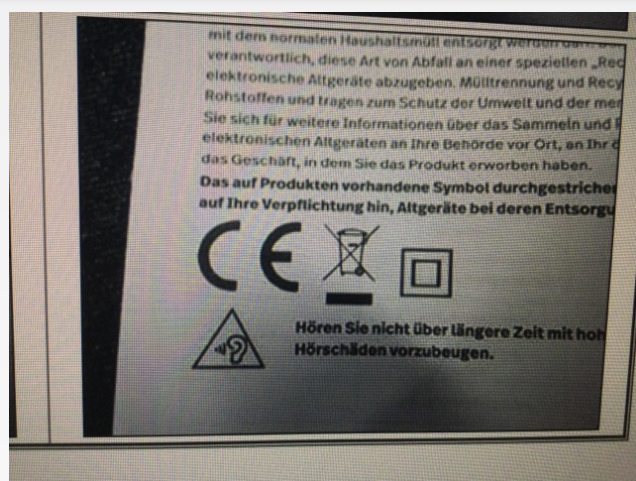

11/08/2022 22:36:36


4. PRODUCT SPECIFICATIONS

PENDING

Picture Report INR-2208001

4.1 / Product Specifications - Color of product




PASSED




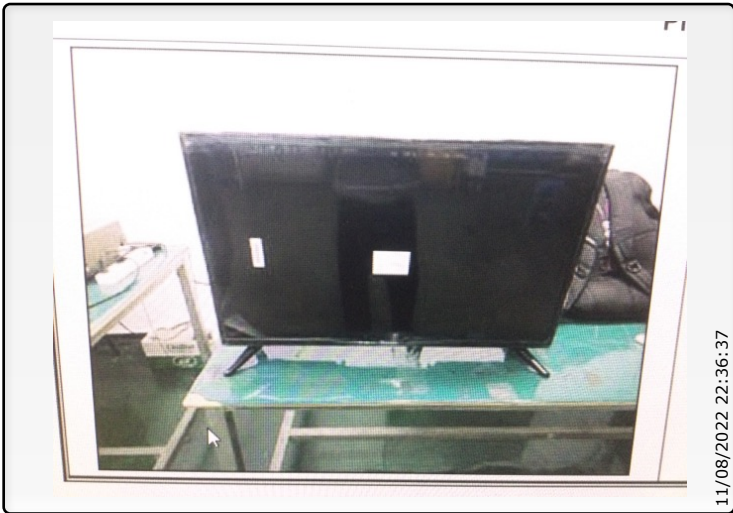


4.2 / Product Specifications - Check finishing

FAILED

★ Not UV coating on all pictures and logos

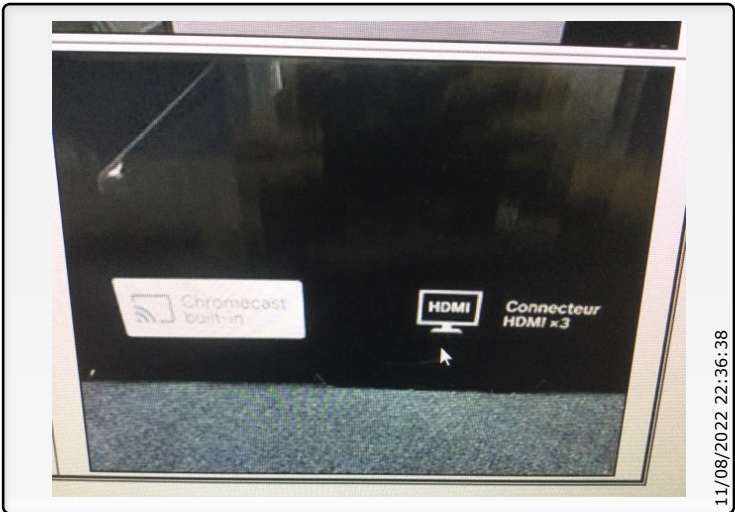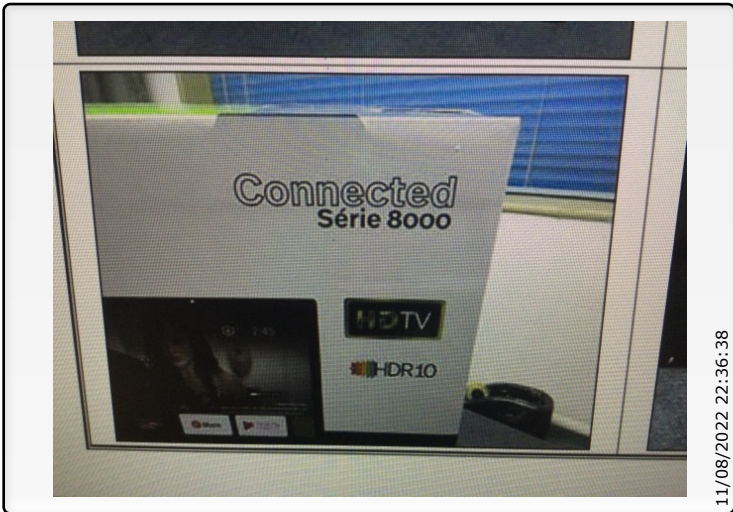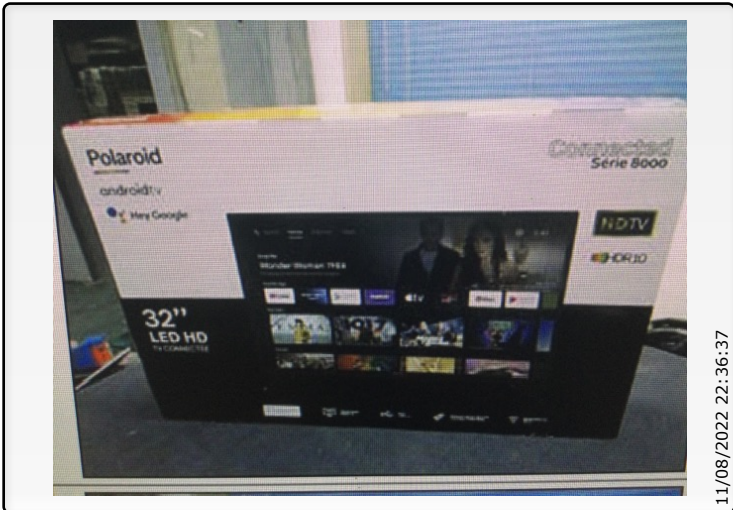

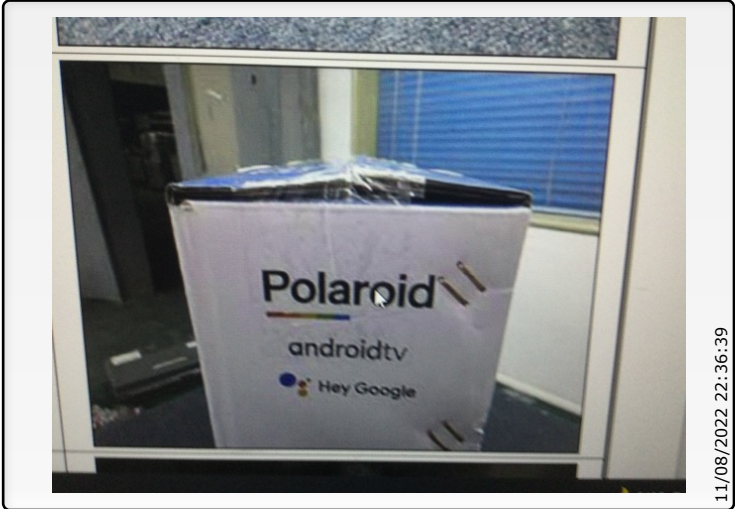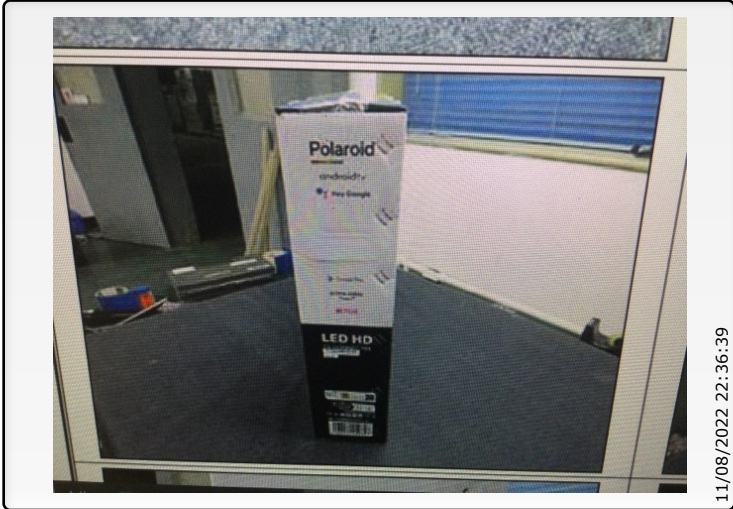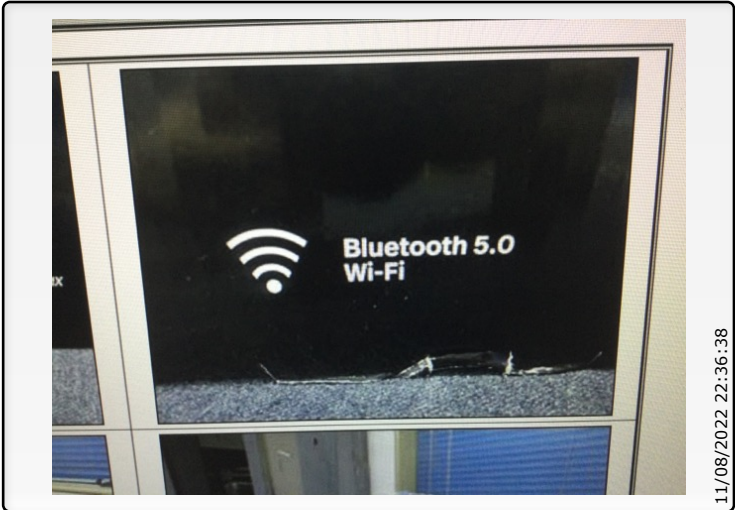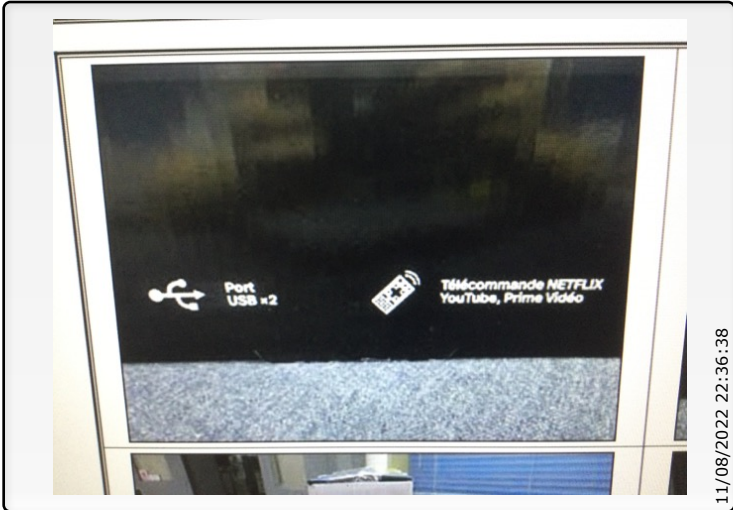




11/08/2022 22:36:40




11/08/2022 22:36:40

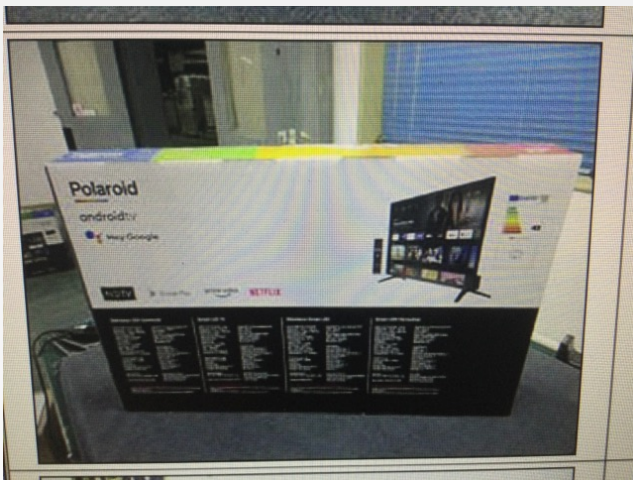


11/08/2022 22:36:40





11/08/2022 22:36:41




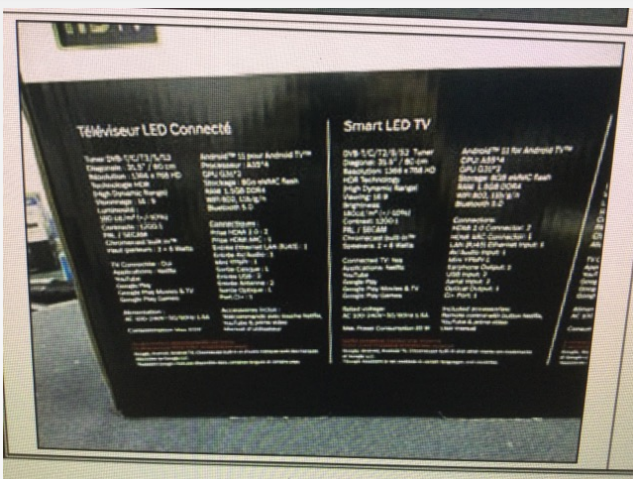



11/08/2022 22:36:41

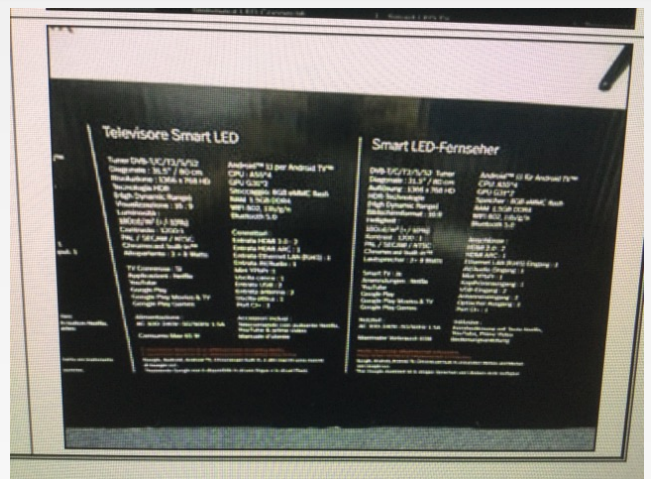


11/08/2022 22:36:41

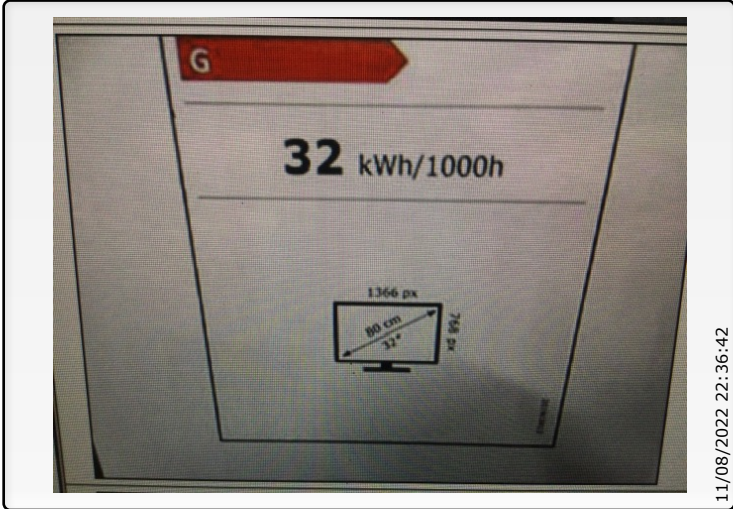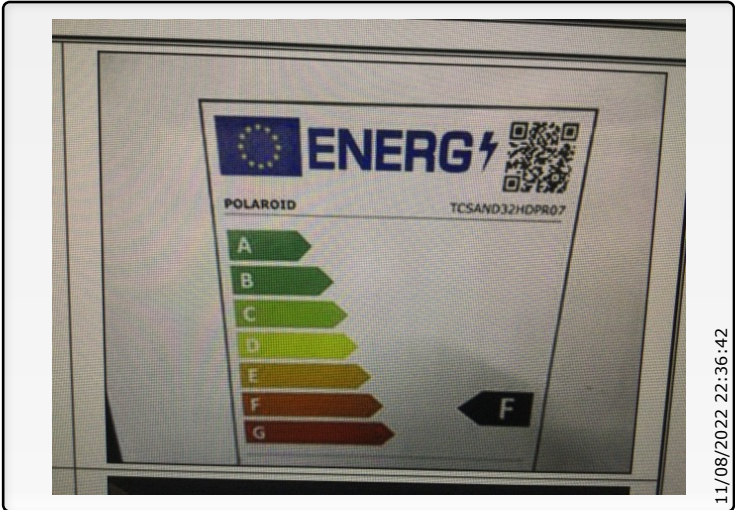


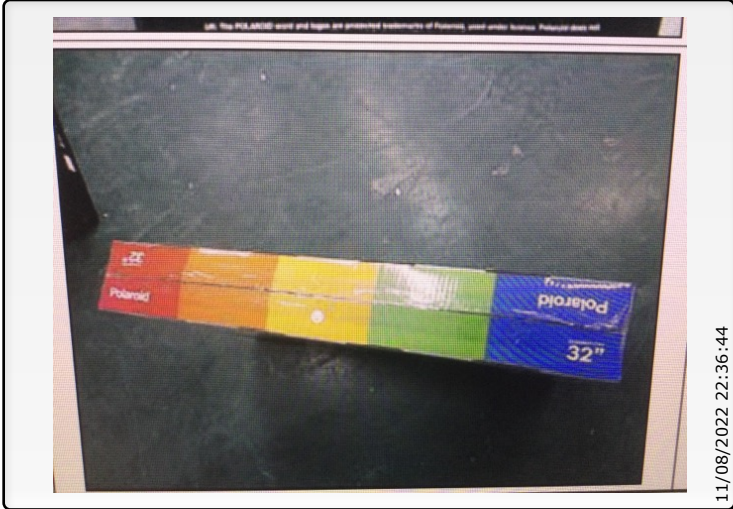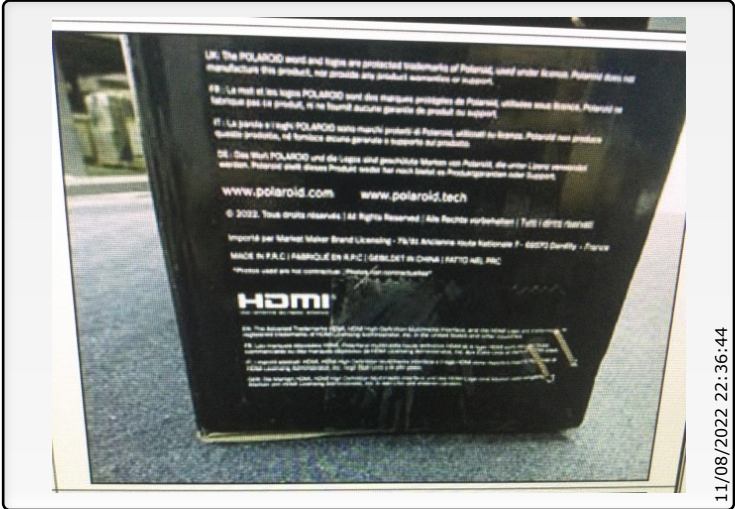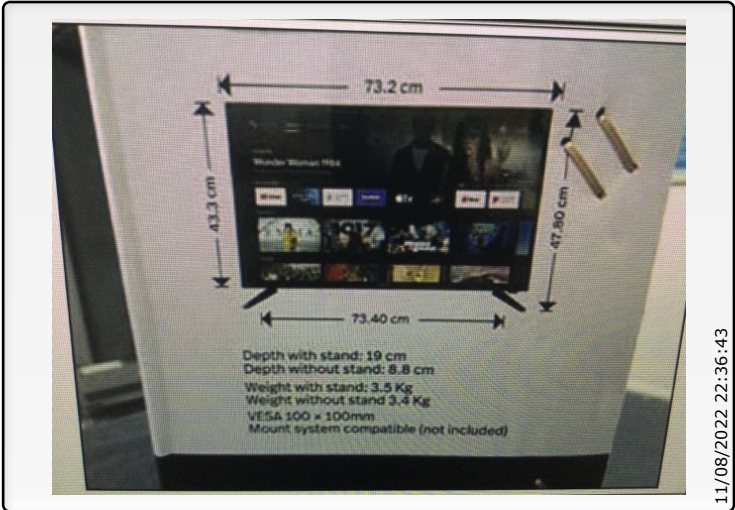
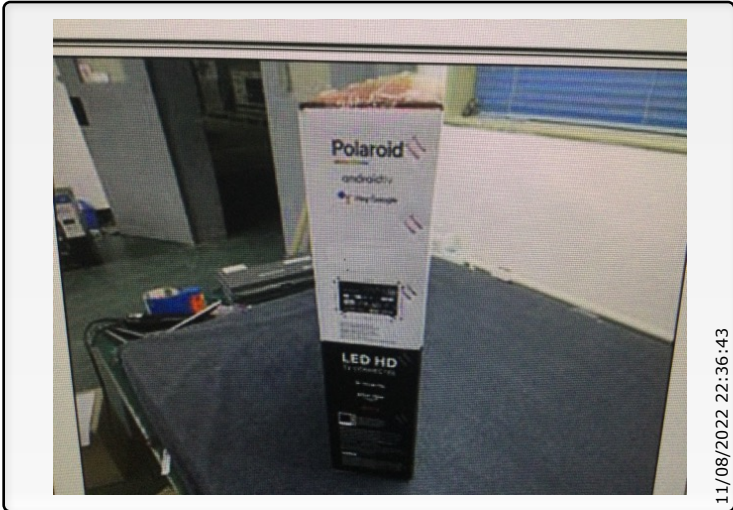


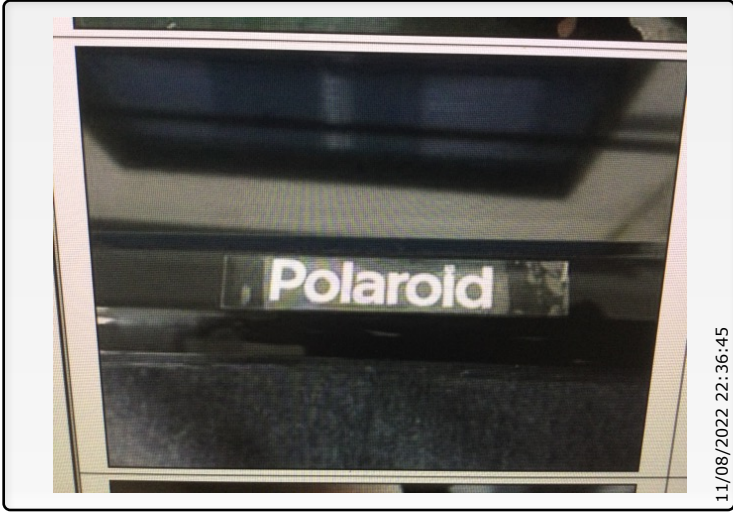



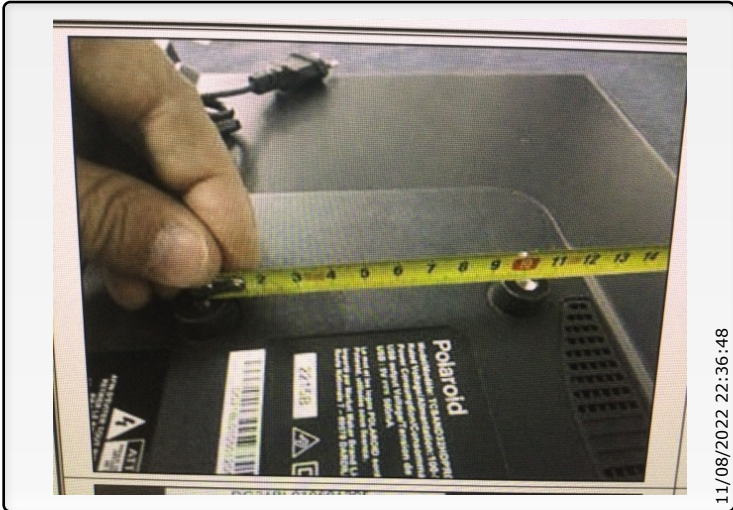

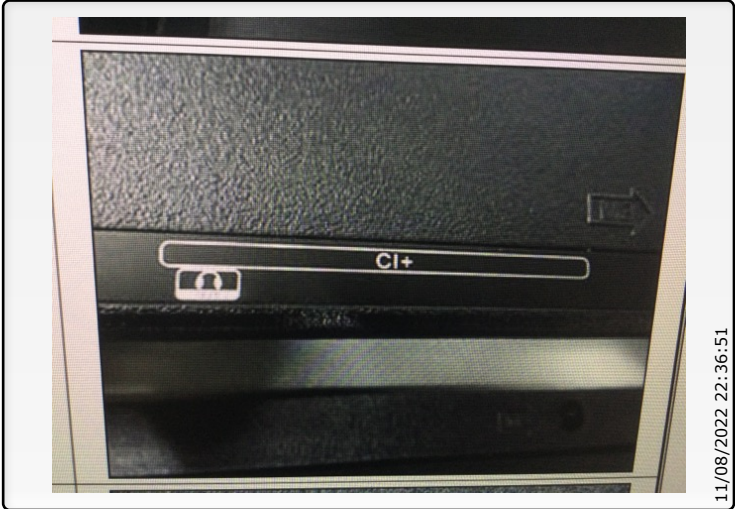


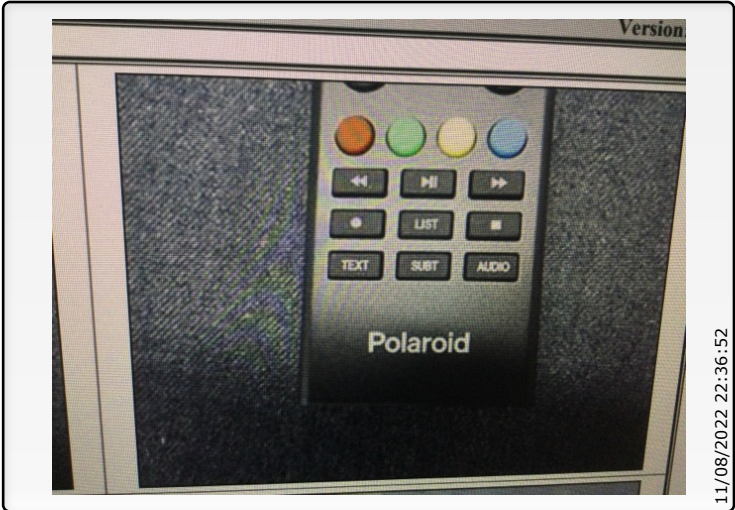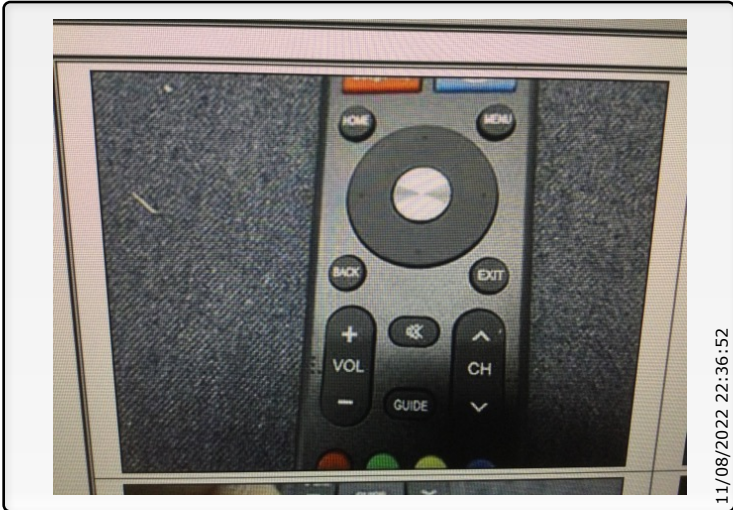



4.3 / Product Specifications - Barcode scanning



PASSED

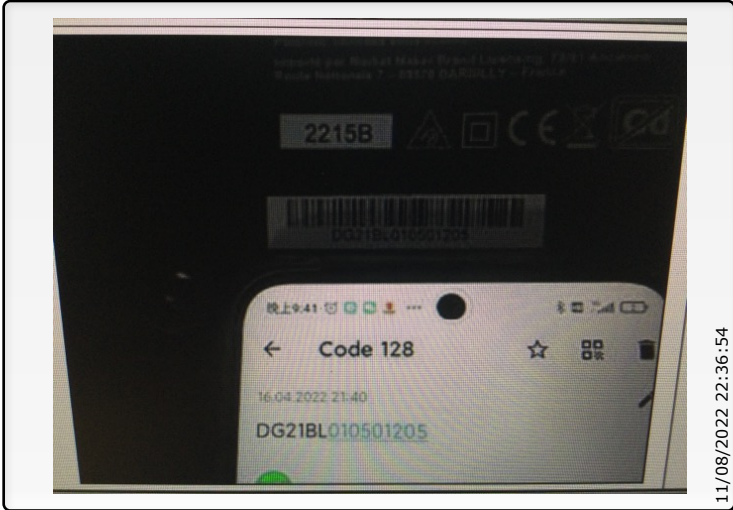





4.4 / Product Specifications - Check Conformity of markings


FAILED

SPL Logo on RL is about 7mm high I/O 8 mm

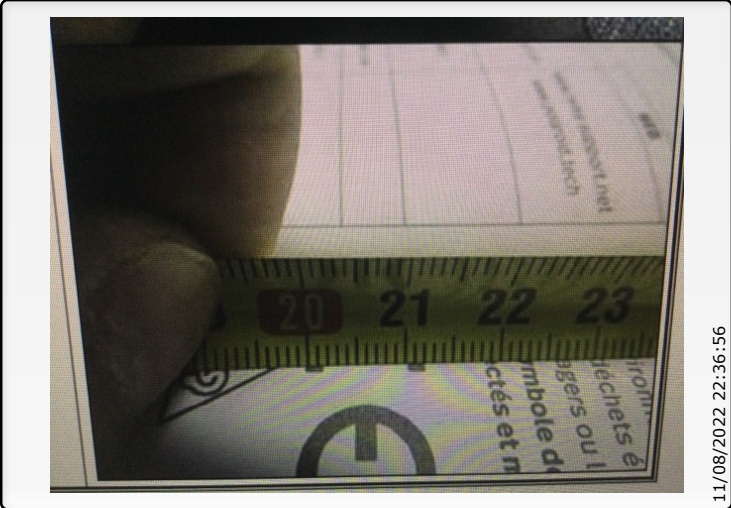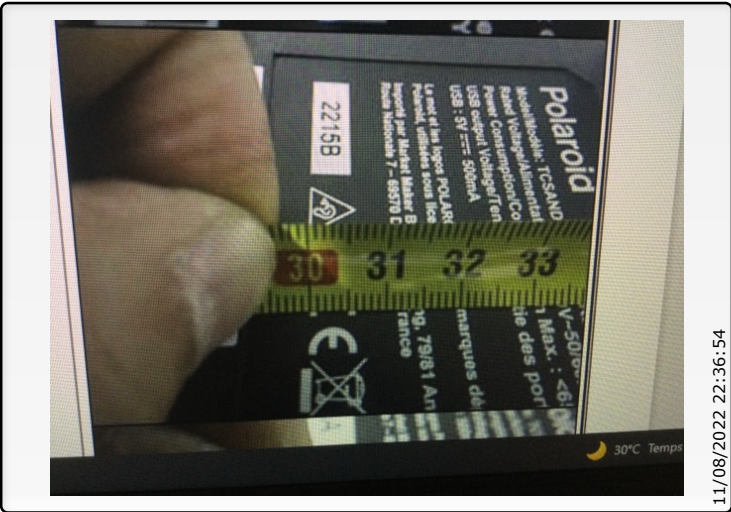

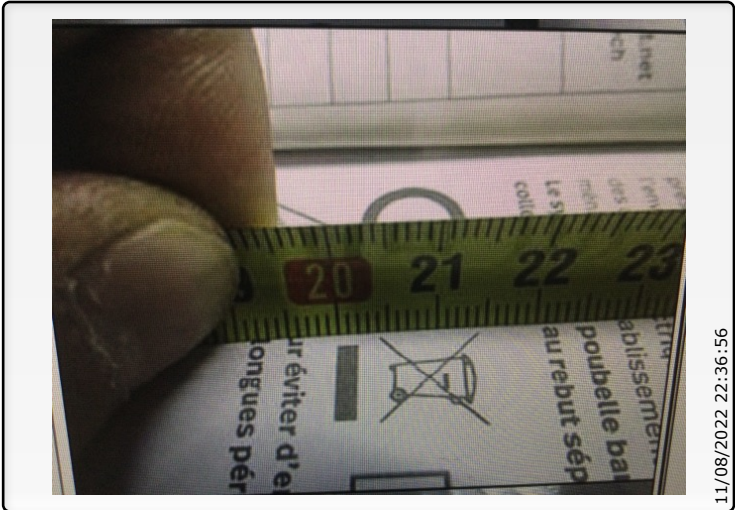


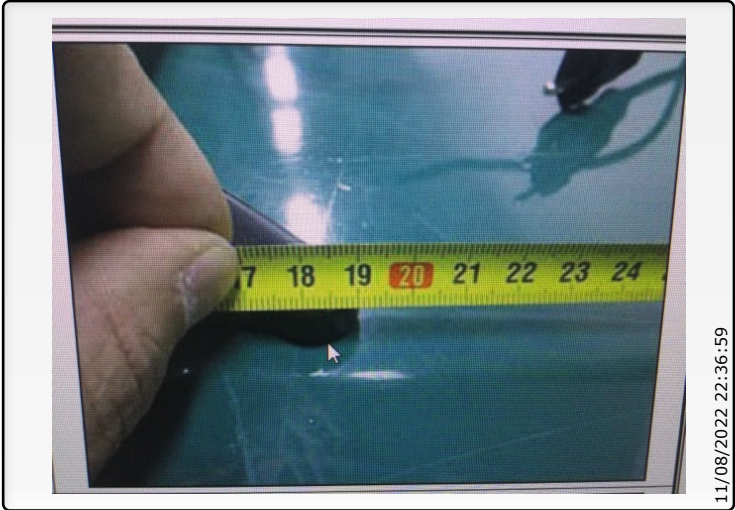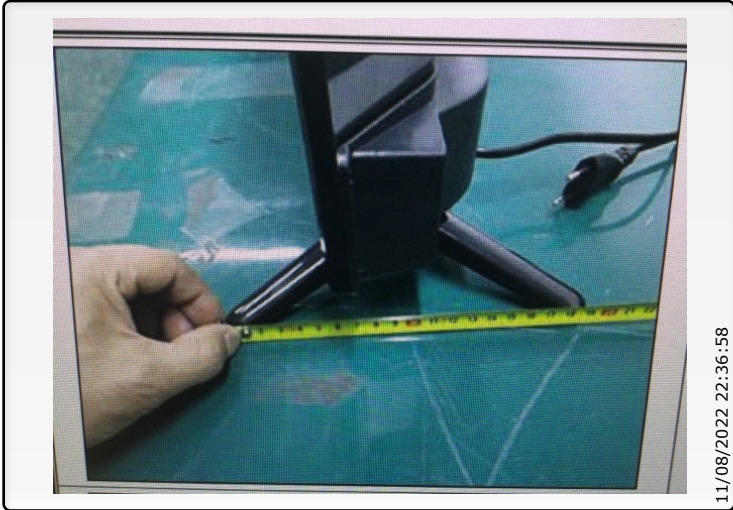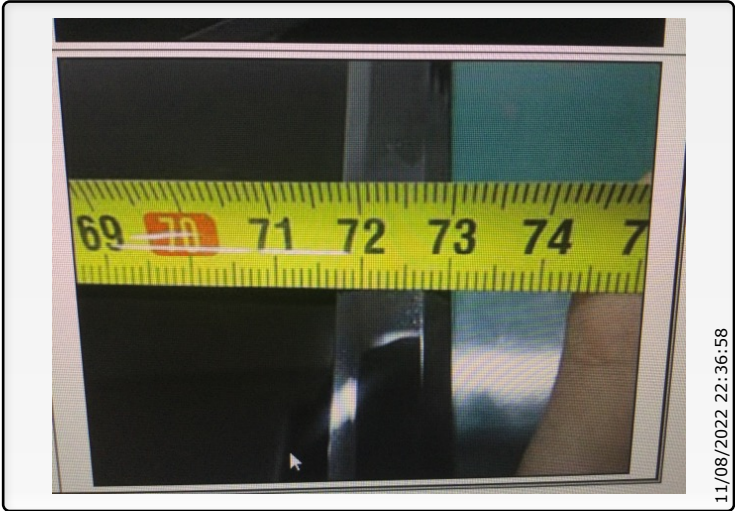

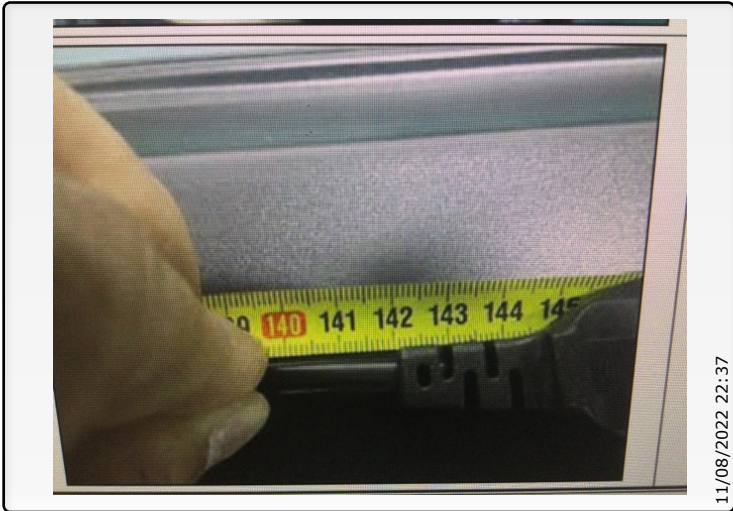


4.6 / Product Specifications - Rub test

PASSED

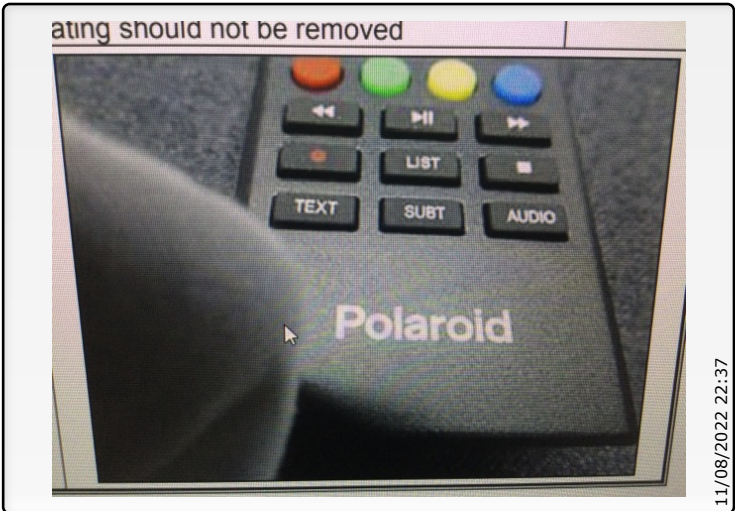

4.7 / Product Specifications - Appearance

PASSED

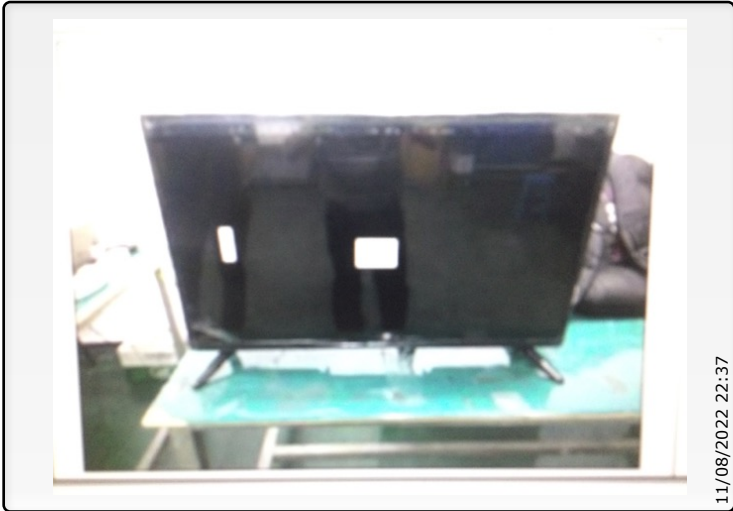

5. FUNCTIONAL TESTING

PENDING

5.1 / Functionnal testing - Battery Fitness check

PASSED



5.2 / Functionnal testing - Assembly test

PASSED



5.3 / Functionnal testing - Fatigue test


PASSED



11/08/2022 23:05:23

5.4 / Functionnal testing - Accessories test

PASSED

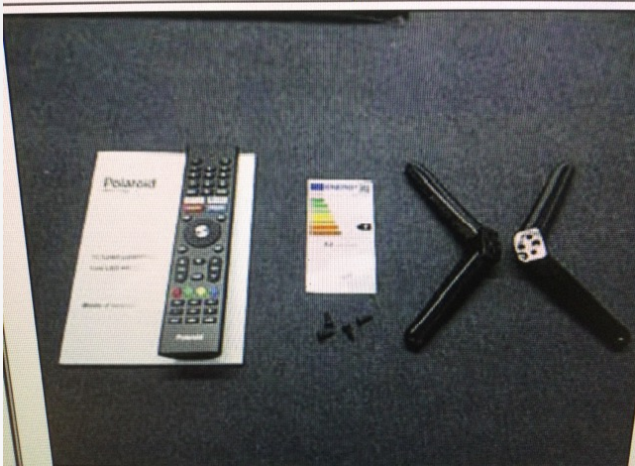

11/08/2022 23:05:24

5.5 / Functionnal testing - Hi-Pot test

PASSED



11/08/2022 23:05:24










11/08/2022 23:05:24

5.6 / Functionnal testing - Internal Check



PENDING

The model chipset couldn't be checked
Power plus is not same as sample

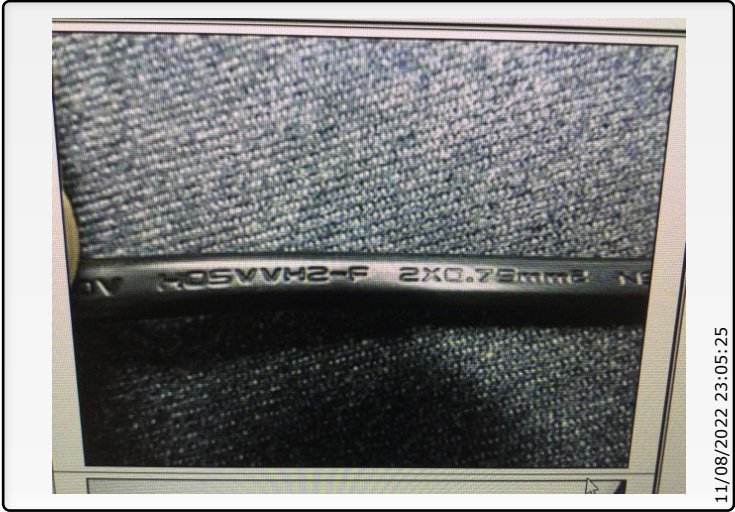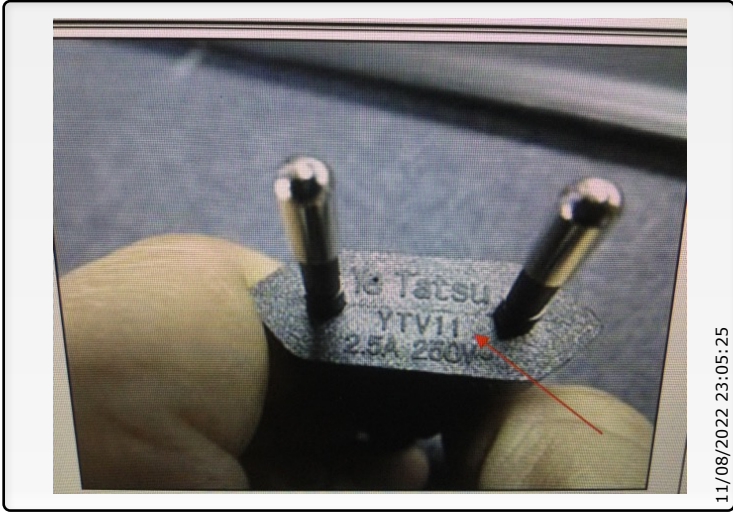

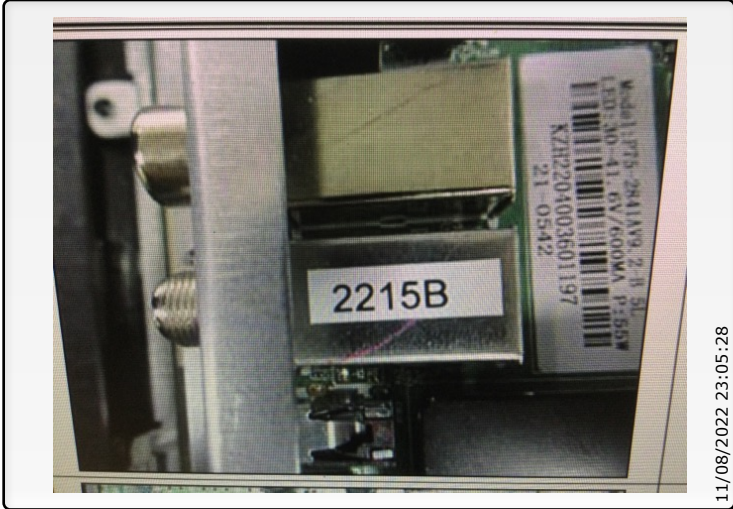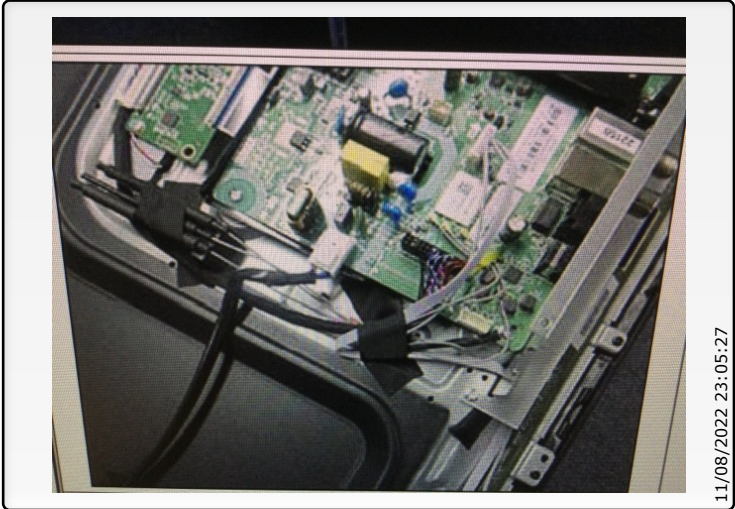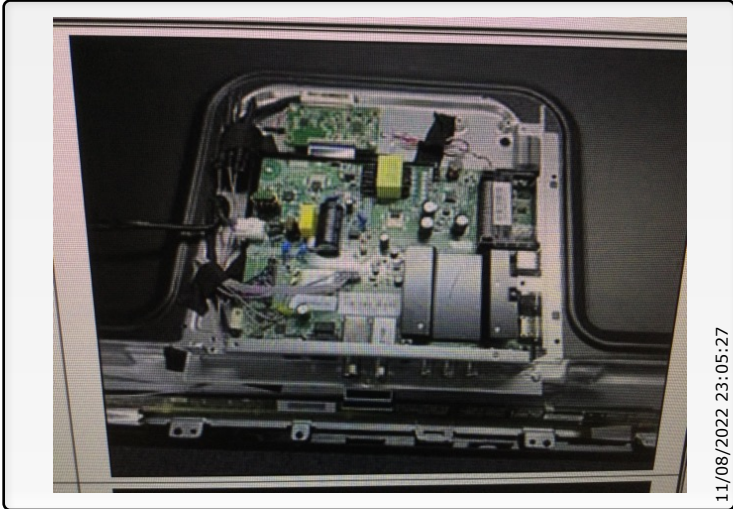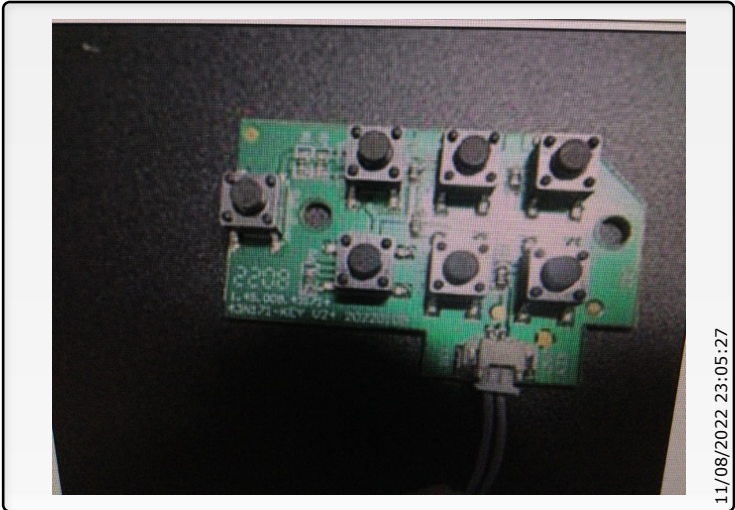
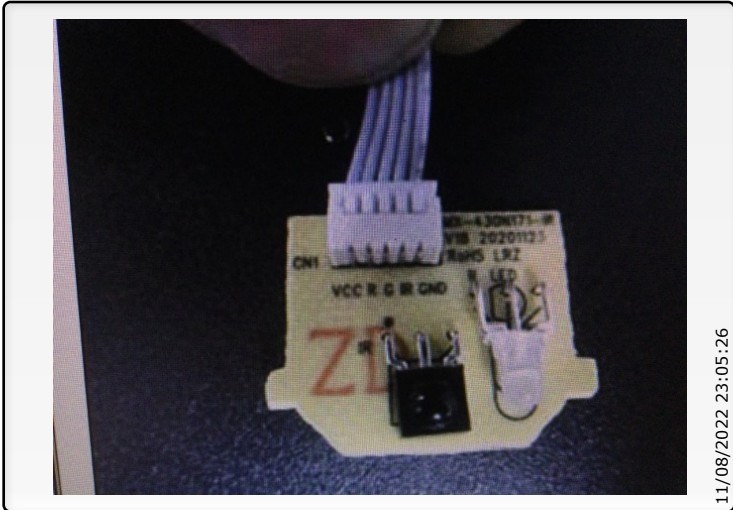


Picture Report INR-2208001

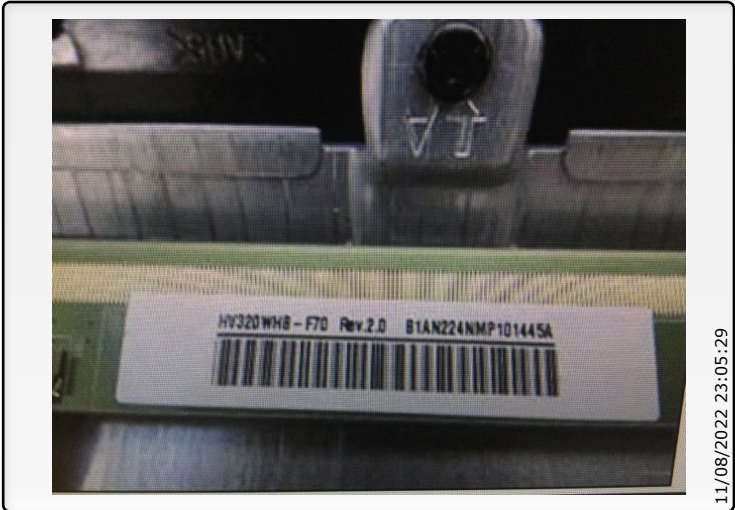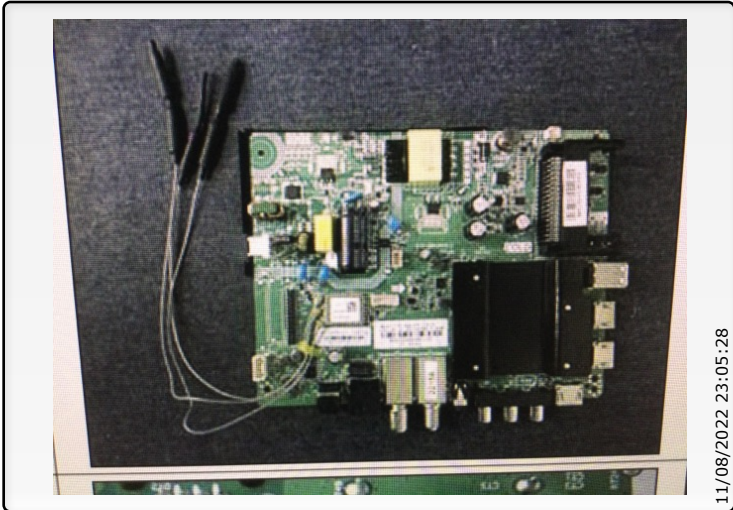


5.7 / Functionnal testing - Software Check

PASSED

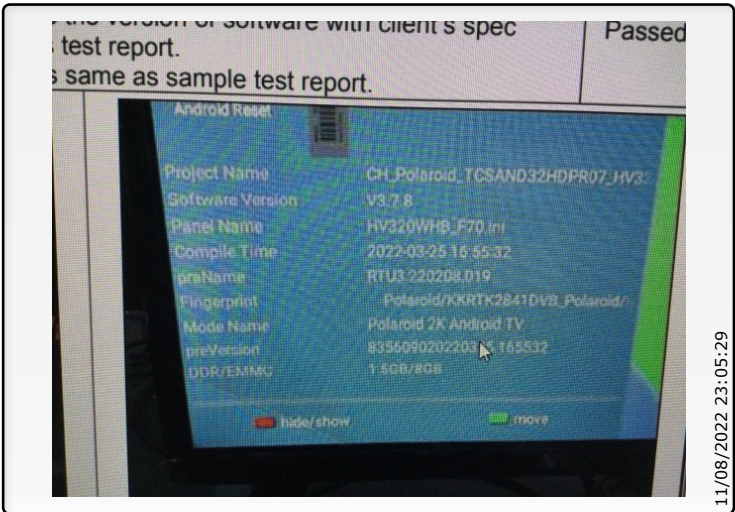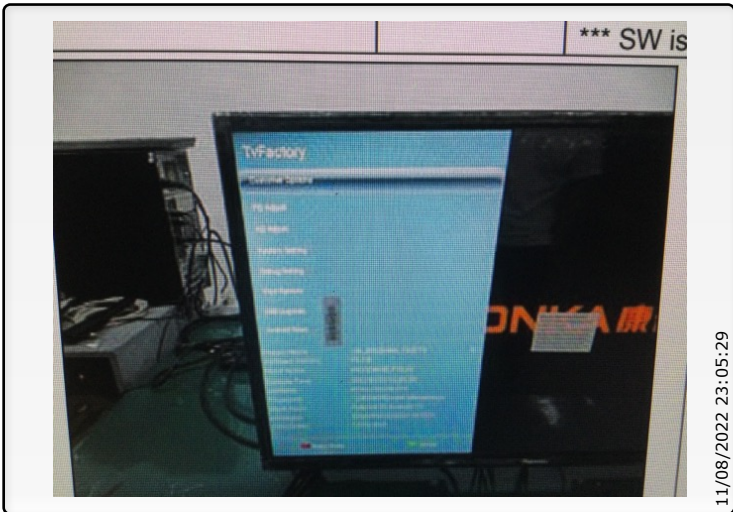



5.8 / Functionnal testing - Burning Test

PASSED

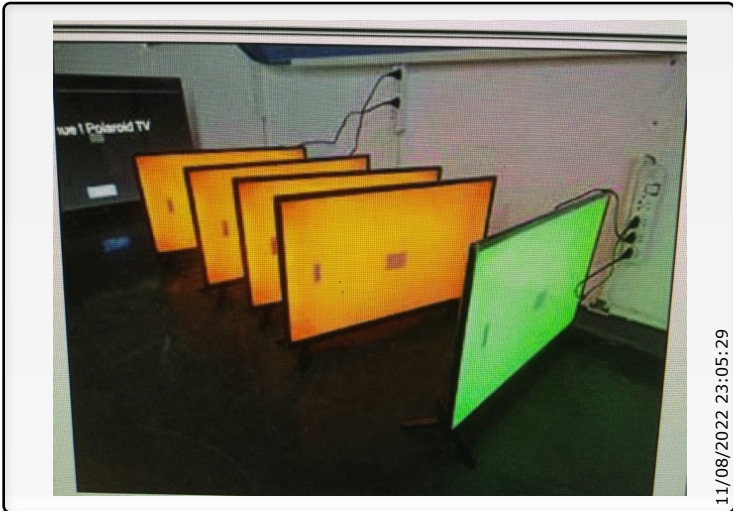



5.9 / Functionnal testing - Power consumption

PASSED

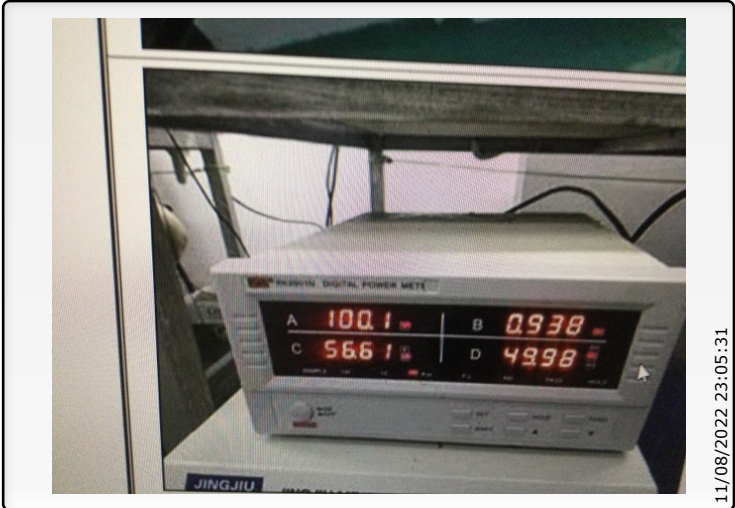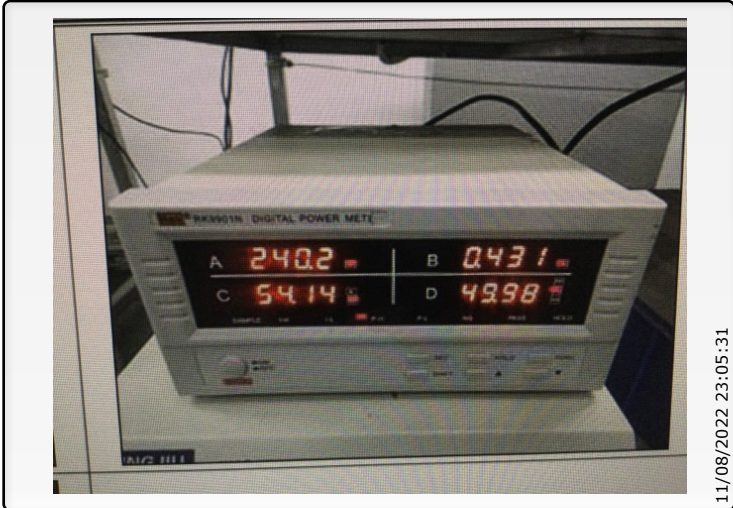

5.10 / Functionnal testing - Pull Test



PASSED

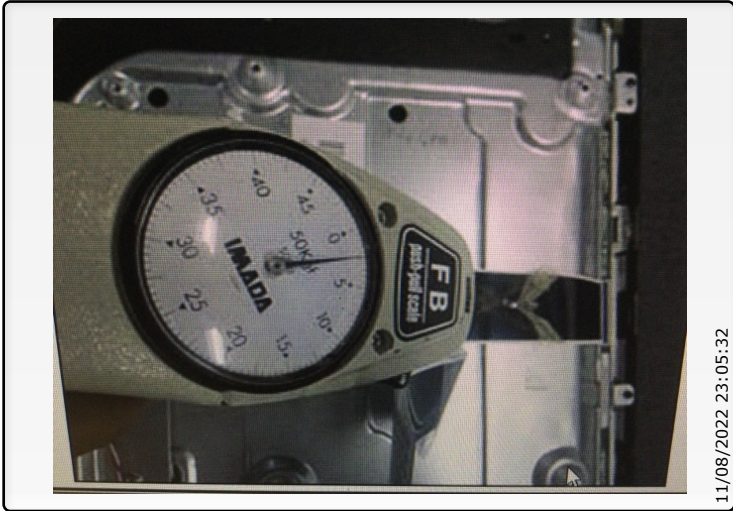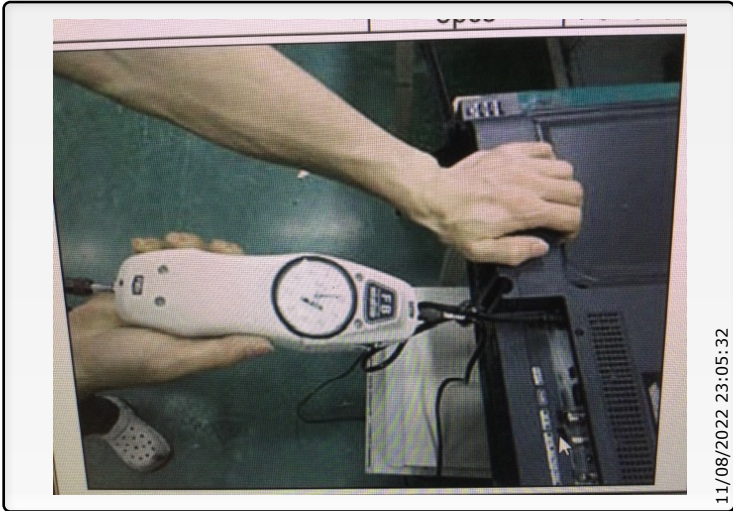


5.11 / Functionnal testing - Panel Dot Checking

PENDING

80 pcs inspected : found 1 bad dot on panel x 1

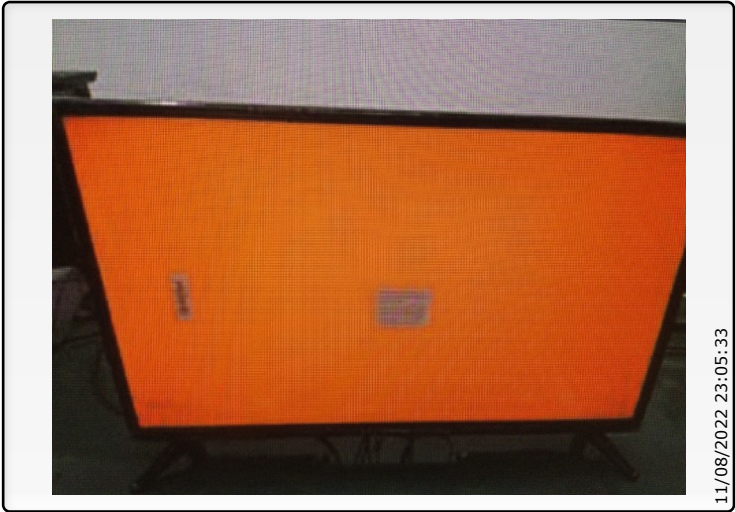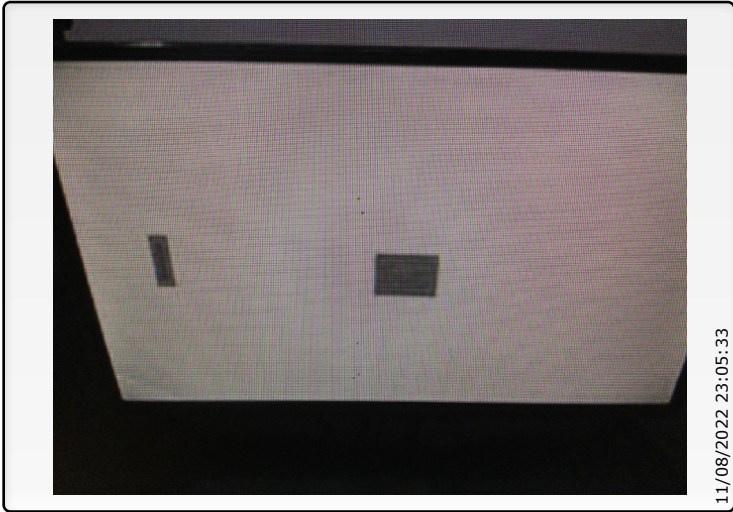

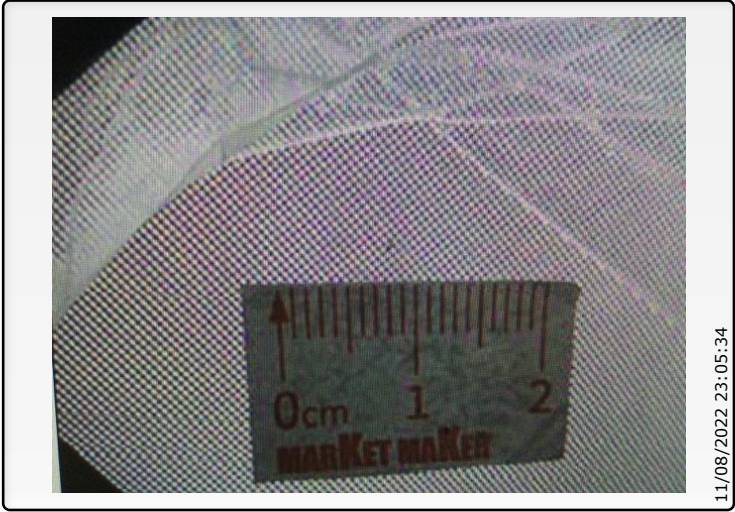

5.12 / Fonctionnal testing - Stability Test

PASSED



5.13 / Functionnal testing - Remote controle test

PASSED




11/08/2022 23:05:35

5.14 / Functionnal testing - Function test


PENDING

Didn't cancel "KONKA" character on netflix ESN mode
RC is not BT but pairing step on UM and first install

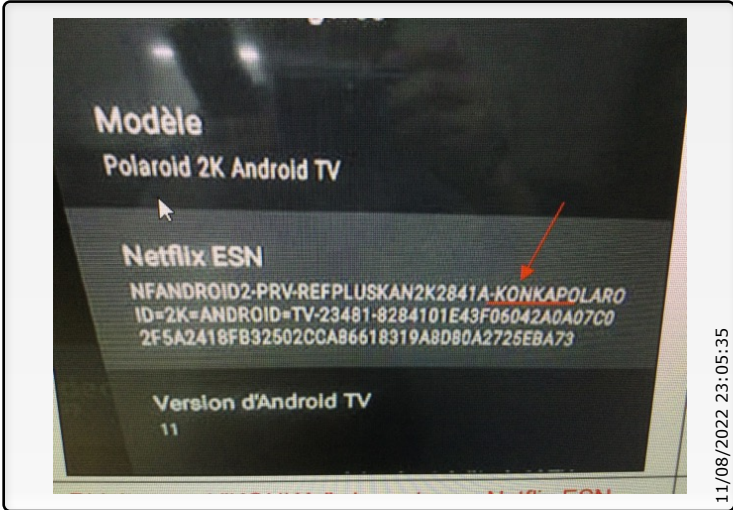


11/08/2022 23:05:35

Didn't cancel KONKA character on Netflix ESN

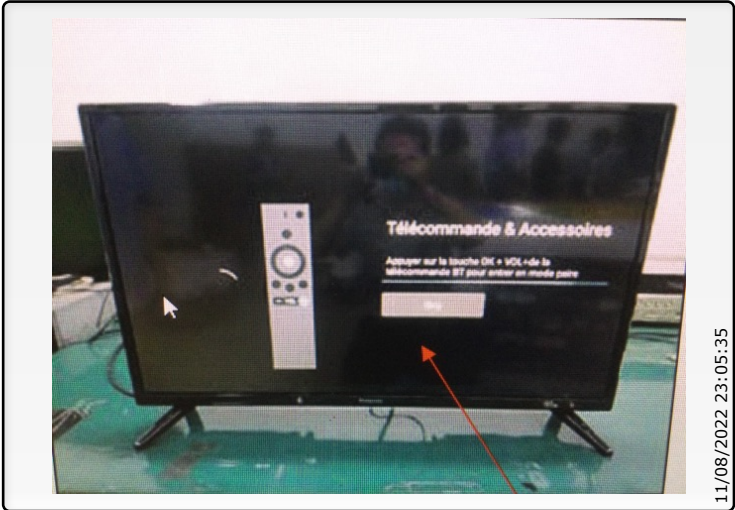

11/08/2022 23:05:35



RC ins't BT but pairing step on first install



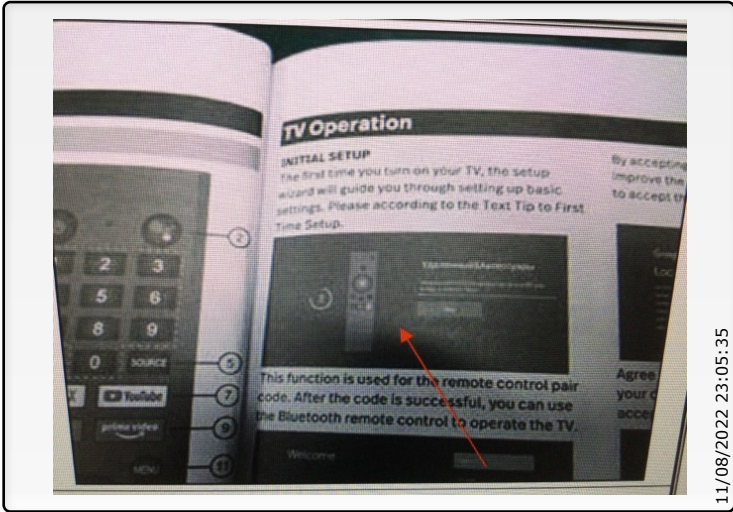



11/08/2022 23:05:35



11/08/2022 23:05:36

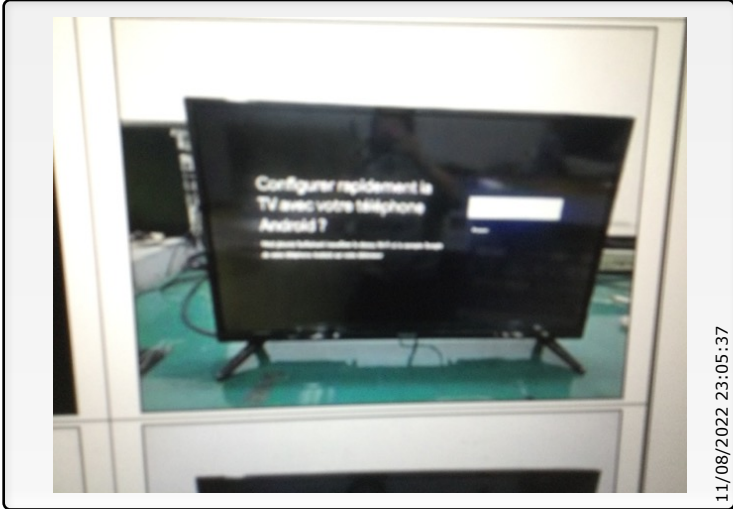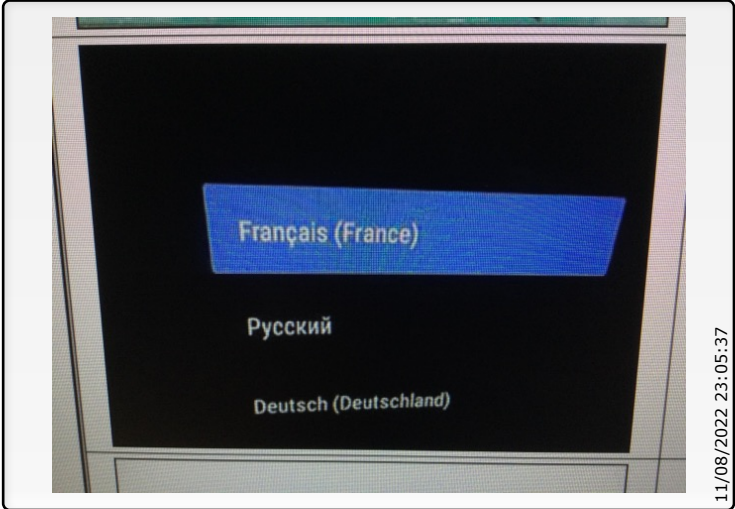

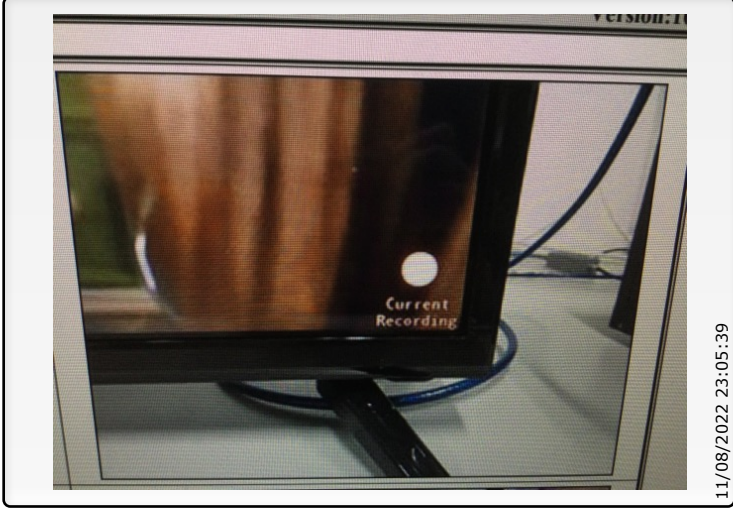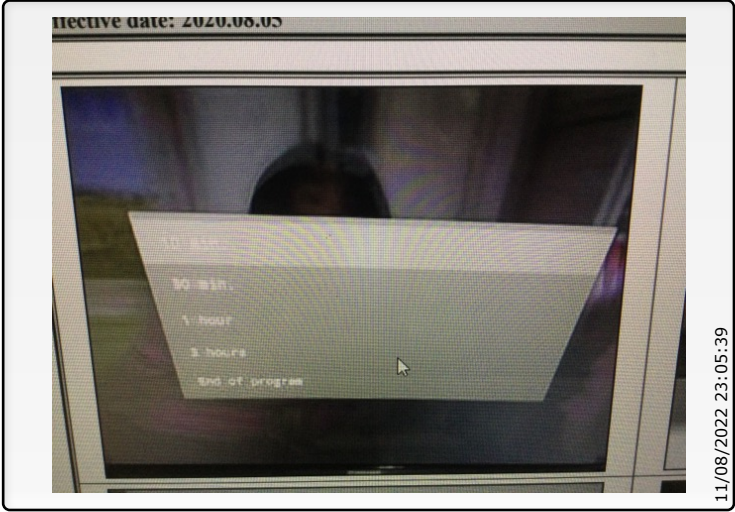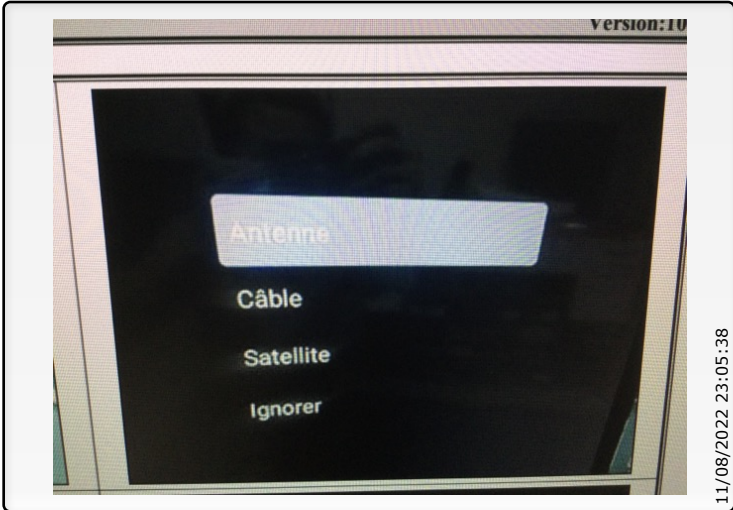

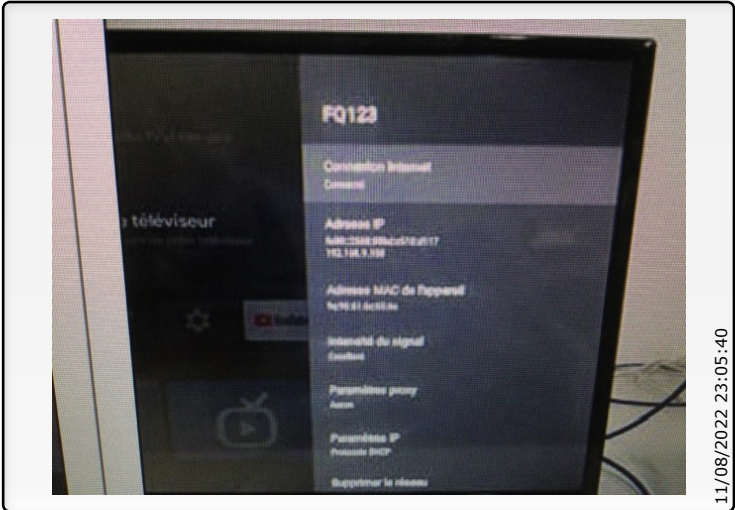





6. SPARE PARTS

PASSED

6.1 / Spare Parts - Spare Part

PASSED

Spare part ready for inspection

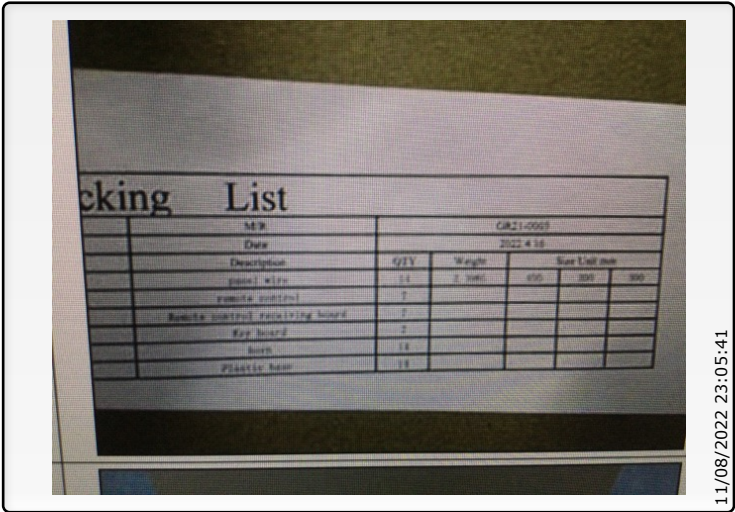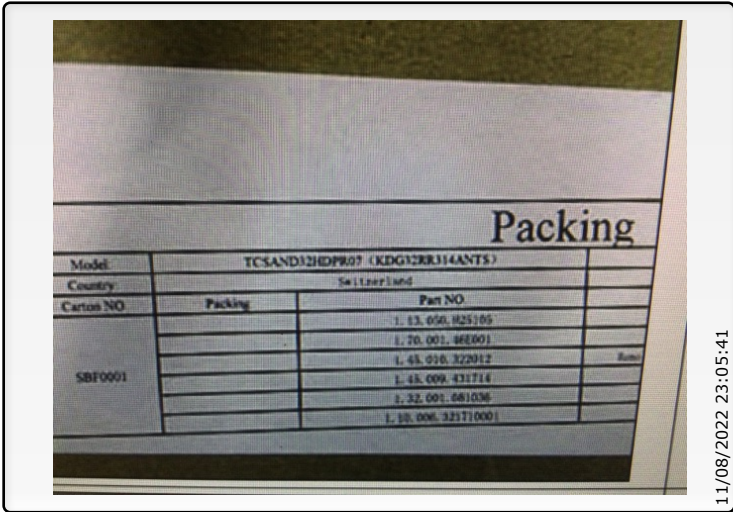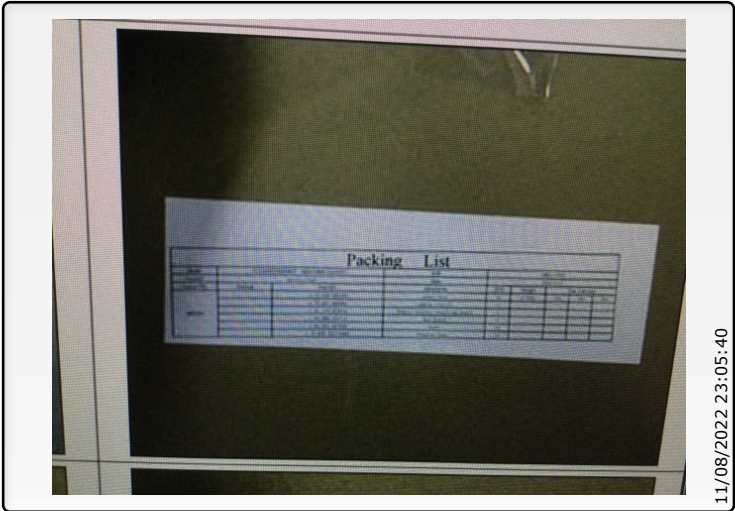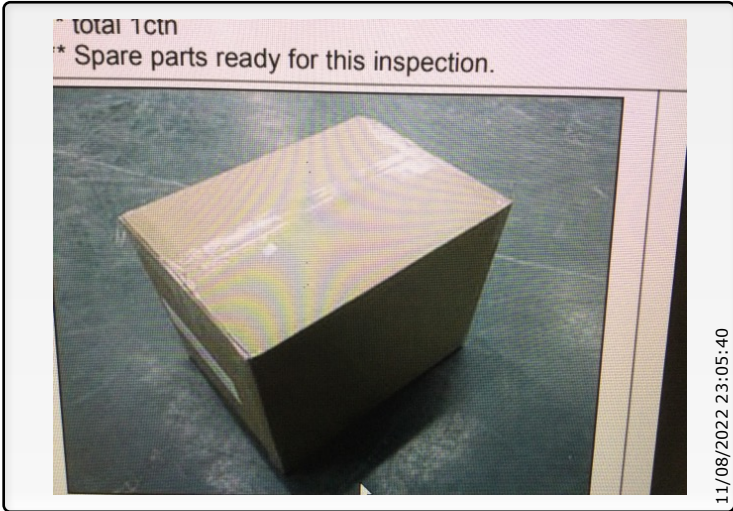



11/08/2022 23:05:41



11/08/2022 23:05:41



11/08/2022 23:05:42




11/08/2022 23:05:42

7. BRIBERY ISSUE & DECLARATION

PASSED

7.1 / Bribery Issue & declaration - Bribery issue & delcaration of supplier

PASSED

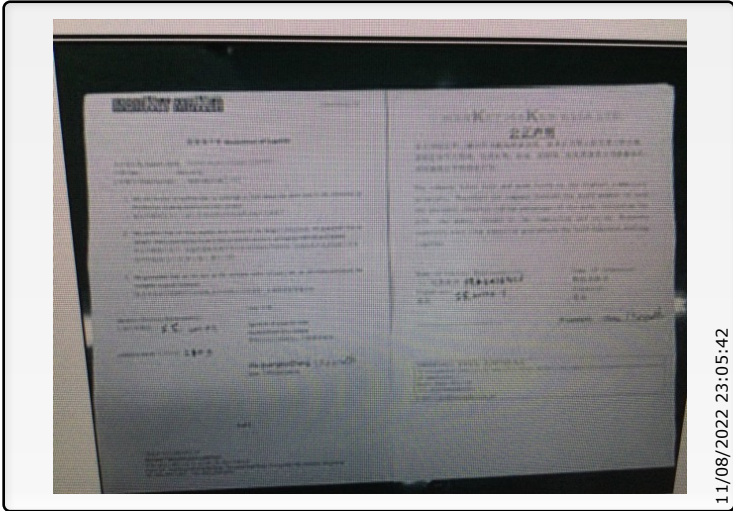

11/08/2022 23:05:42