

	Inspection report	Sample Testing	RESULT
	Inspection number	INR-2305008	FAILED
	Inspection Date		

Client	MMBL	QC Approval	Colin
Supplier	KONKA	QC Team	
Factory			

Problems	CRI	MAJ	MIN
----------	-----	-----	-----

Order Details				
PO NUMBER	MODEL	Brand	QTY	
DG23-BL0031	CELED65UHDSA23B7	Continental	1	

DIMENSION	Item	Unit	Spec	Sample1	Sample2	Sample3
	Screen size	Inch				
	Unit size	mm				
	Power cord	cm				
	Unit Size wo stand	mm				

WEIGHT	Item	Unit	Spec	Value	Material
	Unit Weight without Battery	g			
	GB weight empty	g			
	Polybag weight	g			
	Component weight inside GB	g			
	Product	KG			

REMARKS /FINDINGS

- 1.1. Main Board : ★ PO needs is P150-2851AV9.2 model main board , But sample is P150-2851AV9.7 model main board
- 1.2. Chipset : Because chipset is covered , so chipset could not check during inspection.----Check in MP
- 1.12. Power board : ★ PO needs is P150-2851AV9.2 power main board , But sample is P150-2851AV9.7 model power board
- 5.20. Usage Counter function : ★ PO needs USAGE COUNTER function, But the sample actually not.
- 8.12. VESA : ★ PO needs is VESA 200*200 mm ,But sample is 200*400 mm
- 4.8. HDMI Input : ★ 1.ARC :HDMI 2 . 2.The CEC function default to: OFF 3. HDMI Signal Format Default to AUTO. 2K/4K tested OK. 4.Found select "On" for CEC function and connected with CEC function DVD .Power on after each standby , Backlight is max 。But the backlight display is: 23。(发现CEC功能选择"开",并且连接有CEC功能DVD,每次待机之后开机, 背光为最大。但背光显示是:23)

DETAILS

1. Internal Check		FAILED
1.1 Main Board	★ PO needs is P150-2851AV9.2 model main board , But sample is P150-2851AV9.7 model main board	FAILED

		Inspection report	Sample Testing
		Inspection number	INR-2305008
		Inspection Date	
1.2	Chipset	Because chipset is covered , so chipset could not check during inspection.-----Check in MP	PASSED
1.3	LCD Panel	HV650QUB-F70	PASSED
1.4	TCON Board		PASSED
1.5	Tuner Module	No mark	PASSED
1.6	ROM		PASSED
1.7	Wifi Module.	DCT10R2701	PASSED
1.8	Back Cover		PASSED
1.9	Speaker	10 W X 2 .(Use dual magnetic box speaker)	PASSED
1.10	Power Plug		PASSED
1.11	Power cord		PASSED
1.12	Power board	★ PO needs is P150-2851AV9.2 power main board , But sample is P150-2851AV9.7 model power board	FAILED
2. Power / Safety			PASSED
2.1	Hi Pot test		PASSED
2.2	Power consuption (Std By)		PASSED
2.3	Power consuption (working)	Max 129 W	PASSED
2.4	Earth Continuity test		NA
2.5	Power input test	110–240V	PASSED
2.6	Endurance test		PASSED
3. Connect			PASSED
3.1	Wifi level		PASSED
3.2	Wifi Speed		PASSED
3.3	Network port (LAN)		PASSED
4. Functions			FAILED
4.1	ATV Programs	PAL-BG/DK --OK。 Not support SECAM-L(不支持SECAM-L)--Accepted by France	PASSED
4.2	AV Input		PASSED
4.3	DVBT/T2 programs	Tested:226.5/474/858MHZ OK.	PASSED
4.4	S/S2 programs		PASSED
4.5	DVB-C Programs	Tested:122/858MHZ OK.	PASSED
4.6	YUV Input		PASSED
4.7	Scart		NA
4.8	HDMI Input	★ 1.ARC :HDMI 2 . 2.The CEC function default to: OFF 3. HDMI Signal Format Default to AUTO. 2K/4K tested OK. 4.Found select "On" for CEC function and connected with CEC function DVD .Power	FAILED
4.9	Speaker level and quality	7.5W x 2	PASSED

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	
4.10	Radio	PASSED
4.11	Media Play	PASSED
4.12	Headphones (stereo, quality)	PASSED
4.13	Optical Out	Select AUTO output, No sound from amplifier (including ARC output) (选择AUTO 输出, 功放没有声音(包括ARC输出)) --Already fixed. 1.Setup to SPDIF/Optical OUT, Audio Output Type will auto converted to PASSED
4.14	PC Audio input	NA
4.15	VGA Input	NA
4.16	HDMI ARC	PASSED
5. Software		FAILED
5.1	WEB Browser	Netflix, YouTube, Prime video APPS ect tested OK. PASSED
5.2	Welcome screen	PASSED
5.3	First install guide	1.Need arrange the "language" selection after the open LOGO(需要将“语言”选择编排在开机LOGO之后)--Accepred 2:Needs to cancel sound of First install Guide.(需要取消首次安装指南的声音)。--Accepred 3.Needs to PASSED
5.4	Channel auto search	PASSED
5.5	Channel manual search	PASSED
5.6	EPG function	ON PASSED
5.7	REC Function	PASSED
5.8	Timeshift	No Timeshift key on Remote control (But user menu has Timeshift function, But users operation will be troublesome)。遥控器上没有 Timeshift 键。(但是用户菜单有Timeshift功能, 但是用户操作将会很麻 PASSED
5.9	Channel grouping	PASSED
5.10	TOP Teletext	PASSED
5.11	DTV Radio	PASSED
5.12	Power cut memory	PASSED
5.13	Sleep	PASSED
5.14	Remote control key	PASSED
5.15	Remote control distance	PASSED
5.16	Media Pict files	PASSED
5.17	Video Files	PASSED
5.18	Audio files	PASSED
5.19	Factory Password	MENU+1147 PASSED
5.20	Usage Counter function	★ PO needs USAGE COUNTER function, But the sample actually not. FAILED
5.21	Usage function steps	PASSED
5.22	Auto Stand Bye	4H PASSED
6. Panel		PASSED
6.1	LED resolution	3840X2160.1200:1 PASSED

	Inspection report	Sample Testing	
	Inspection number	INR-2305008	
	Inspection Date		
6.2	Angle view	178X178	PASSED
6.3	LED Display tester	The brightness control functions only have a slight effect (亮度控制功能只有轻微效果)--Already fixed	PASSED
6.4	Image quality	Found that the cool color of color temperature is reddish,Need change to bluish. (色温的冷色偏红色, 需要更改为偏蓝色)。--Already fixed	PASSED
6.5	Mirror surface		PASSED
7. System			PASSED
7.1	Default country	France. can be selected。---Accepted	PASSED
7.2	Default OSD language	English, German,French,Italian, Spanish , Portugal,Nederlands and default to French .	PASSED
7.3	Default subtitle lang	Default to OFF.	PASSED
7.4	Default audio country	Default to French.	PASSED
7.5	Support image system	Default to16:09	PASSED
7.6	Support sound system	Default to French	PASSED
7.7	CI Information	Cannot read CI card information in Digital Channel Setup, If according to such operation:live Tv> press ok->TV options -> Channel options -> Common Interface -> Common Interface Slot,	PASSED
7.8	LCN Information	ON	PASSED
7.9	Hotel Mode	No Hotel model and key Lock function----Accepted	NA
7.10	System Reset		PASSED
8. Mecanical test			FAILED
8.1	DC plug		PASSED
8.2	USB Plug		PASSED
8.3	CI Plug		PASSED
8.4	Control Wifi Antenna		PASSED
8.5	Headphone (mechanical test)		PASSED
8.6	Button test		PASSED
8.7	Mechanical pressure test		PASSED
8.8	Ground connection		NA
8.9	LCD fixation		PASSED
8.10	Isolation PCB/LCD		PASSED
8.11	Brightness test		PASSED
8.12	PCB Fix Prop		PASSED
8.12	VESA	★ PO needs is VESA 200*200 mm ,But sample is 200*400 mm	FAILED
8.16	User Menu		PASSED
8.17	Backlight		PASSED
8.21	COF Board Assembly		PASSED

	Inspection report	Sample Testing	RESULT FAILED
	Inspection number	INR-2305008	
	Inspection Date		

Buyer MMBL	QC Approval Colin
Supplier KONKA	QC Team
Factory	

Order Details

PO NUMBER	MODEL	Brand	QTY
DG23-BL0031	CELED65UHDSA23B7	Continental	1




1. INTERNAL CHECK

FAILED

1.1 / Internal Check - Main Board

FAILED

★ PO needs is P150-2851AV9.2 model main board , But sample is P150-2851AV9.7 model main board

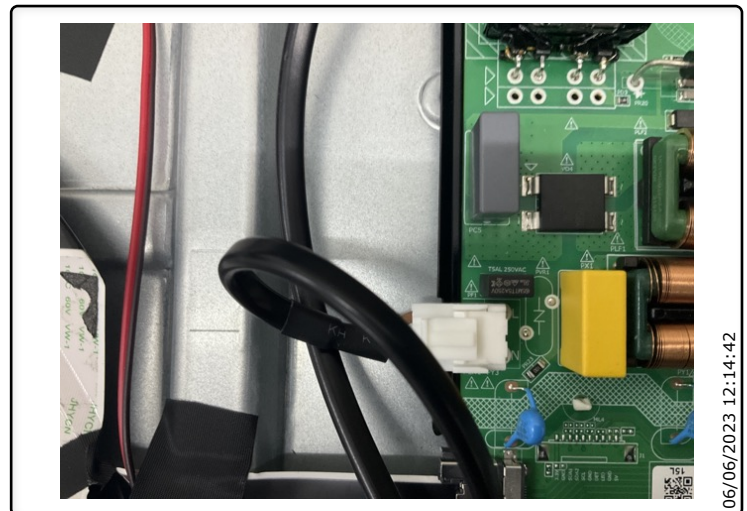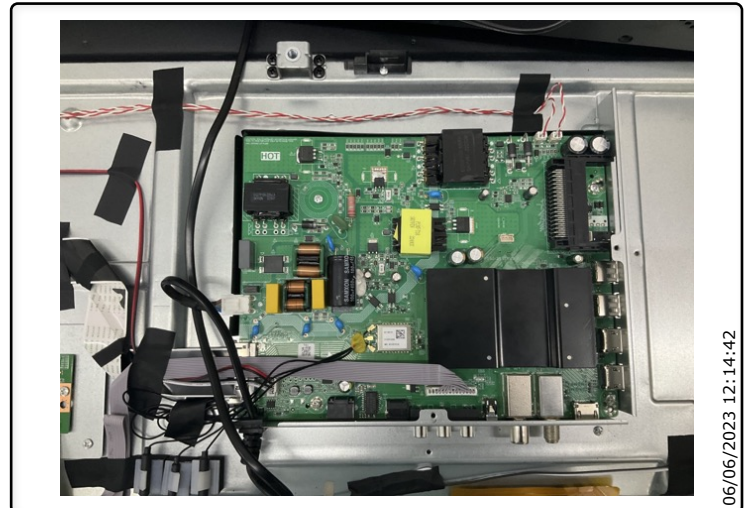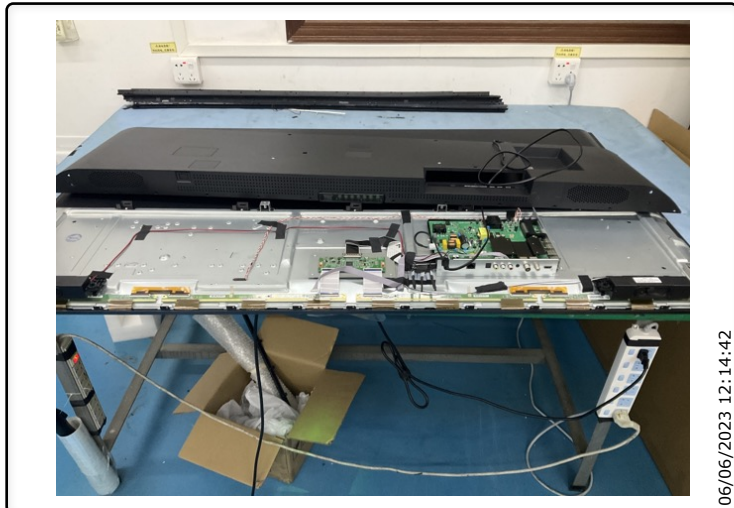

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	


1.2 / Internal Check - Chipset
PASSED

Because chipset is covered , so chipset could not check during inspection.----Check in MP




1.3 / Internal Check - LCD Panel
PASSED

HV650QUB-F70

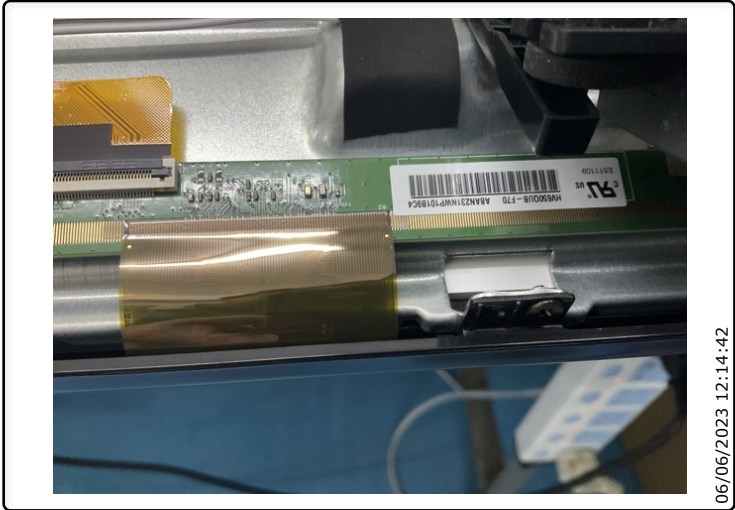

1.4 / Internal Check - TCON Board
PASSED

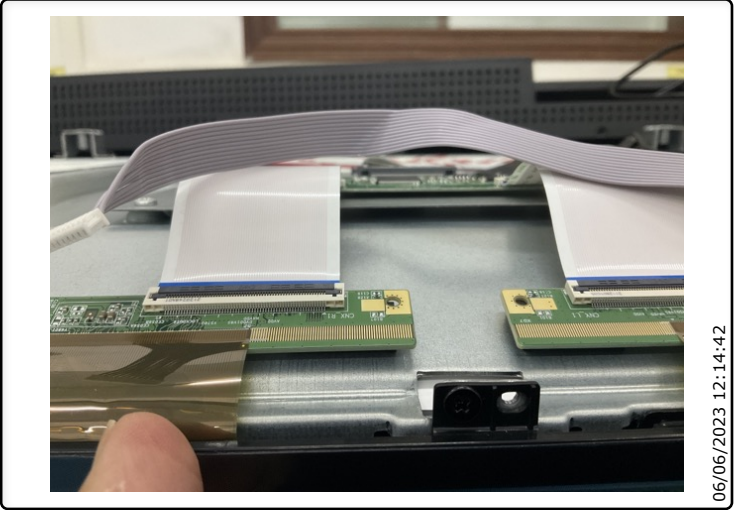


	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

1.5 / Internal Check - Tuner Module

PASSED


No mark

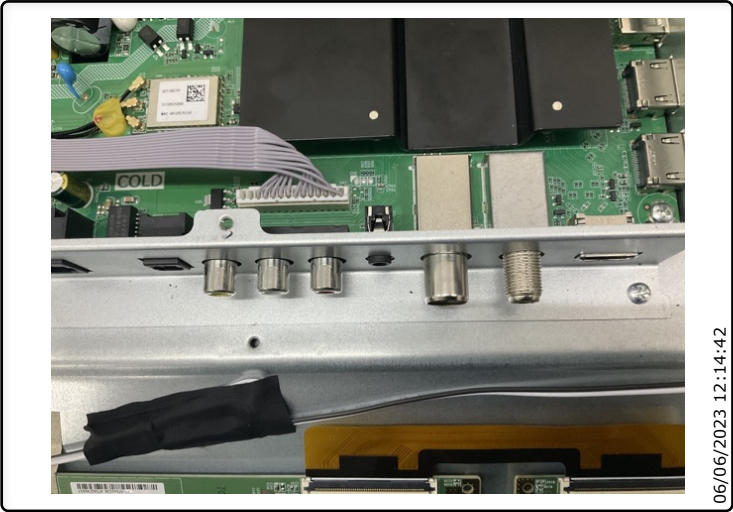

1.7 / Internal Check - Wifi Module.


PASSED

DCT10R2701

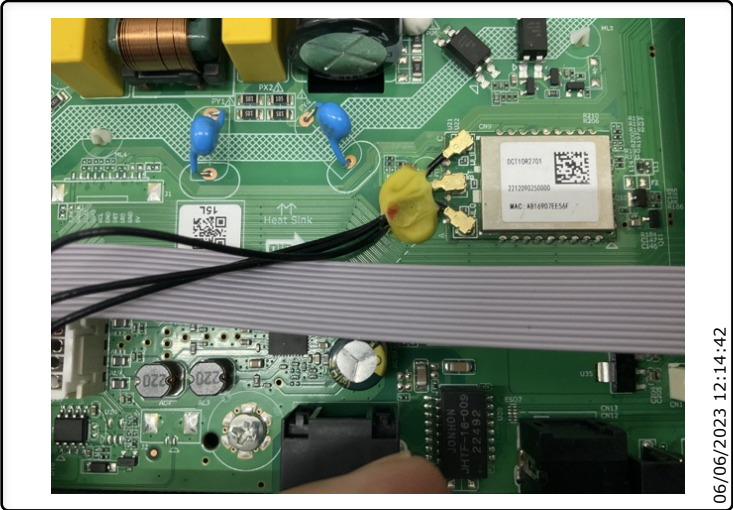

1.8 / Internal Check - Back Cover

PASSED


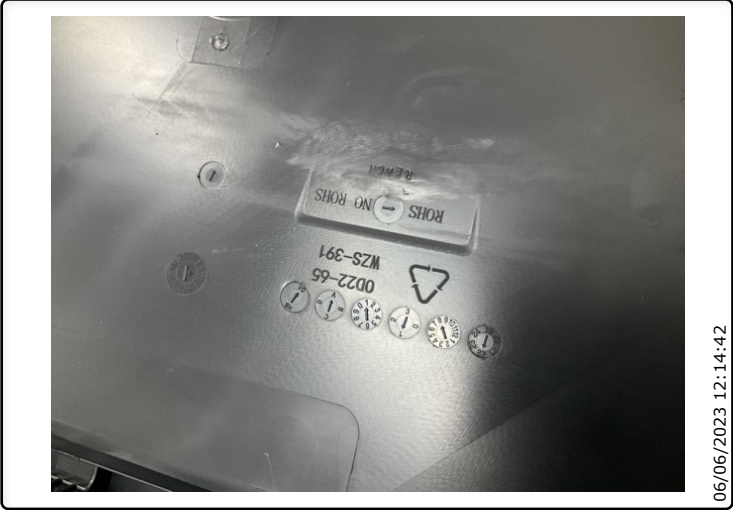


	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

1.9 / Internal Check - Speaker

PASSED

10 W X 2 .(Use dual magnetic box speaker)

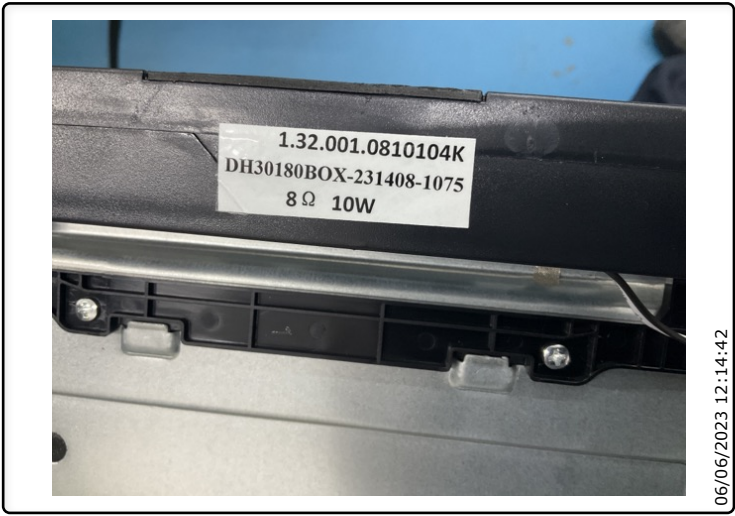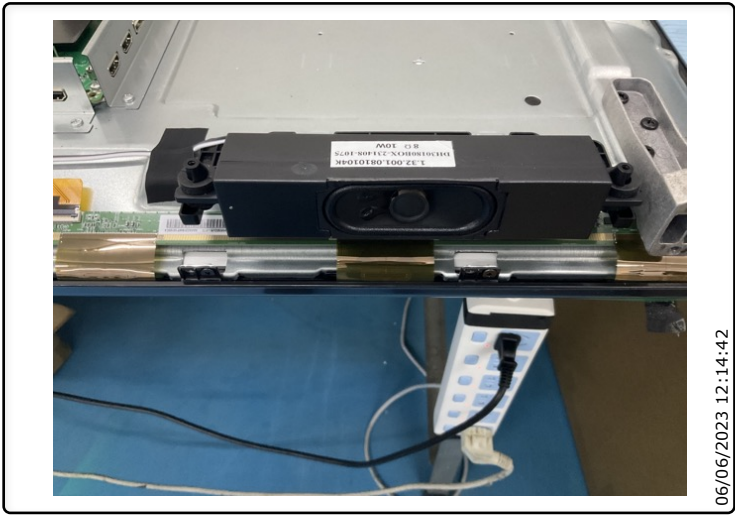

1.10 / Internal Check - Power Plug

PASSED




1.11 / Internal Check - Power cord

PASSED



	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

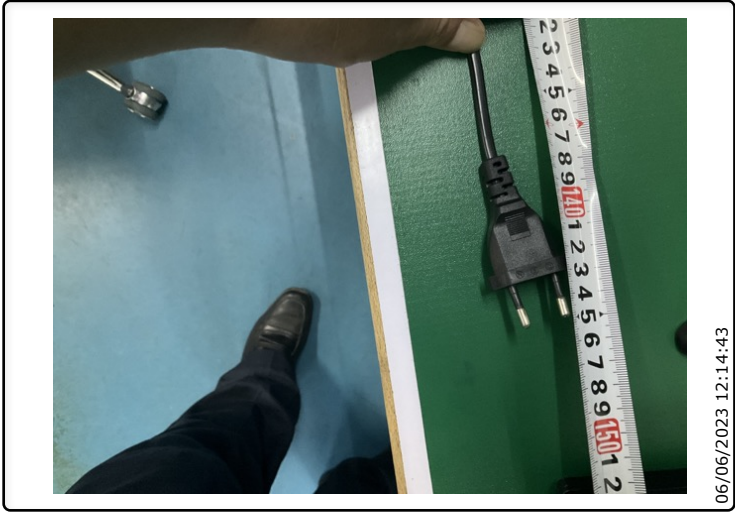

1.12 / Internal Check - Power board

FAILED

★ PO needs is P150-2851AV9.2 power main board , But sample is P150-2851AV9.7 model power board




2. POWER / SAFETY

PASSED

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

2.2 / Power / Safety - Power consumption (Std By)



PASSED

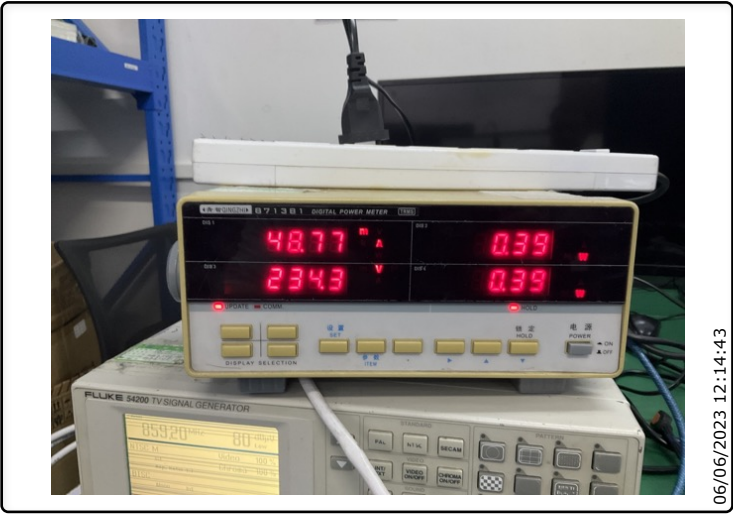

2.3 / Power / Safety - Power consumption (working)

PASSED

Max 129 W

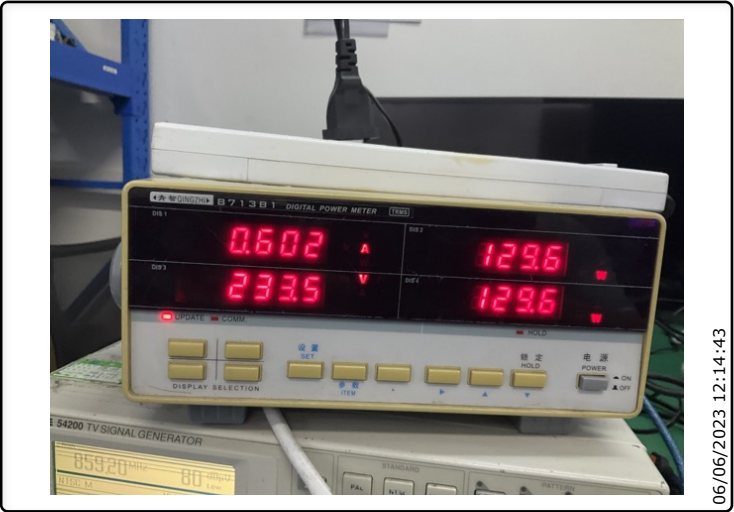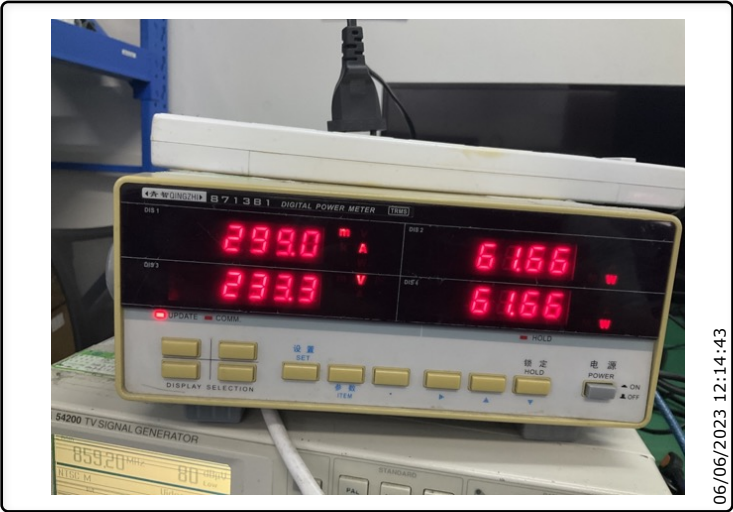

2.5 / Power / Safety - Power input test

PASSED

110-240V




MMK ASIA LIMITED	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

3. CONNECT

PASSED


3.1 / Connect - Wifi level

PASSED

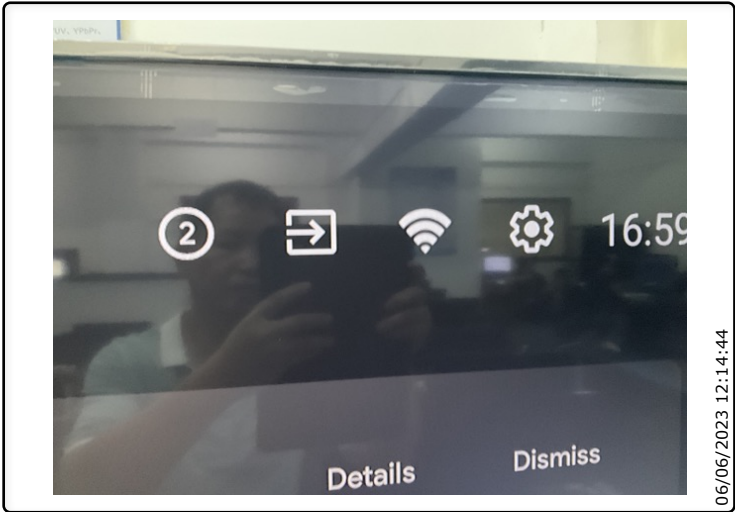


3.2 / Connect - Wifi Speed

PASSED

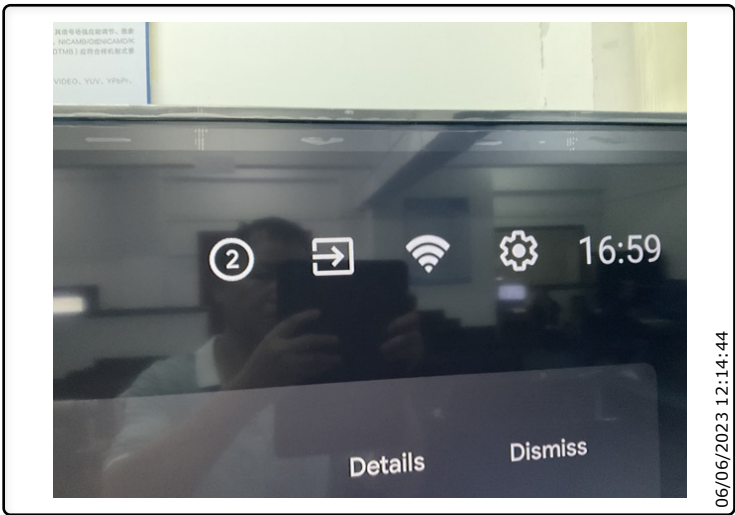

3.3 / Connect - Network port (LAN)

PASSED

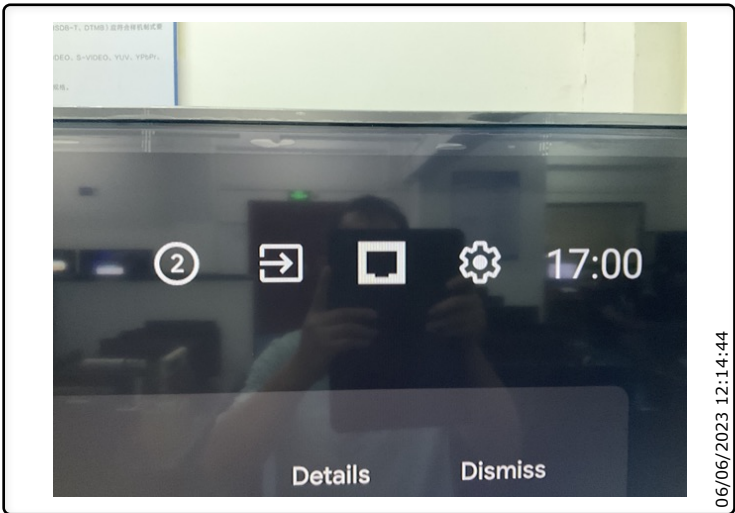

4. FUNCTIONS



FAILED

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

4.1 / Functions - ATV Programs


PASSED

PAL-BG/DK --OK。Not support SECAM-L(不支持SECAM-L)--Accepted by France

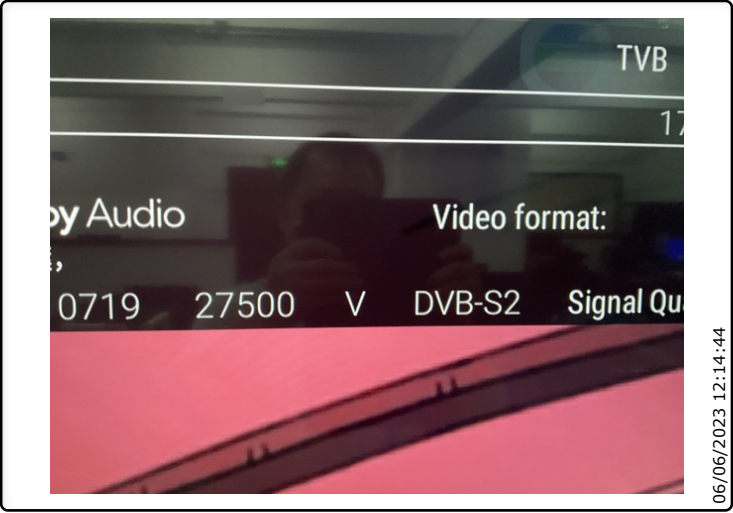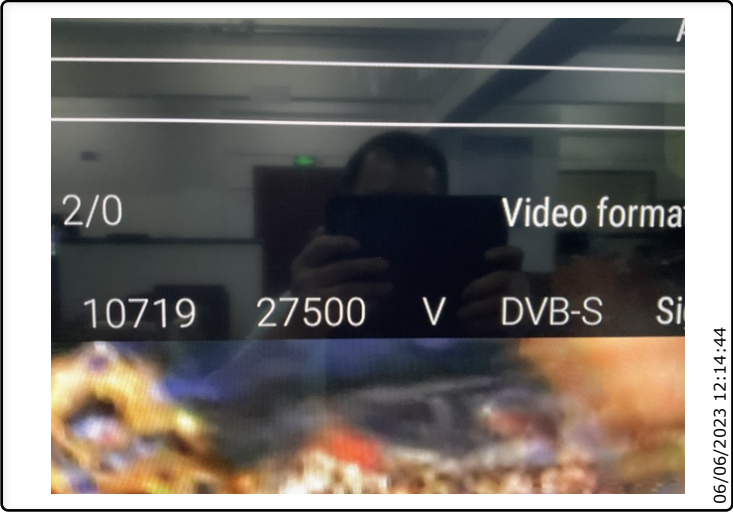

4.2 / Functions - AV Input

PASSED

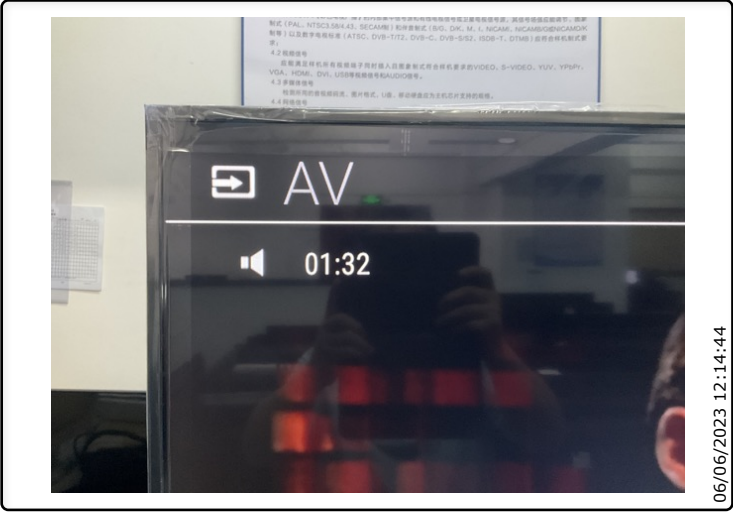


	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

4.3 / Functions - DVBT/T2 programs


PASSED

Tested:226.5/474/858MHZ OK.

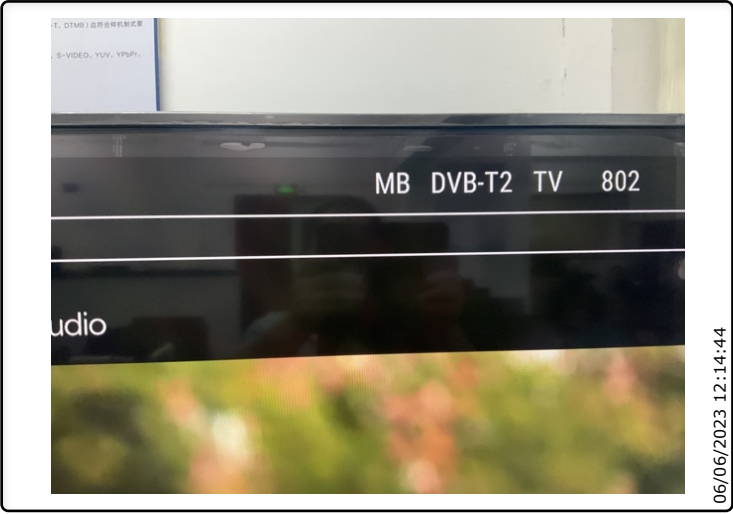

4.6 / Functions - YUV Input

PASSED

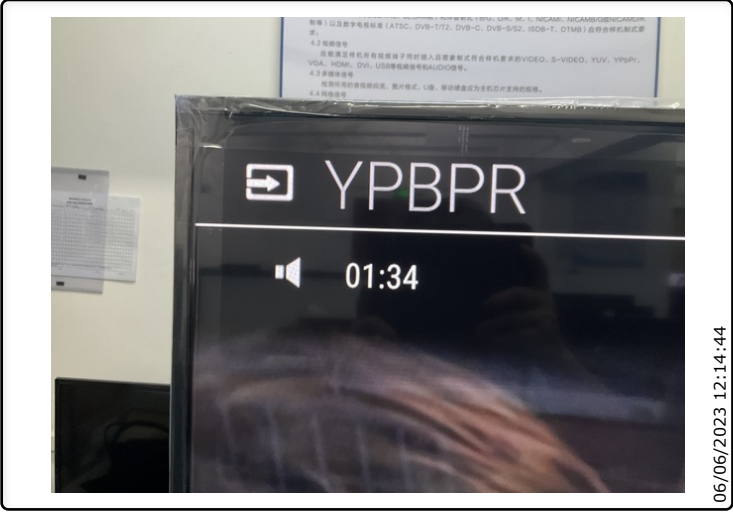

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	



4.11 / Functions - Media Play

PASSED



5. SOFTWARE

FAILED

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

5.1 / Software - WEB Browser

PASSED

Netflix, YouTube, Prime video APPS ect tested OK.






06/06/2023 12:14:44




06/06/2023 12:14:44



06/06/2023 12:14:44

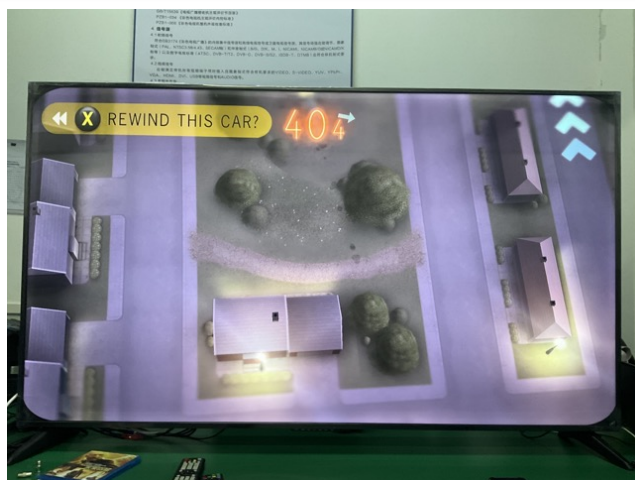

06/06/2023 12:14:45


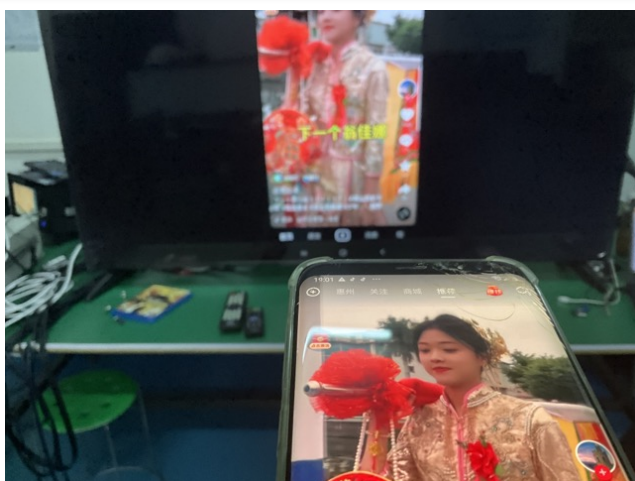


06/06/2023 12:14:45



06/06/2023 12:14:45



MMK ASIA LIMITED	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

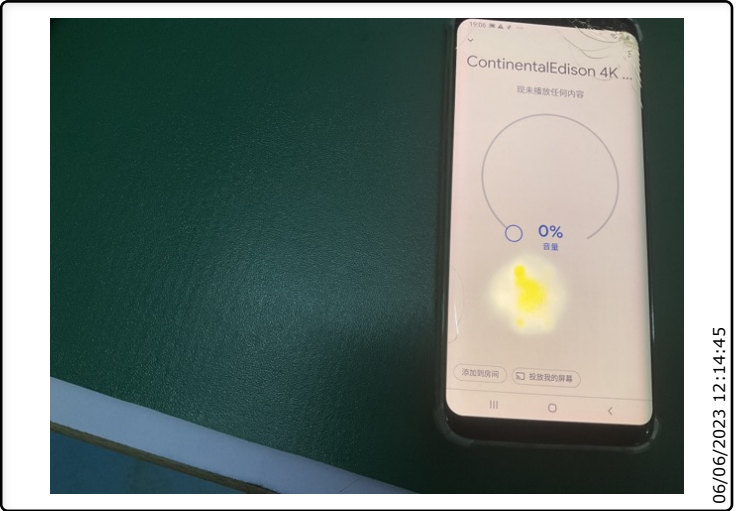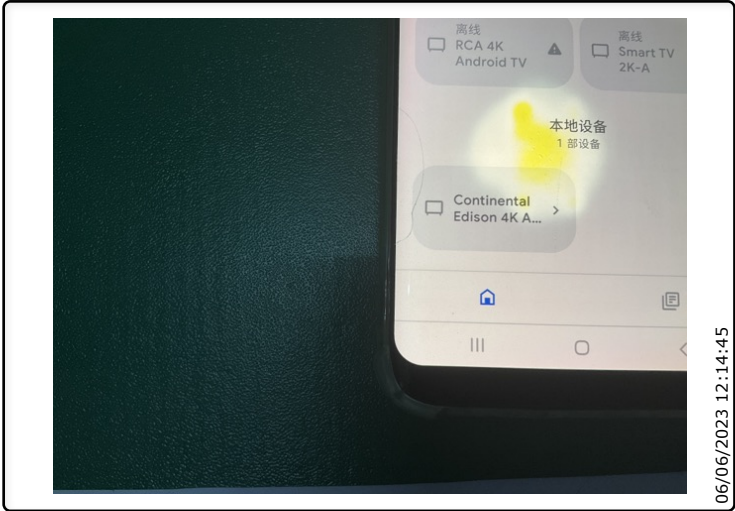


5.3 / Software - First install guide


PASSED

1.Need arrange the "language" selection after the open LOGO (需要将“语言”选择编排在开机LOGO之后)--Accepted 2:Needs to cancel sound of First install Guide.(需要取消首次安装指南的声音)。--Accepted 3.Needs to cancel "KONKA " character on menu(需要取消菜单上的“KONKA”字符)KONKA Reply:It's key for sample. plesae check in MP. It will be no 'Konka' character. ---Accepted

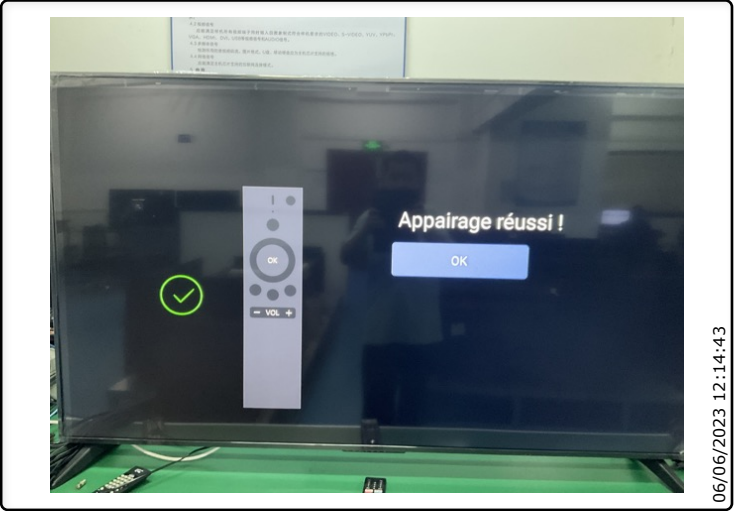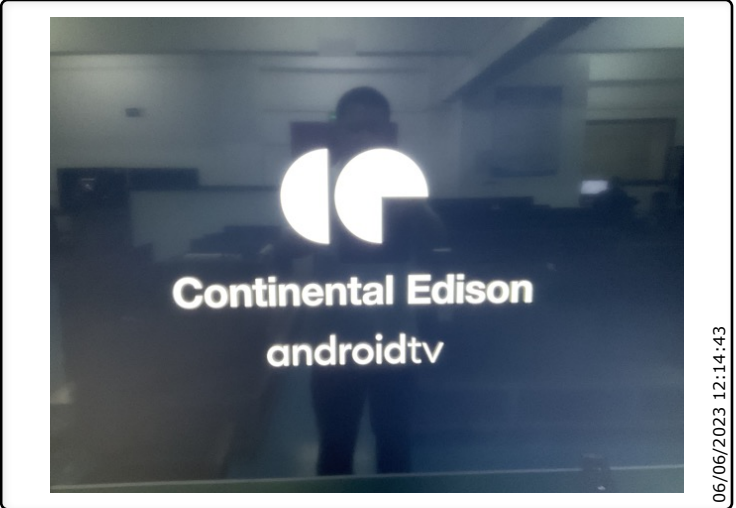


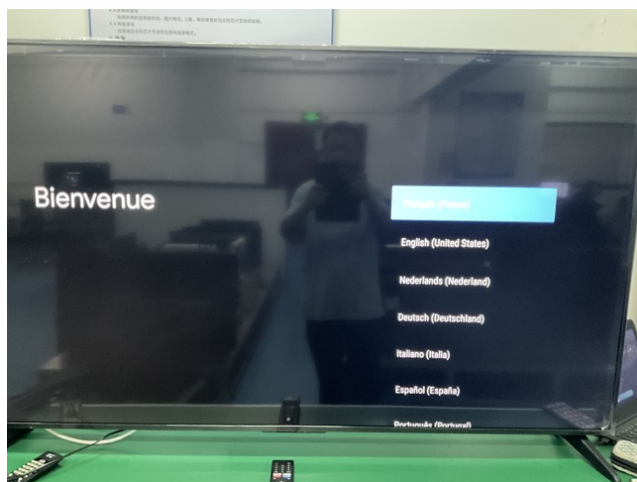


06/06/2023 12:14:43

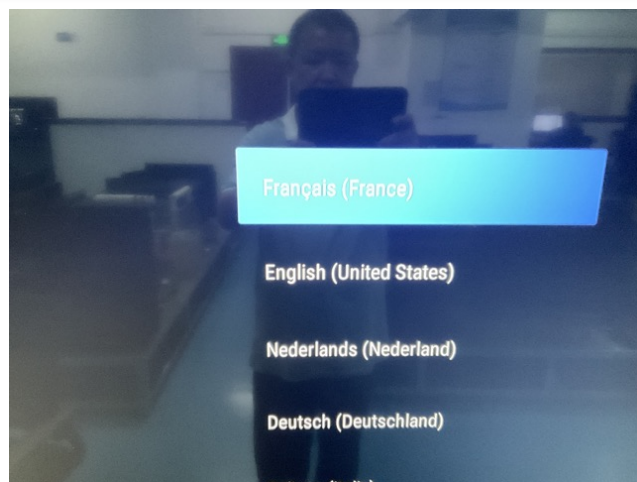


06/06/2023 12:14:43

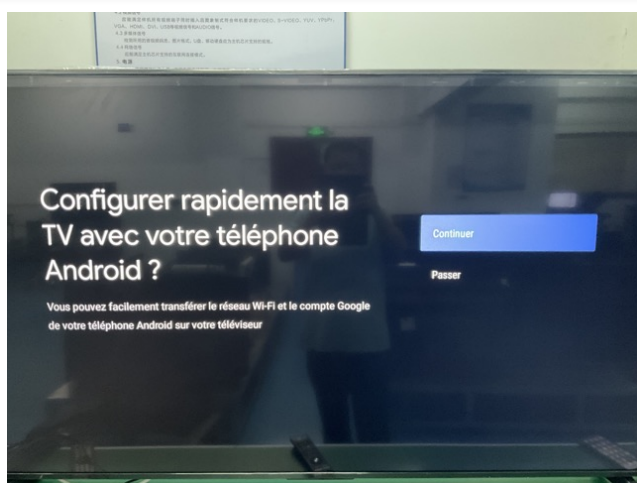


06/06/2023 12:14:43

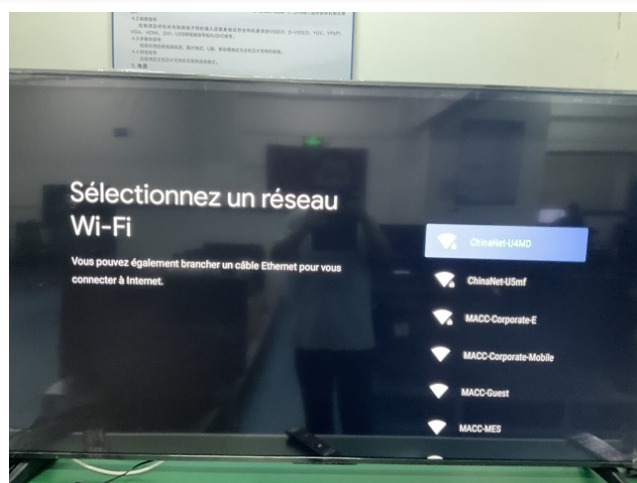

06/06/2023 12:14:43

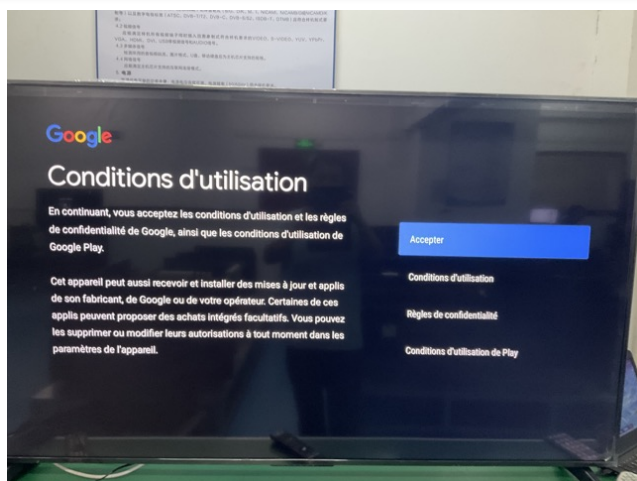

06/06/2023 12:14:43

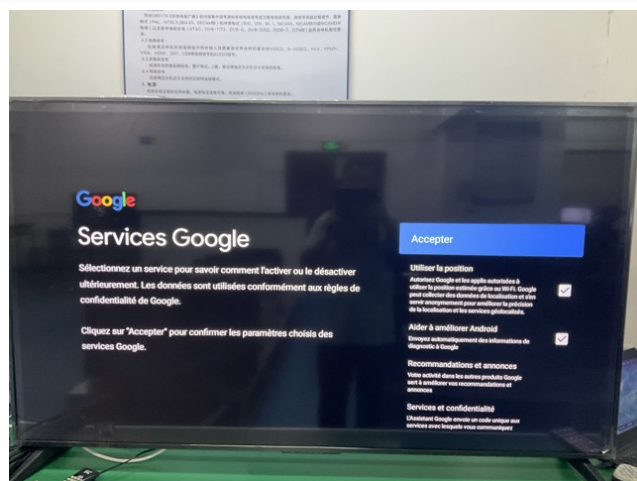


06/06/2023 12:14:43



06/06/2023 12:14:43




06/06/2023 12:14:43

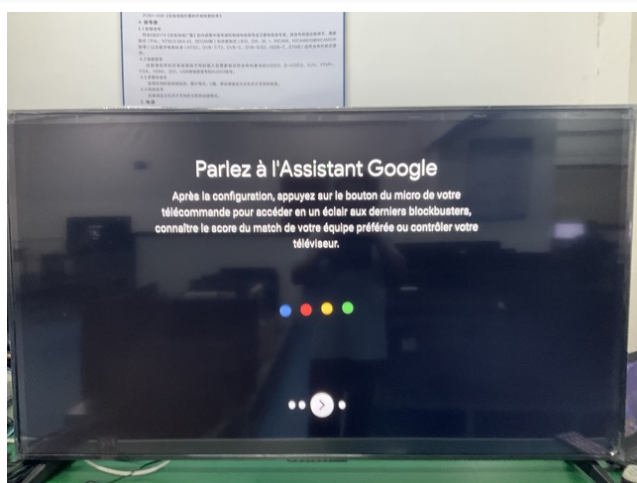


06/06/2023 12:14:43




06/06/2023 12:14:43

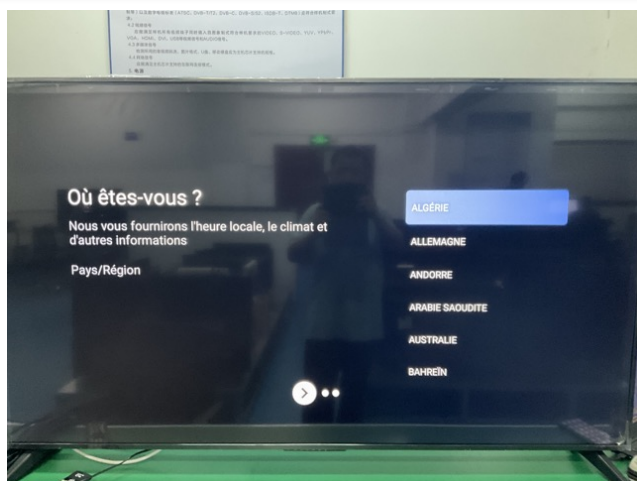


06/06/2023 12:14:43

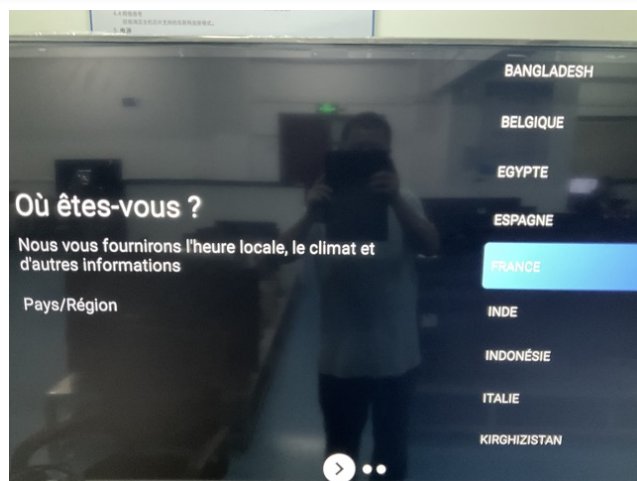


06/06/2023 12:14:43

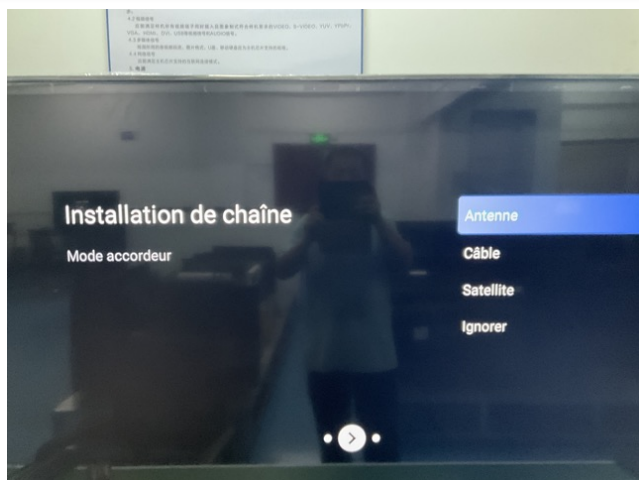


06/06/2023 12:14:43

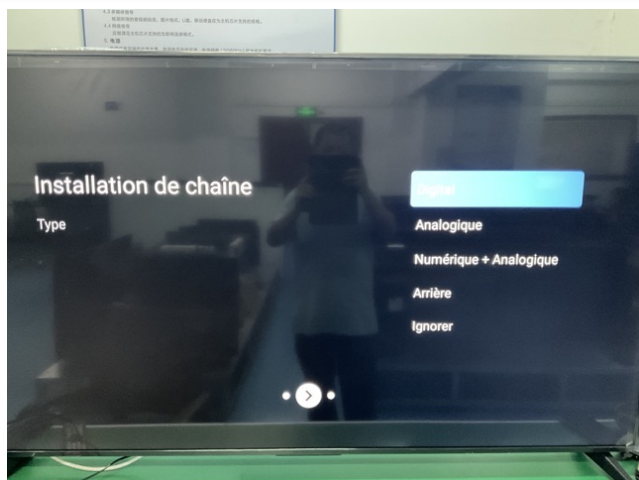


06/06/2023 12:14:43

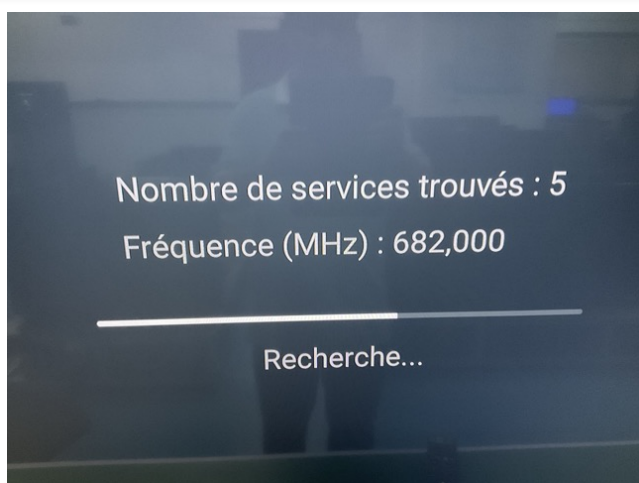


06/06/2023 12:14:43

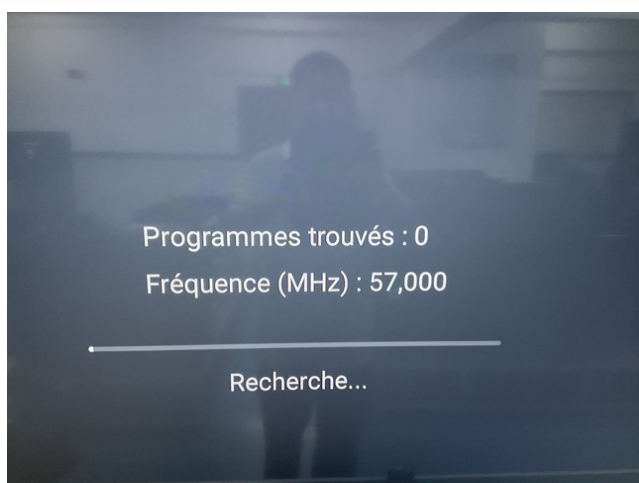


06/06/2023 12:14:43

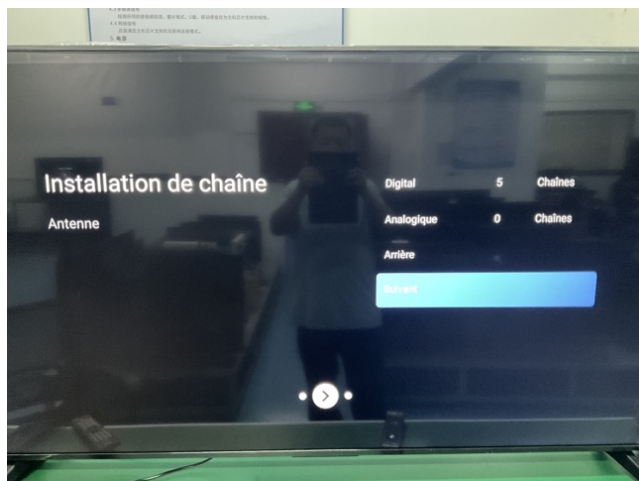


06/06/2023 12:14:43

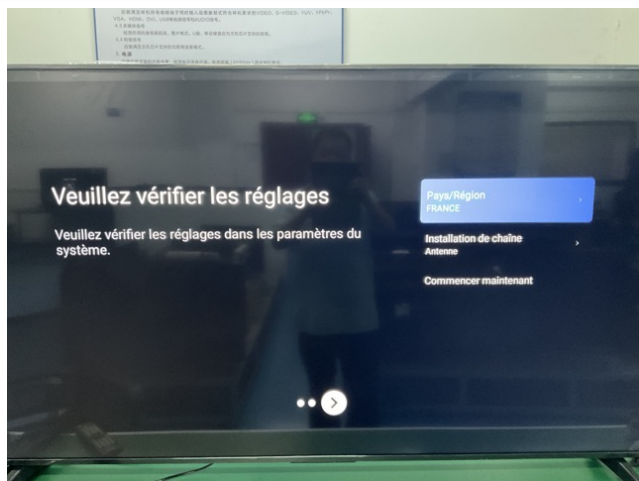

06/06/2023 12:14:43

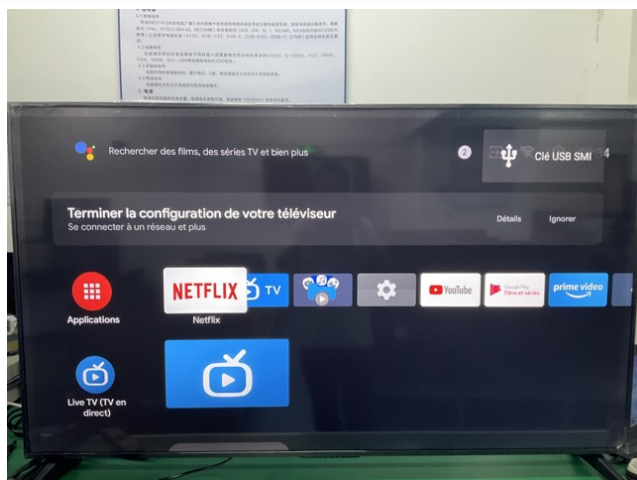

06/06/2023 12:14:43

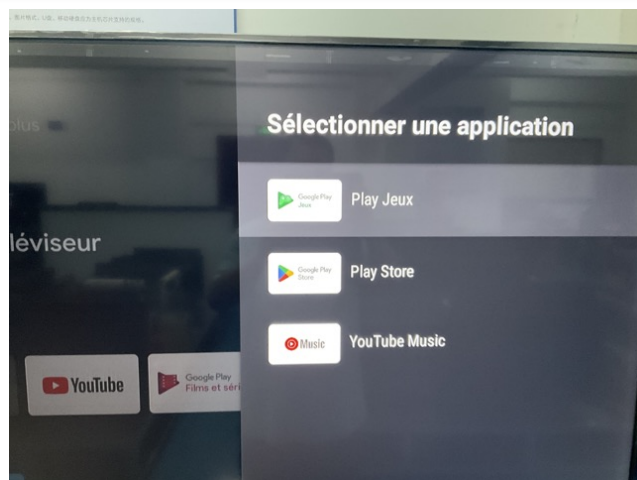


06/06/2023 12:14:43




06/06/2023 12:14:43




06/06/2023 12:14:43

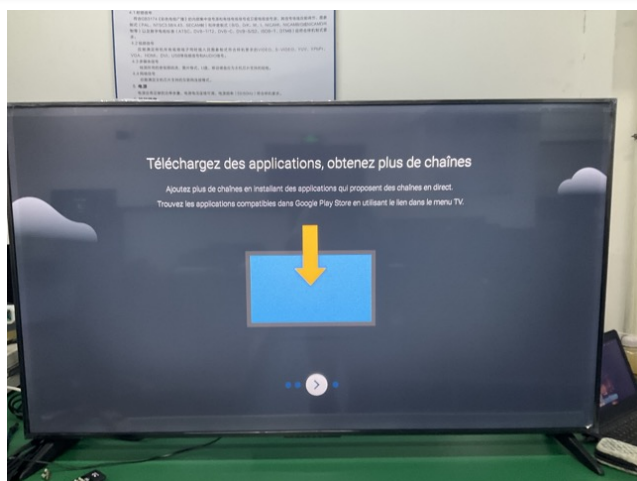


06/06/2023 12:14:43

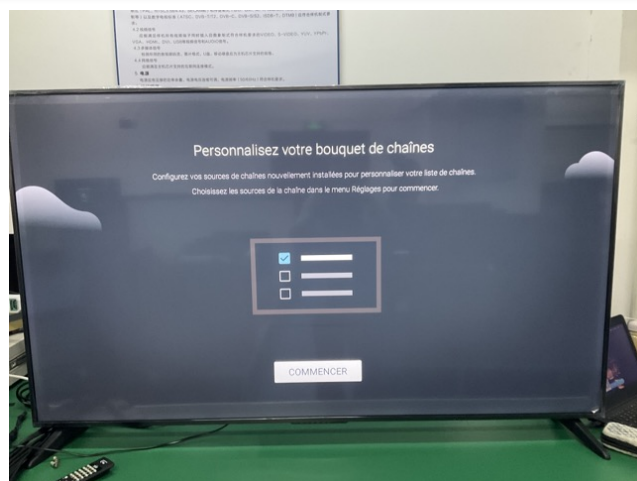

06/06/2023 12:14:43

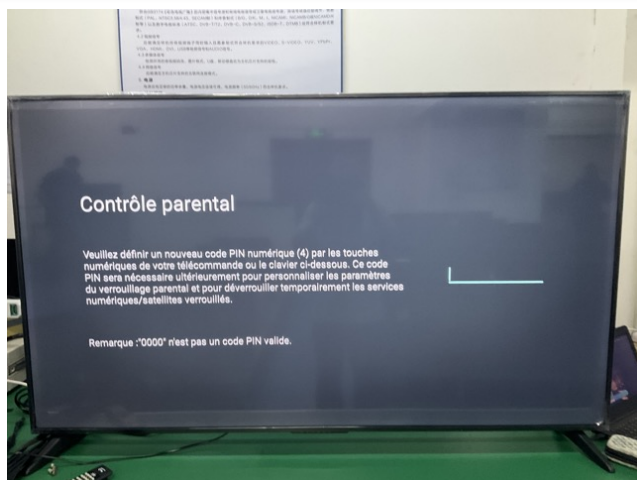


06/06/2023 12:14:43

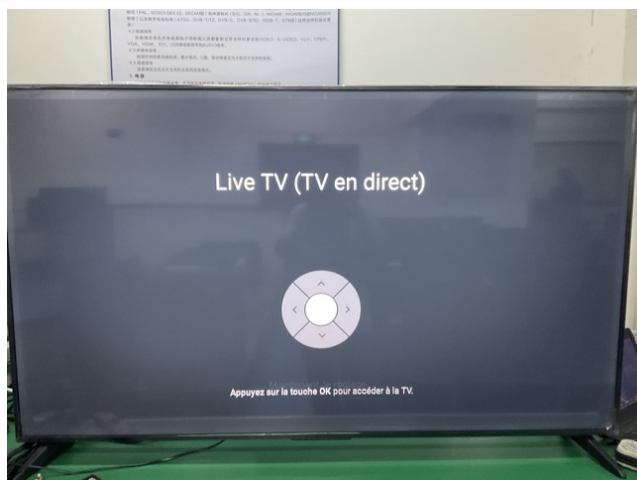

06/06/2023 12:14:43




06/06/2023 12:14:43

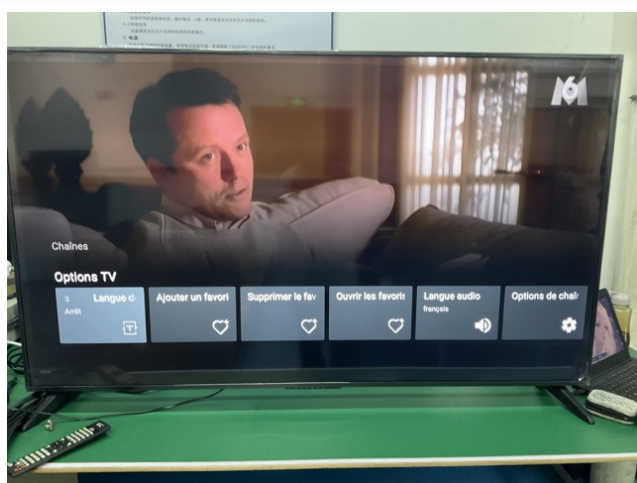


06/06/2023 12:14:43




06/06/2023 12:14:43

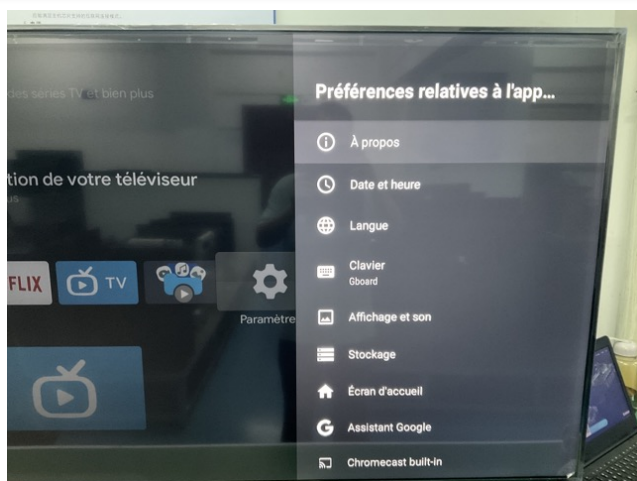


06/06/2023 12:14:43

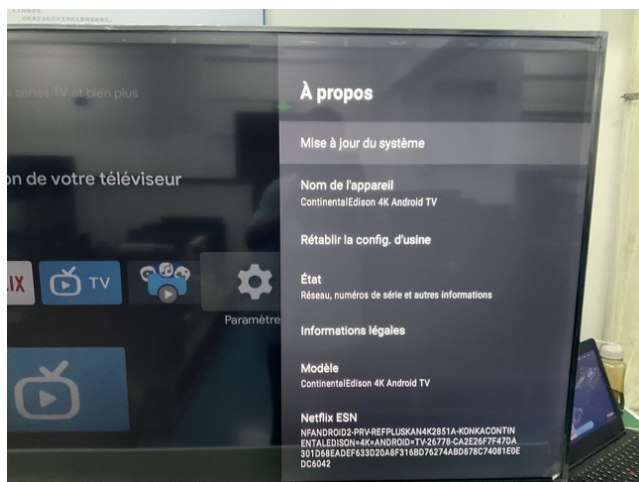


06/06/2023 12:14:43

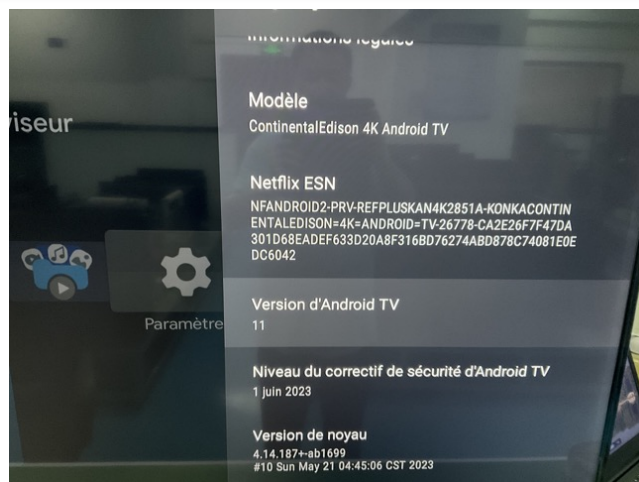


06/06/2023 12:14:43

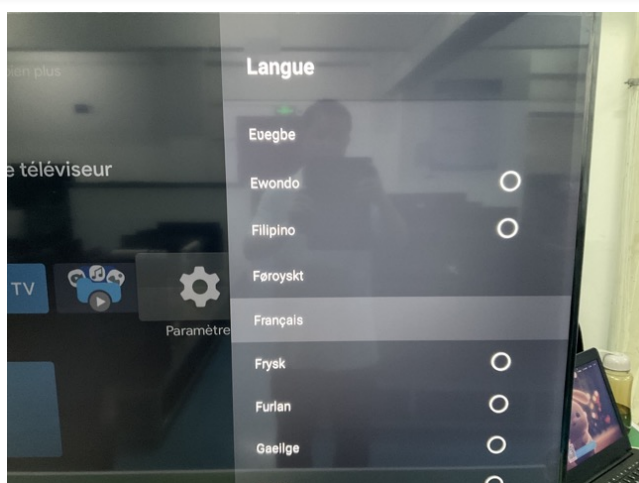

06/06/2023 12:14:43

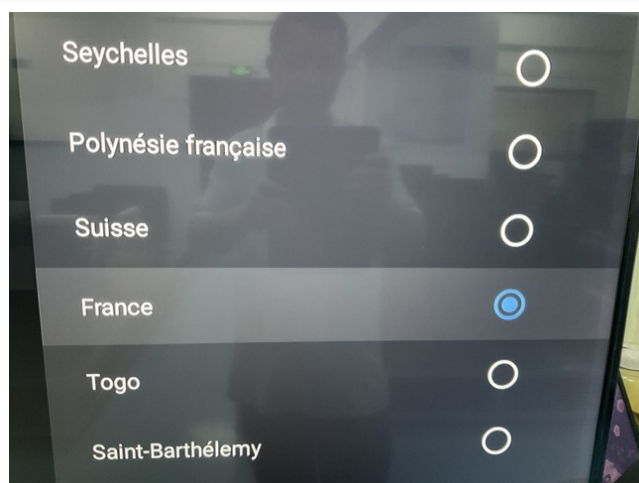

06/06/2023 12:14:43





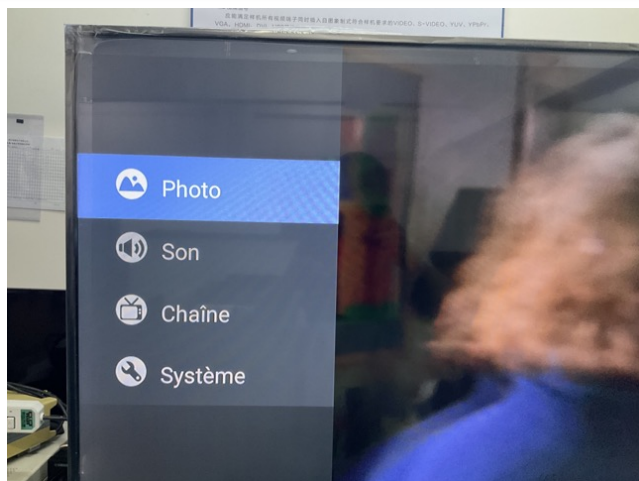


06/06/2023 12:14:43




06/06/2023 12:14:43

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

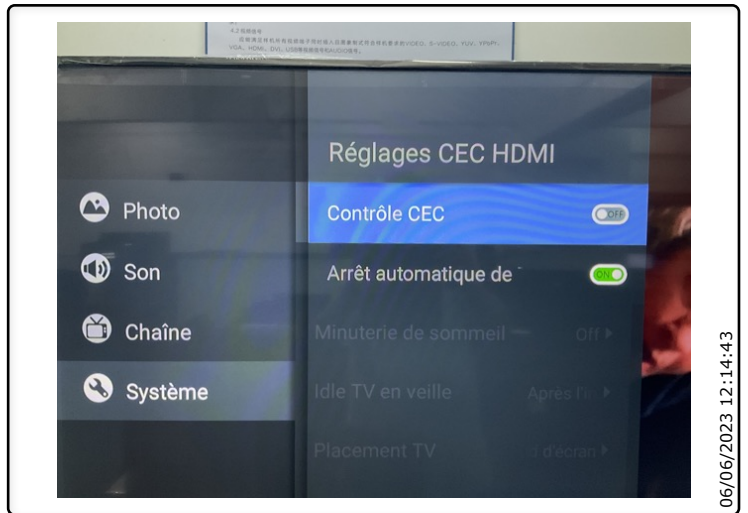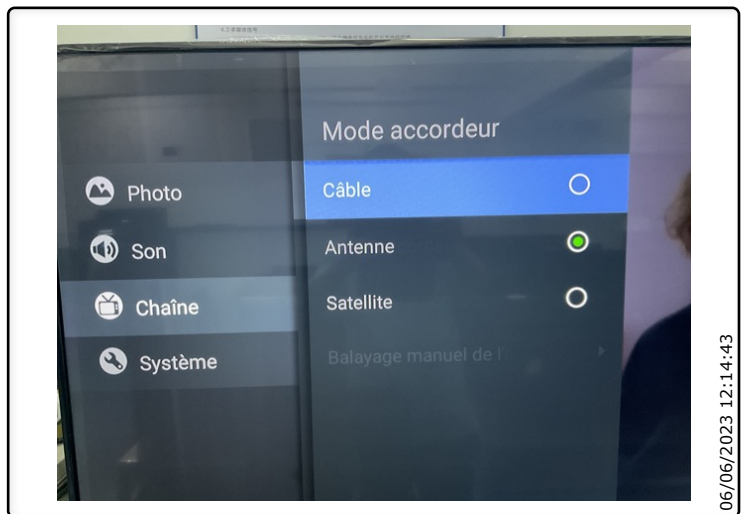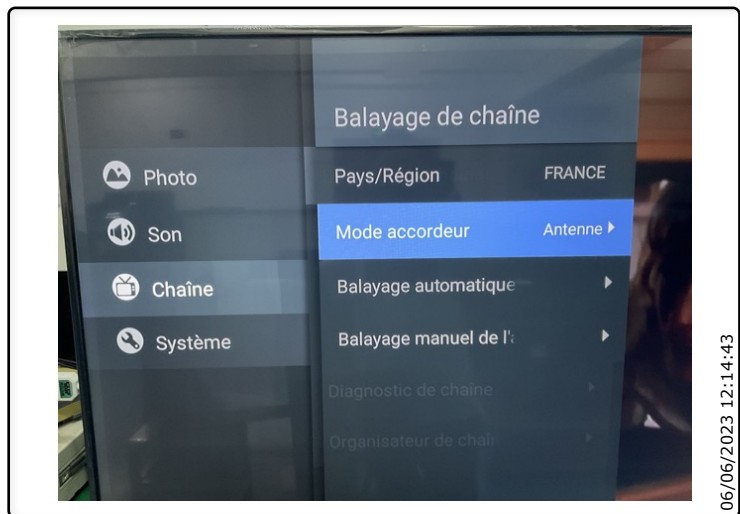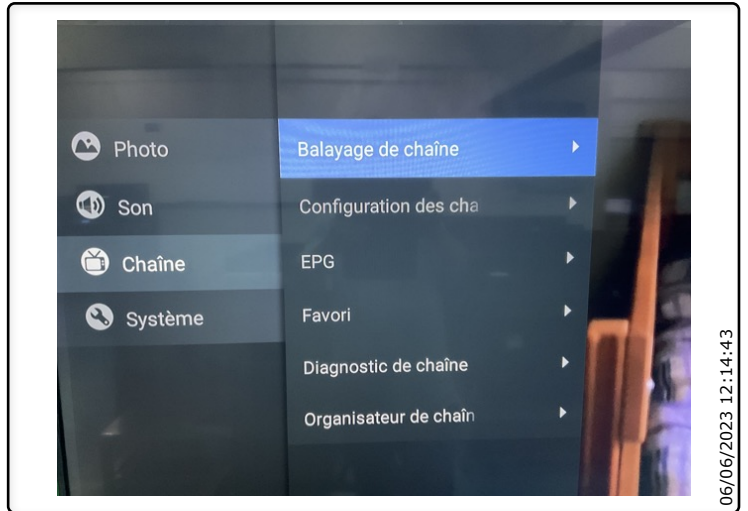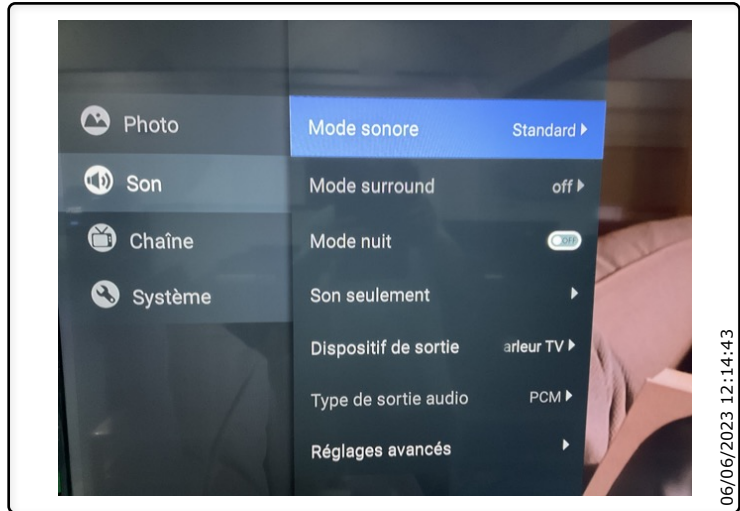





06/06/2023 12:14:43

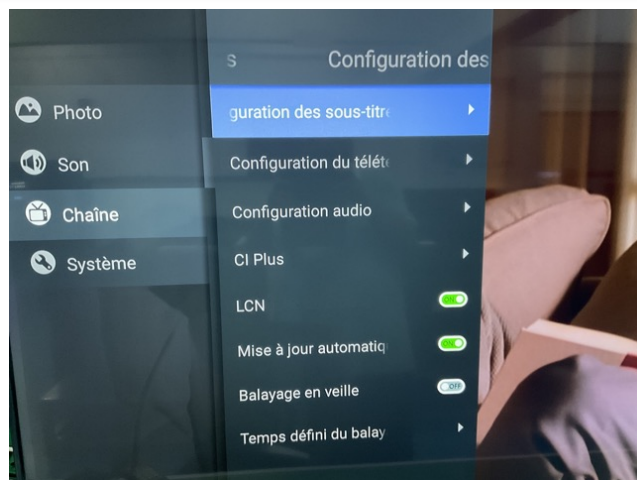

06/06/2023 12:14:43

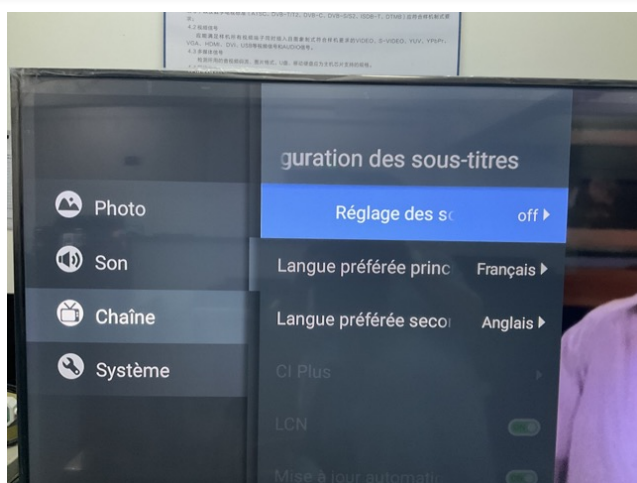

06/06/2023 12:14:43

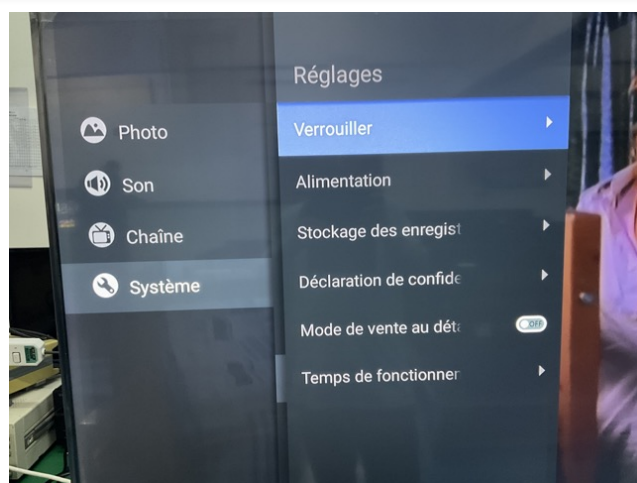


06/06/2023 12:14:43




06/06/2023 12:14:43




06/06/2023 12:14:43

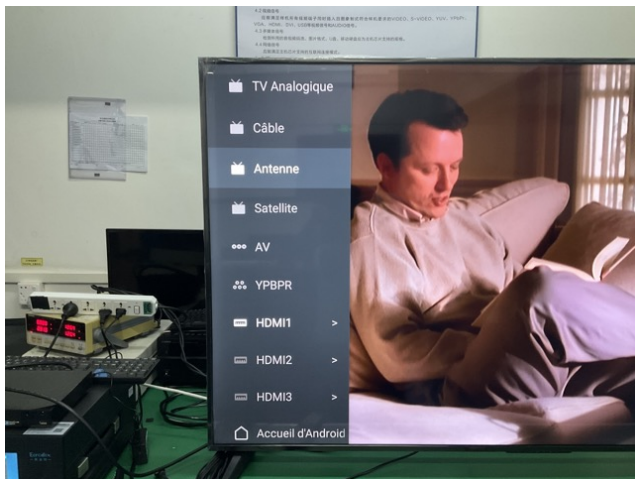


06/06/2023 12:14:43

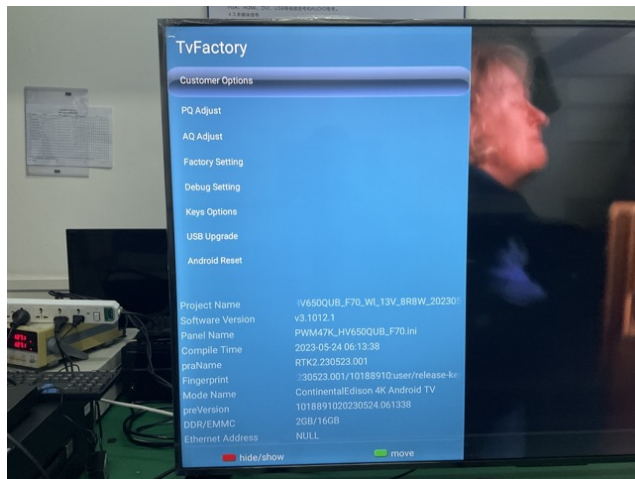


06/06/2023 12:14:43

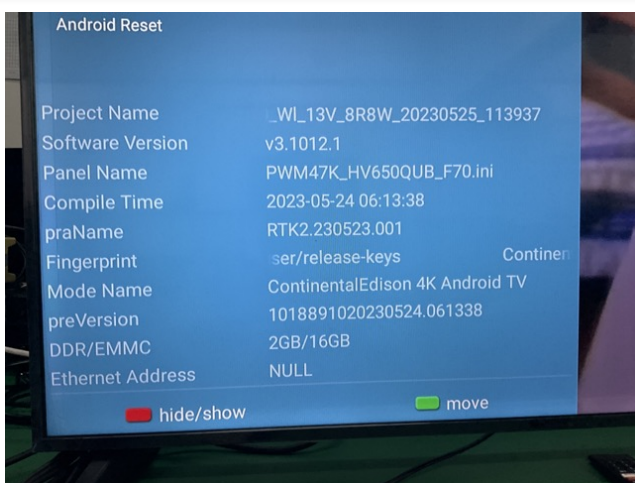


06/06/2023 12:14:43

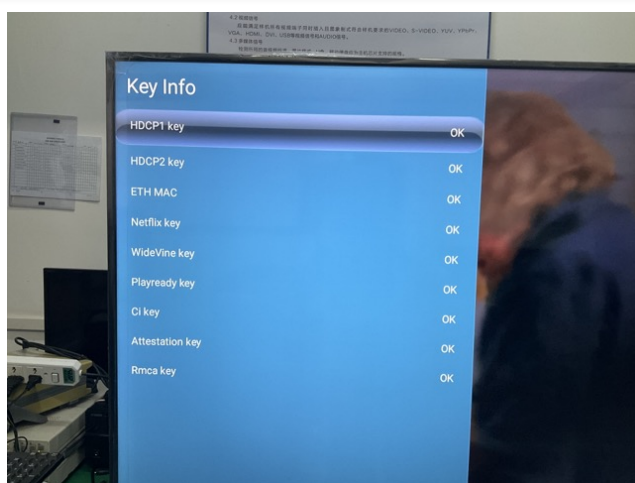

06/06/2023 12:14:43





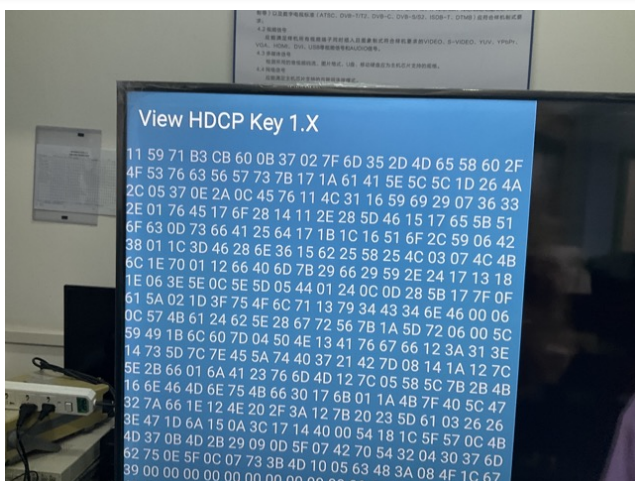



06/06/2023 12:14:43

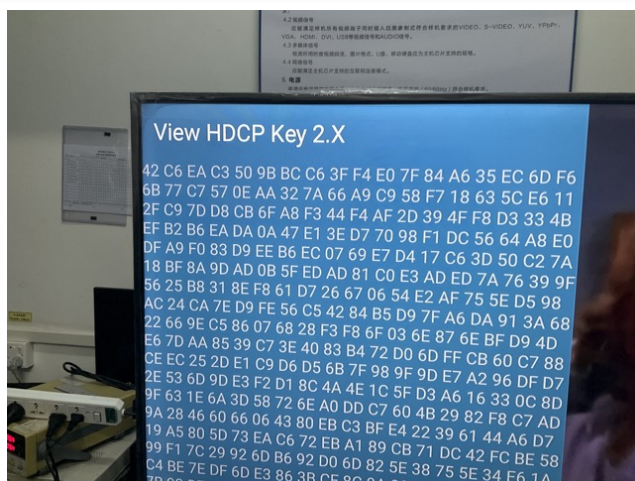


06/06/2023 12:14:43

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

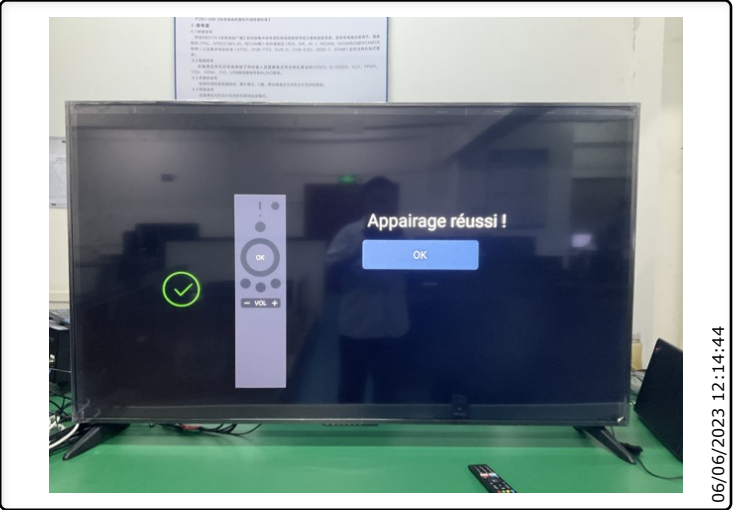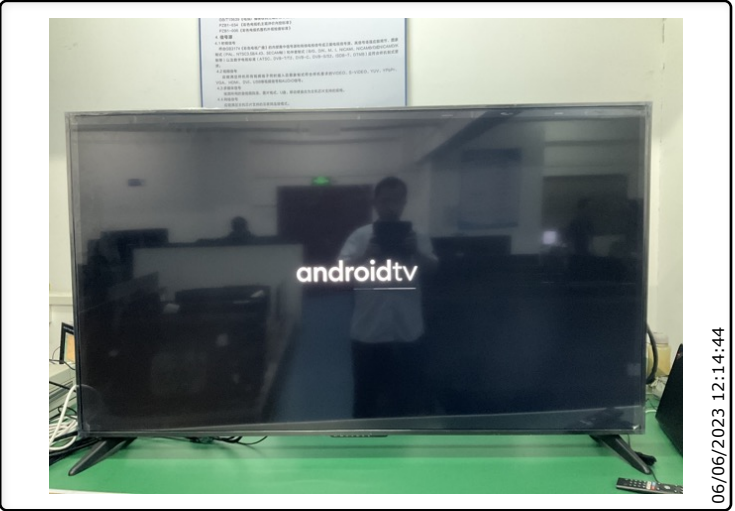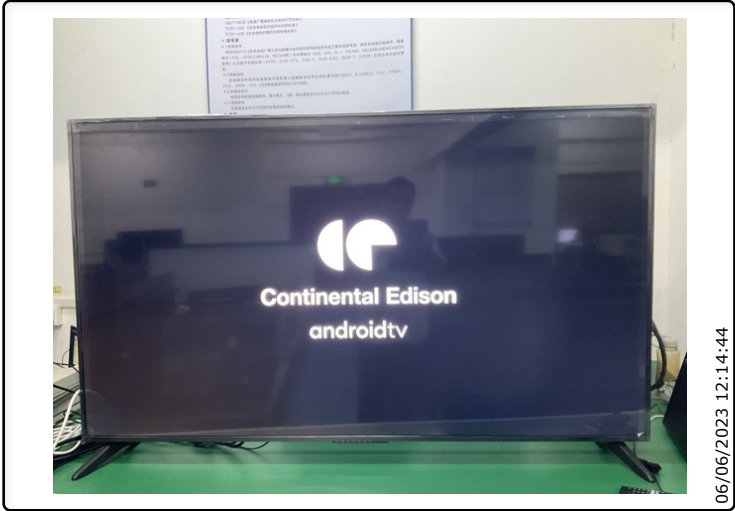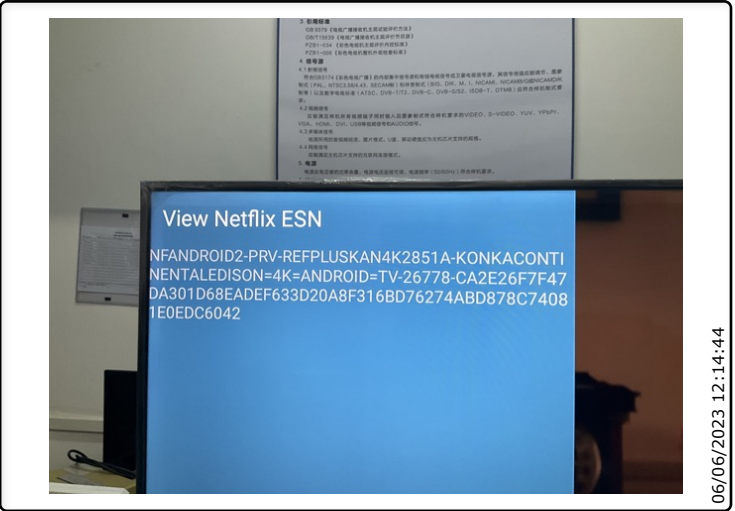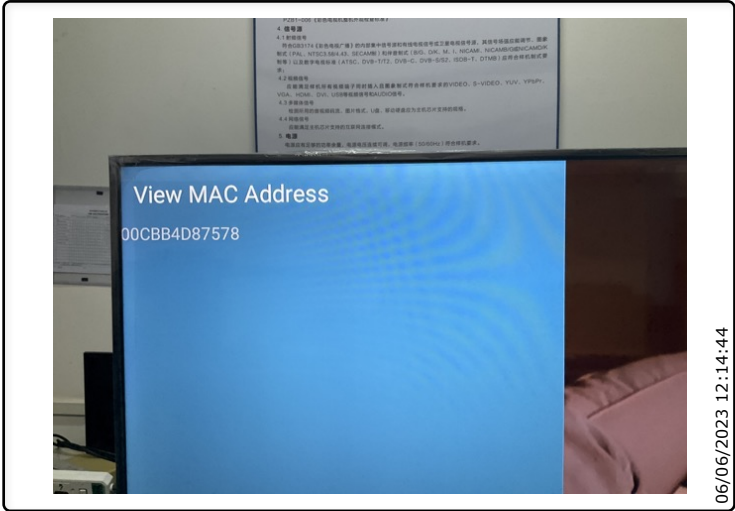


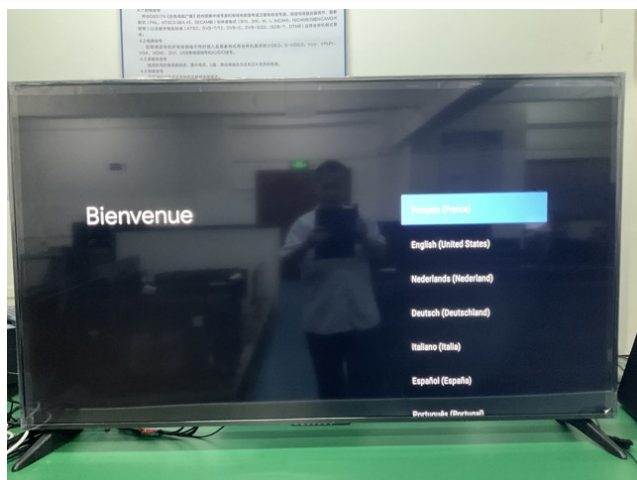


06/06/2023 12:14:44

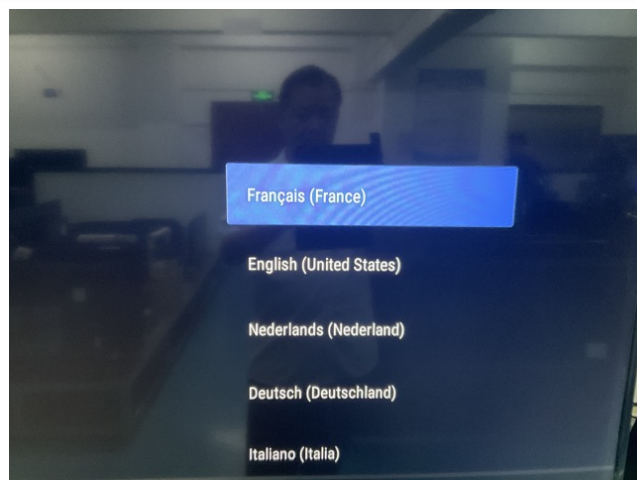


06/06/2023 12:14:44

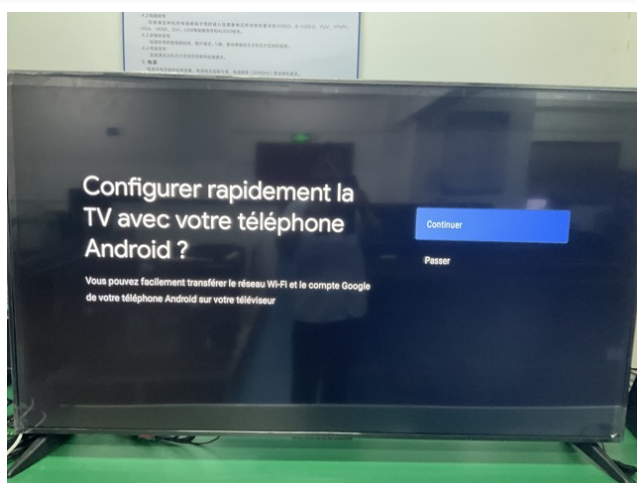


06/06/2023 12:14:44

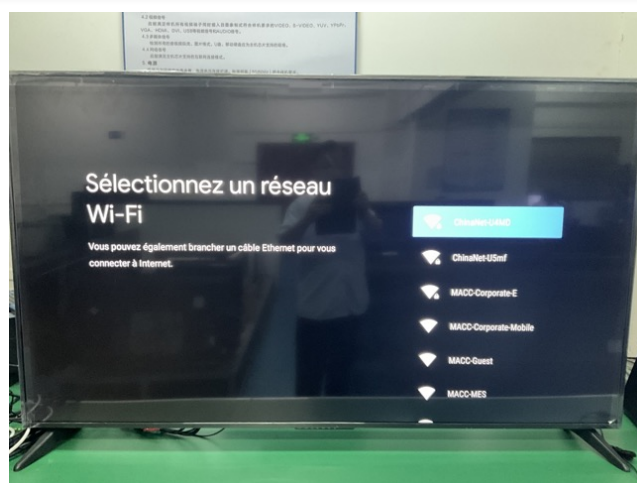

06/06/2023 12:14:44

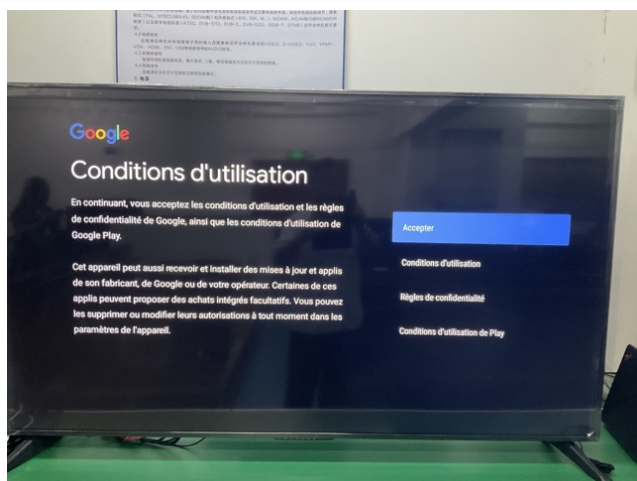

06/06/2023 12:14:44

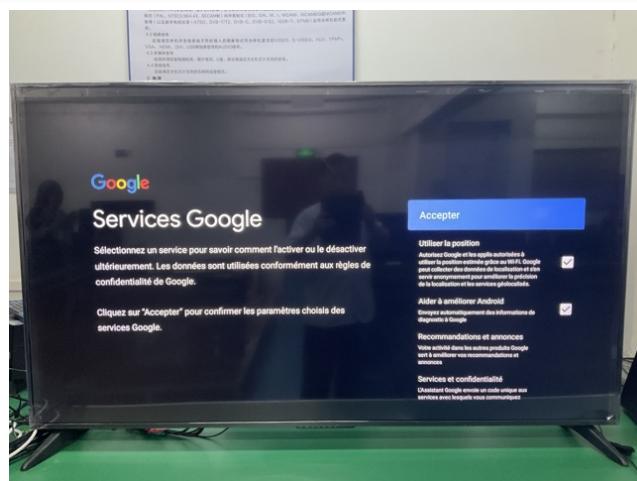

06/06/2023 12:14:44



06/06/2023 12:14:44




06/06/2023 12:14:44




06/06/2023 12:14:44




06/06/2023 12:14:44

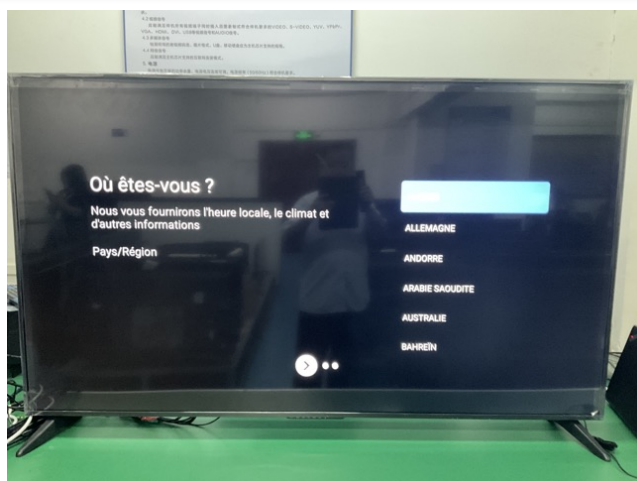


06/06/2023 12:14:44

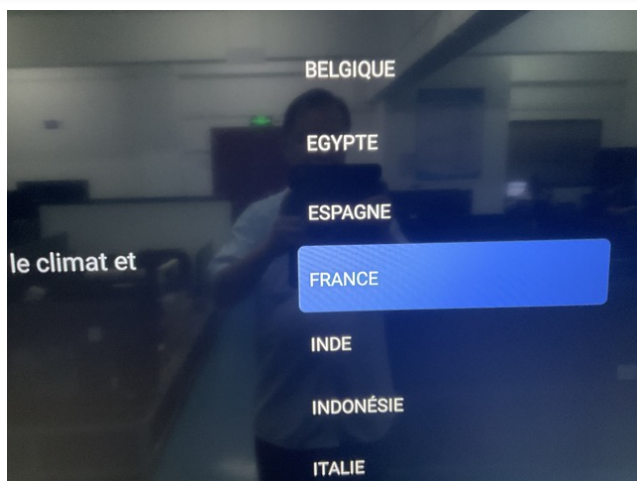


06/06/2023 12:14:44

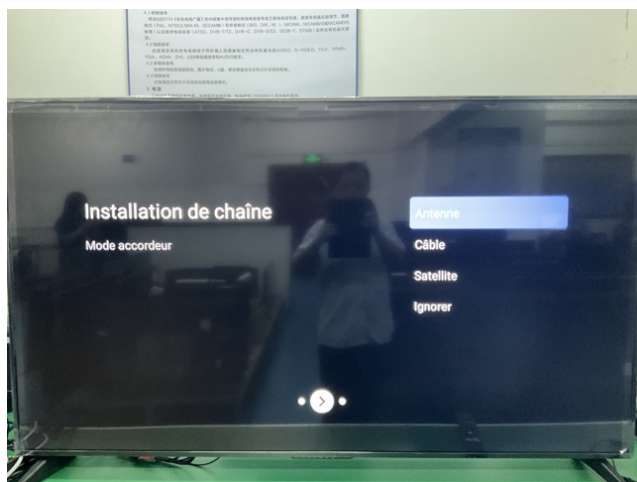


06/06/2023 12:14:44

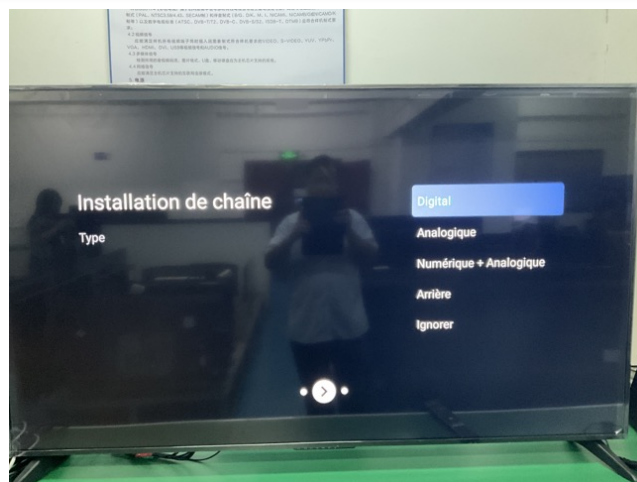


06/06/2023 12:14:44

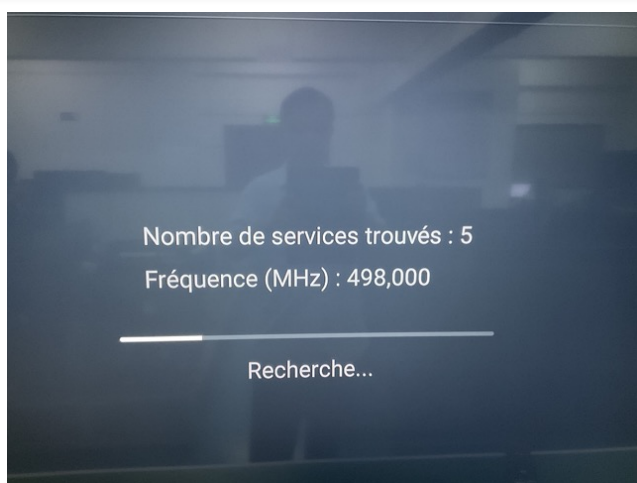


06/06/2023 12:14:44

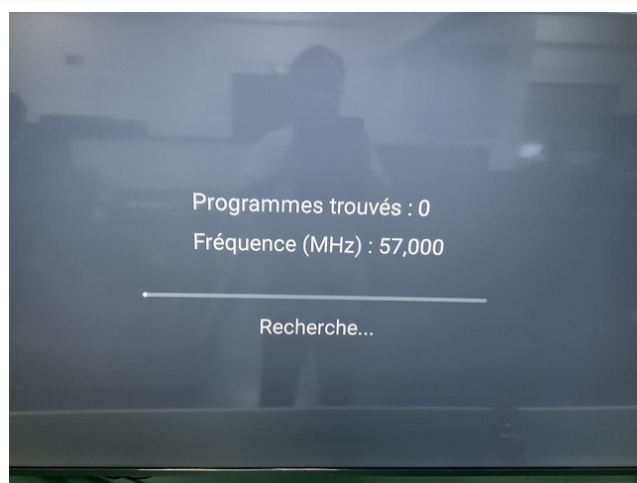


06/06/2023 12:14:45

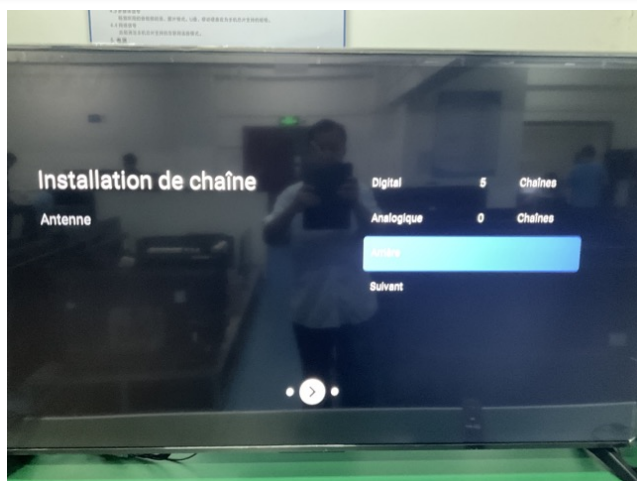


06/06/2023 12:14:45

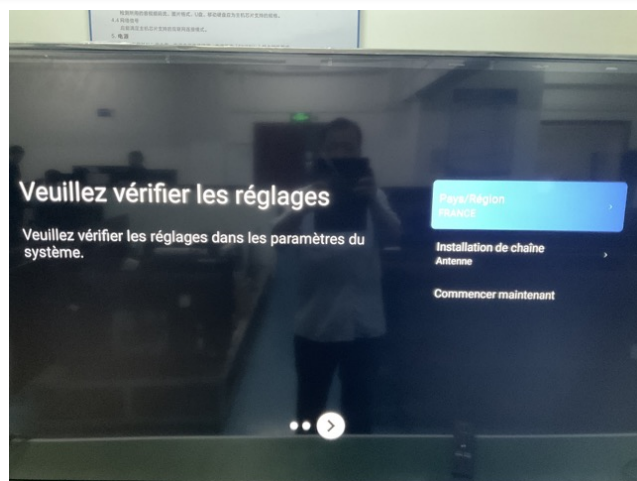


06/06/2023 12:14:45

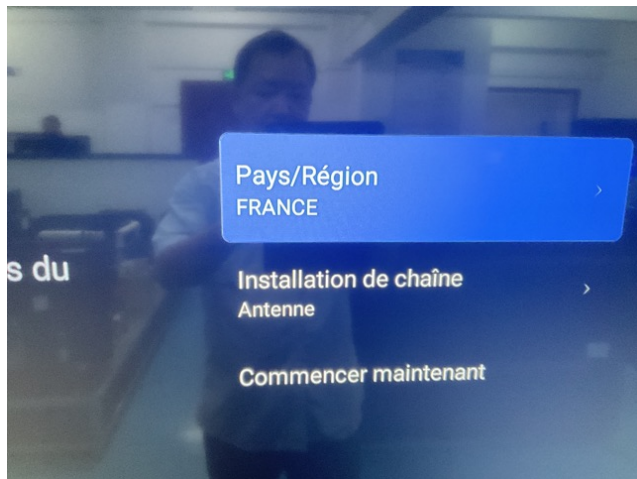

06/06/2023 12:14:45

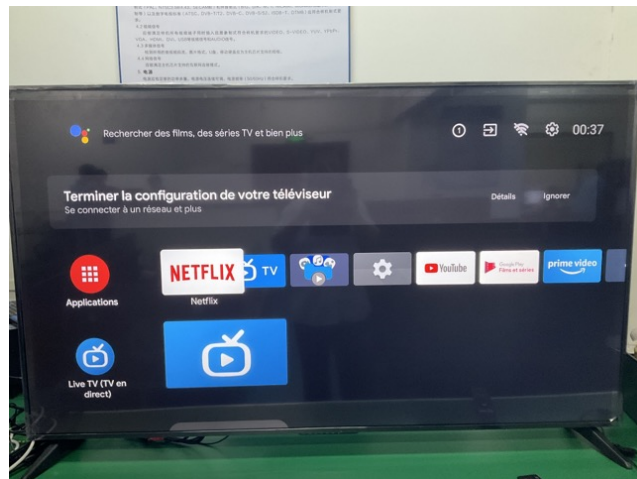

06/06/2023 12:14:45

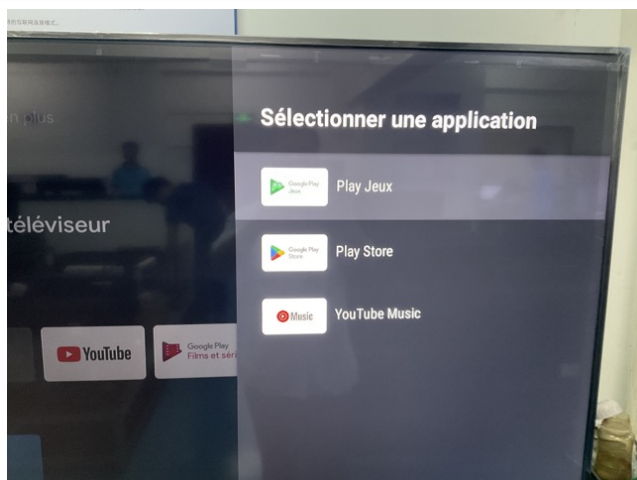


06/06/2023 12:14:45




06/06/2023 12:14:45



06/06/2023 12:14:45

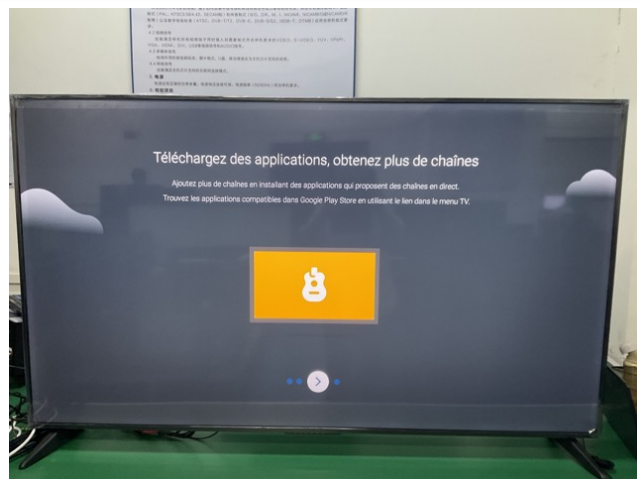

06/06/2023 12:14:45

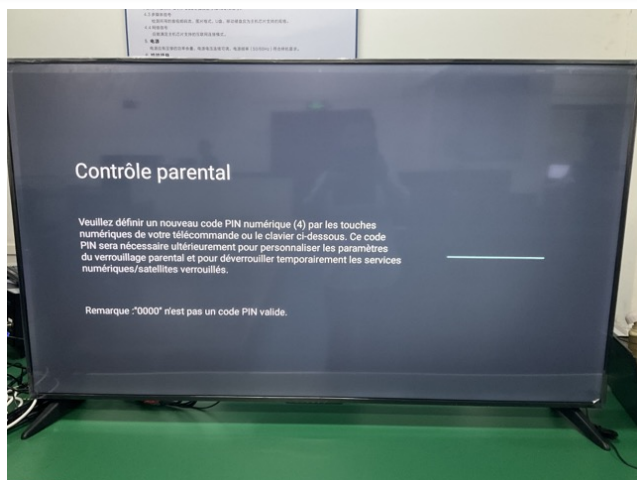

06/06/2023 12:14:45




06/06/2023 12:14:45




06/06/2023 12:14:45



06/06/2023 12:14:45




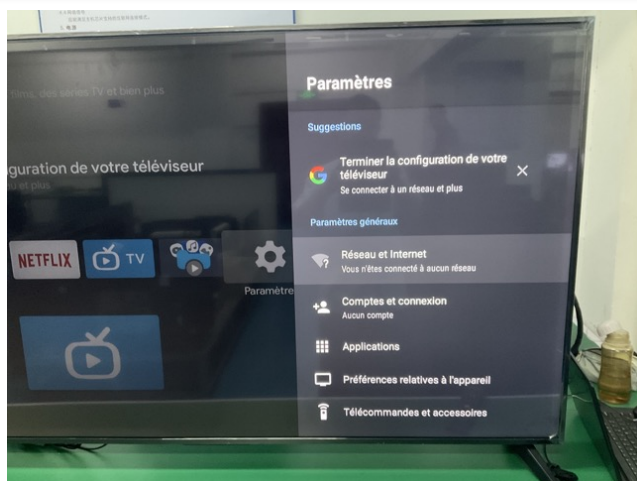



06/06/2023 12:14:45

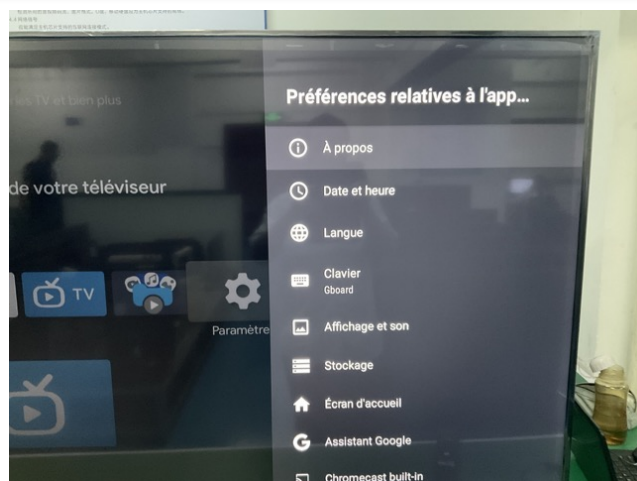


06/06/2023 12:14:45

MMK ASIA LIMITED	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

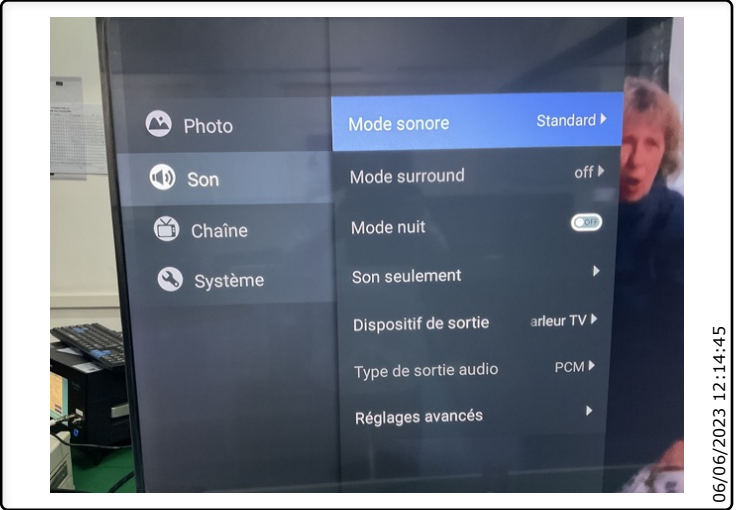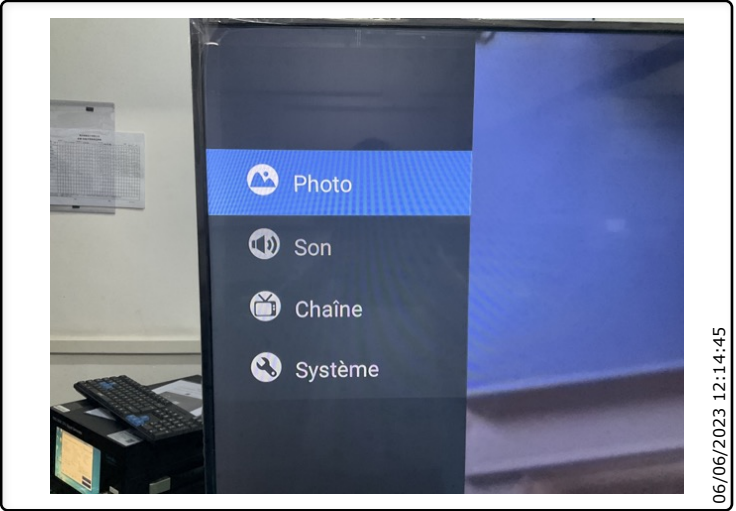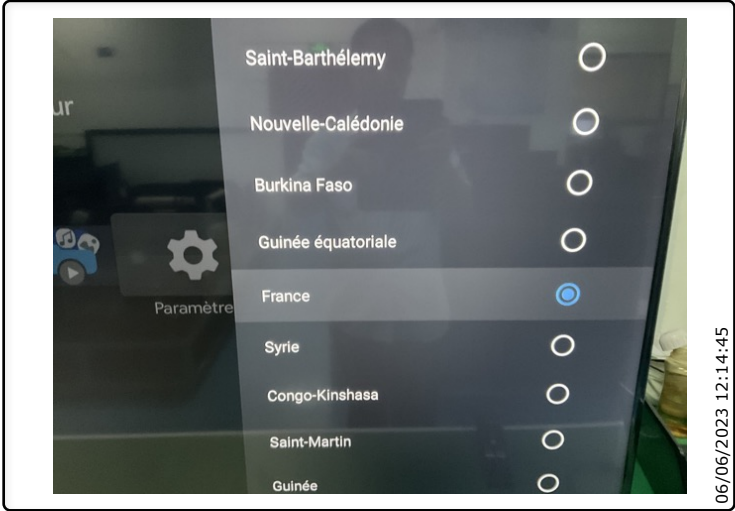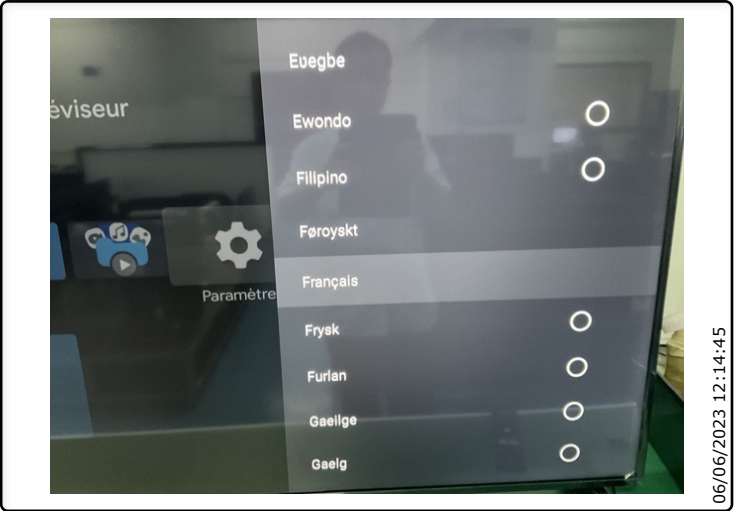

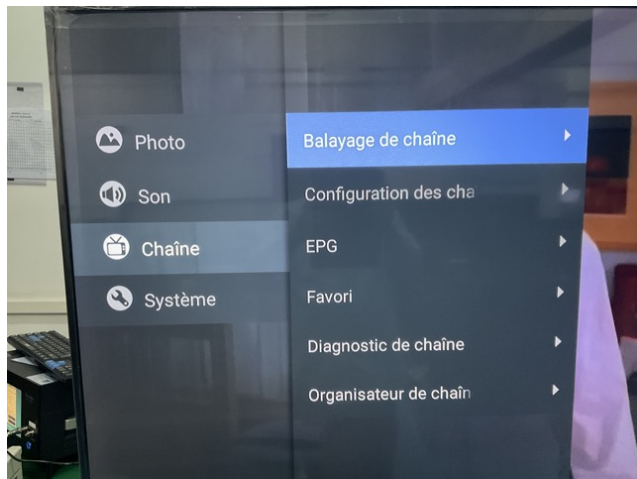


06/06/2023 12:14:45

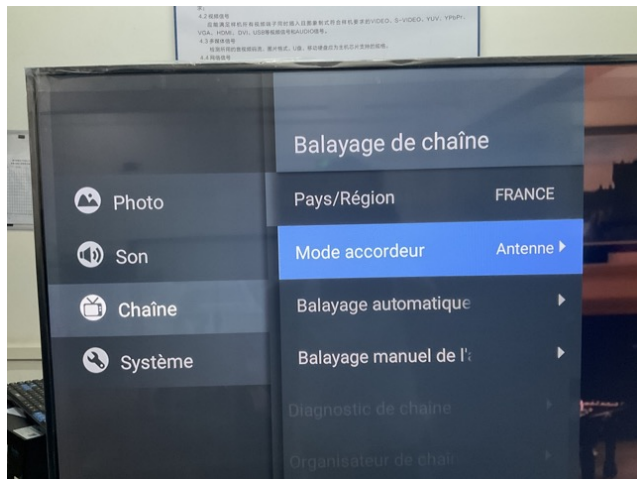

06/06/2023 12:14:45



06/06/2023 12:14:45

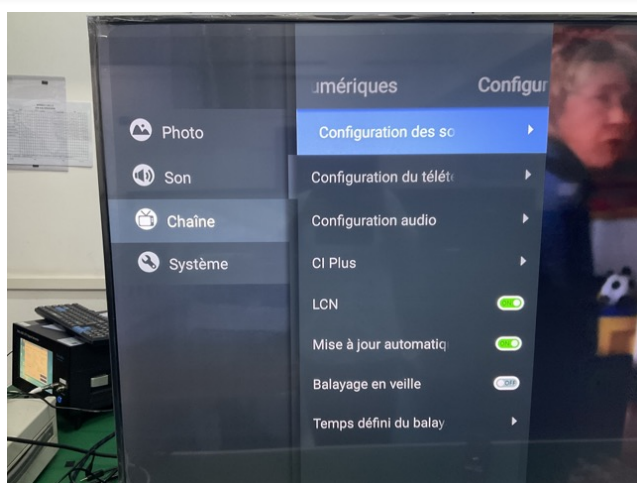

06/06/2023 12:14:45




06/06/2023 12:14:45




06/06/2023 12:14:45




06/06/2023 12:14:45

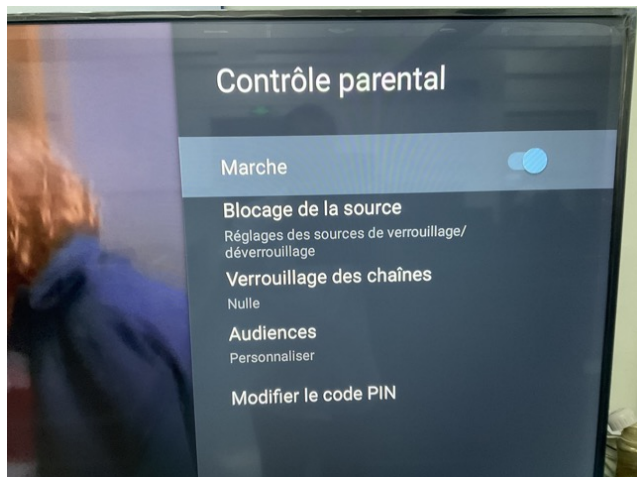


06/06/2023 12:14:45

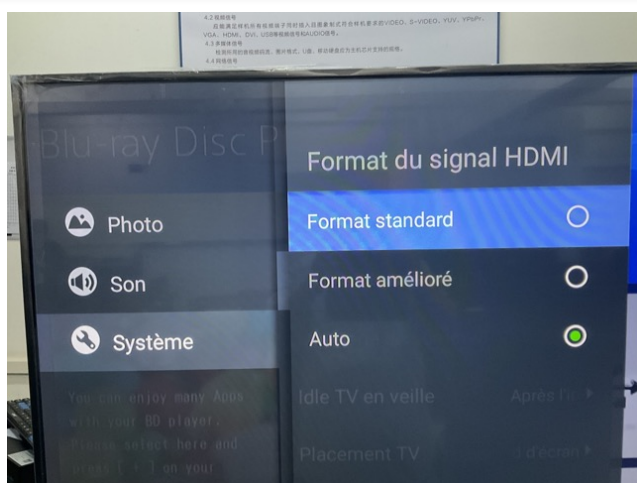

06/06/2023 12:14:45

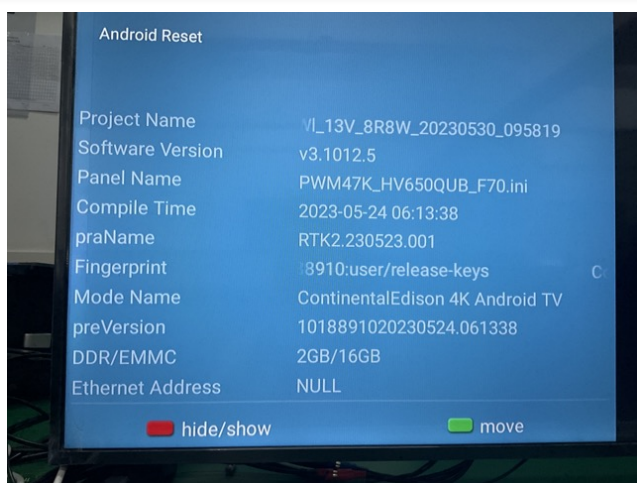

06/06/2023 12:14:45

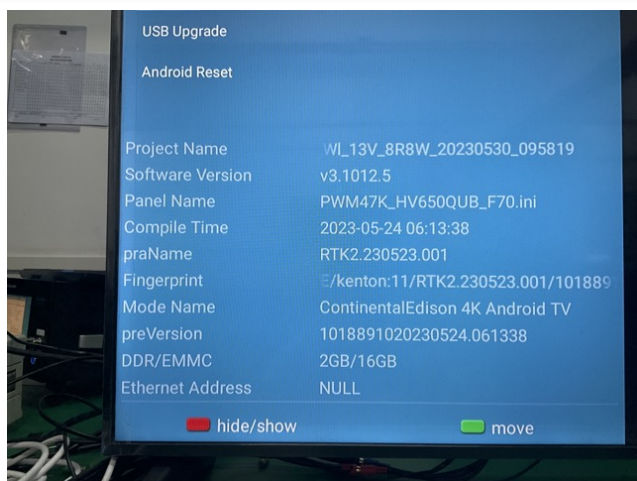





06/06/2023 12:14:45

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

5.6 / Software - EPG function

PASSED

ON

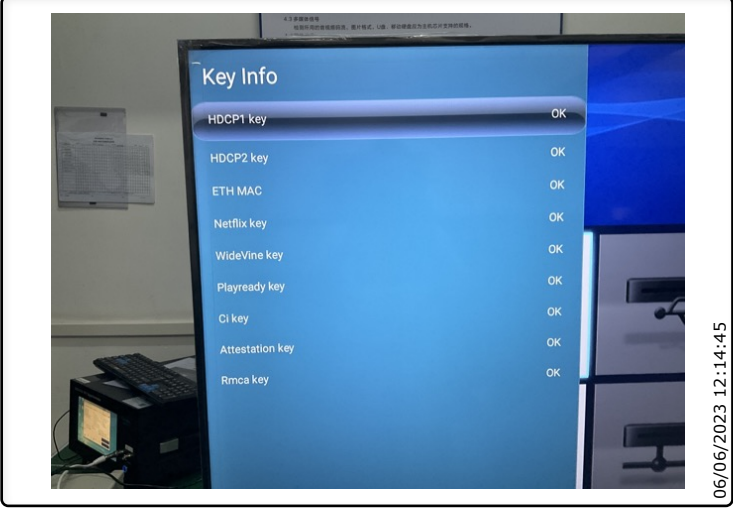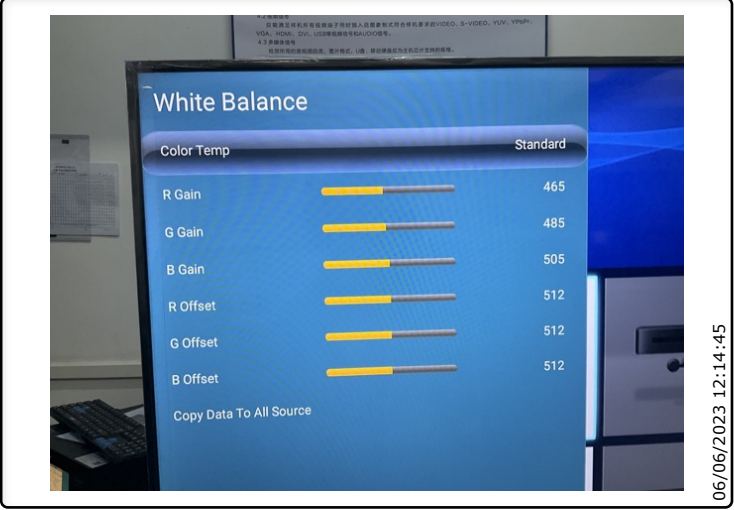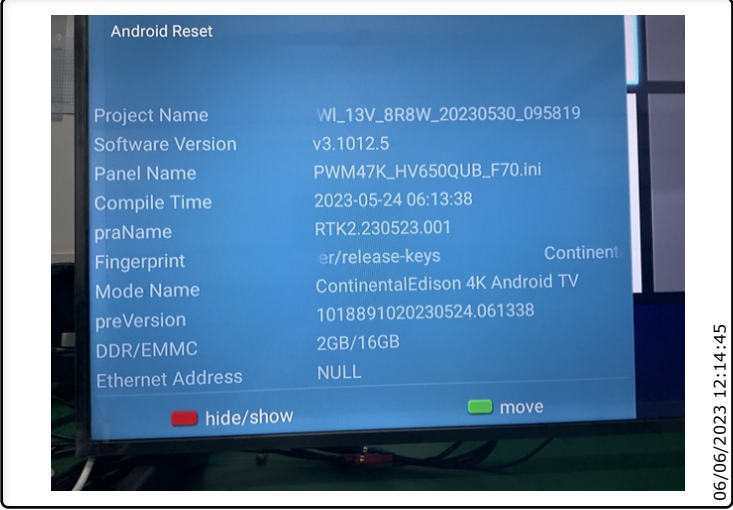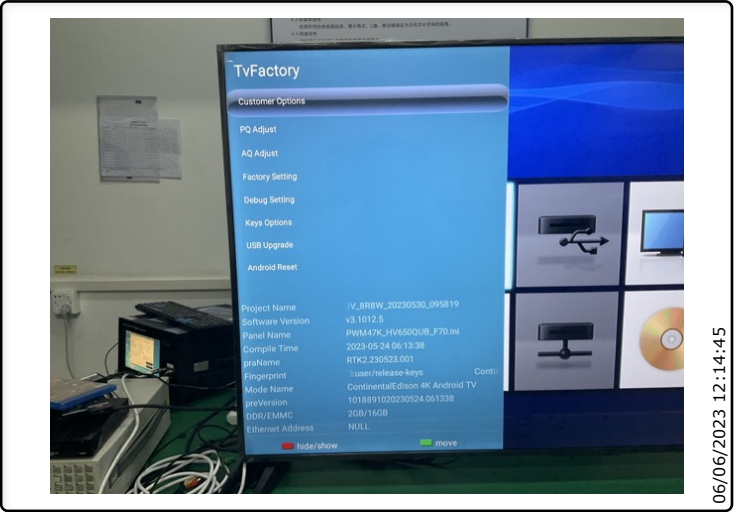

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

5.7 / Software - REC Function

PASSED



5.8 / Software - Timeshift



PASSED

No Timeshift key on Remote control (But user menu has Timeshift function, But users operation will be troublesome)。遥控器上没有 Timeshift 键。(但是用户菜单有Timeshift功能, 但是用户操作将会很麻烦)。---- Accepted by France



5.10 / Software - TOP Teletext

PASSED

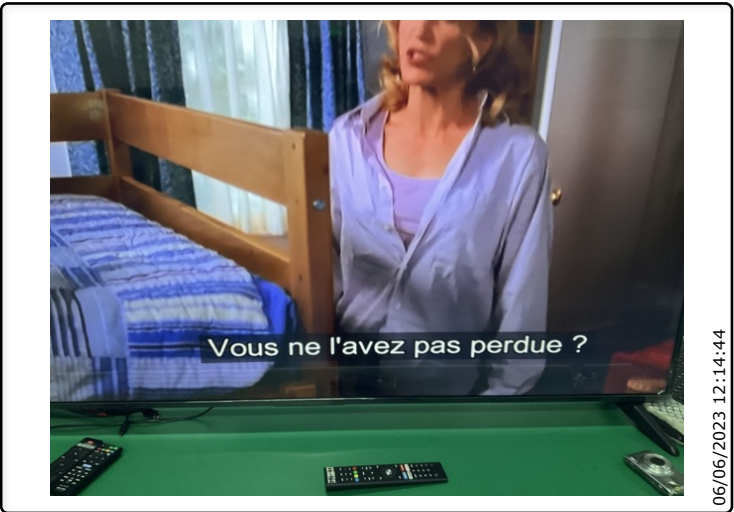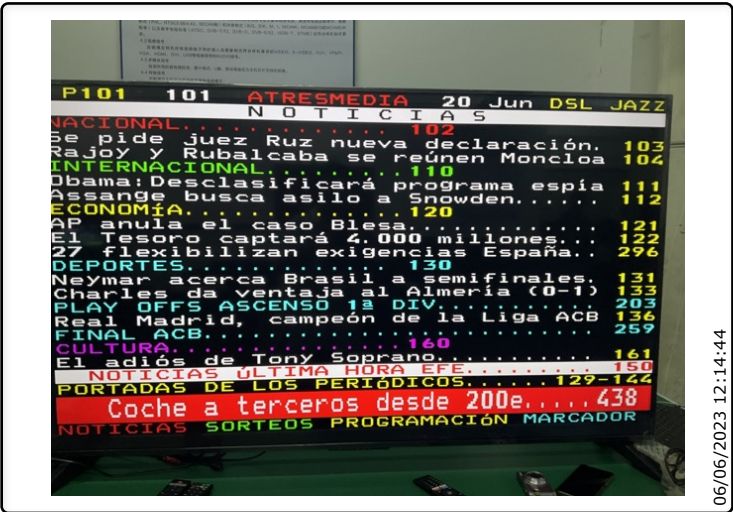

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

5.14 / Software - Remote control key

PASSED



6. PANEL

PASSED

6.1 / Panel - LED resolution

PASSED

3840X2160.1200:1



MMK ASIA LIMITED	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	




	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

6.3 / Panel - LED Display tester

PASSED

The brightness control functions only have a slight effect (亮度控制功能只有轻微效果)--Already fixed

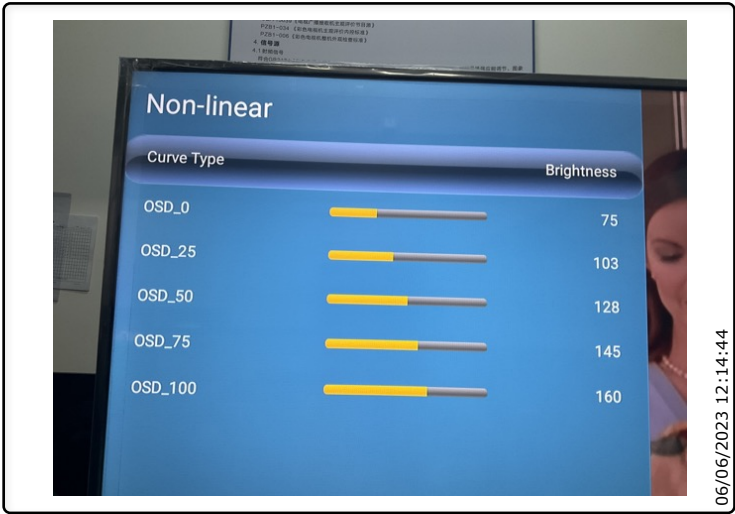



7. SYSTEM

PASSED

7.7 / System - CI Information

PASSED

Cannot read CI card information in Digital Channel Setup, If according to such operation:live Tv> press ok->TV options -> Channel options -> Common Interface -> Common Interface Slot, Can read CI information。But users operation will be troublesome。(在Digital Channel Setup 不能读CI 卡信息。 如果按照这样的操作:liveTv>按 ok->TV options -> Channel optoins -> Common Interface -> Common Interface Slot。可以读取CI 信息, 但是用户操作将会很麻烦)。---- Accepted by France

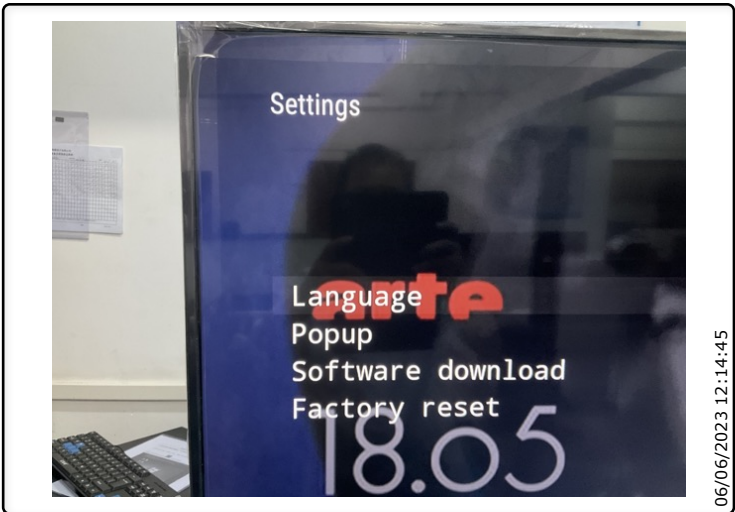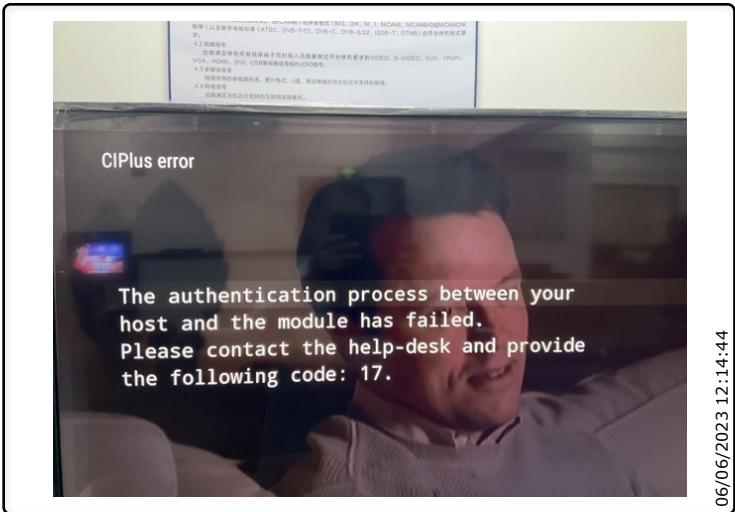


8. MECANICAL TEST

FAILED

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

8.1 / Mecanical test - DC plug

PASSED

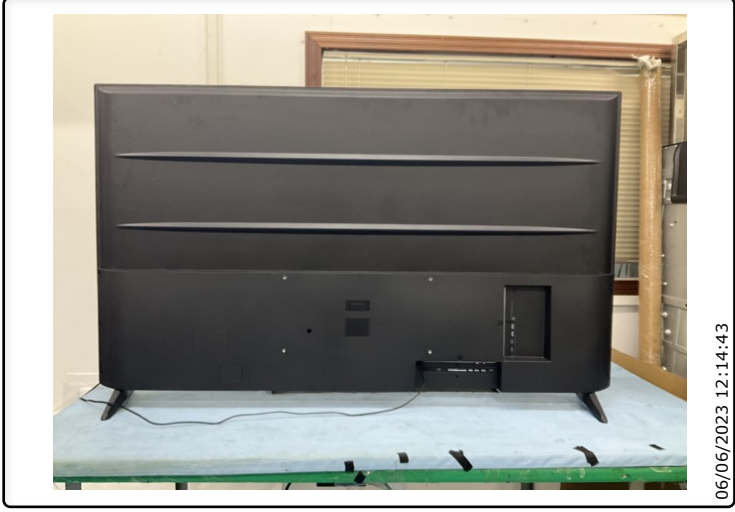

	Inspection report	Sample Testing
	Inspection number	INR-2305008
	Inspection Date	

8.7 / Mecanical test - Mechanical pressure test

PASSED

